

SHIP TO: IN STORE PICKUP

INVOICE TO: [REDACTED]
[REDACTED]
[REDACTED] SALT LAKE CITY UT 84120

Branch SALT LAKE CITY		
Date 07/25/24	Time 23:03:24 (B)	Page 02
Account No [REDACTED]	Phone No [REDACTED]	Inv No W13167
Ship Via		Purchase Order
		Salesperson 614

www.ditchwitchrockies.com

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
028294	YELLOW VAC	1	971214		
	PDM-500				
LINES SUPPLY TO TANK, BYPASS AND PRESSURE LINES AND HOSE.					
FI	FREIGHT IN			2	
P-1044	YELLOW VAC PUMP			1 N	
SUBLETP	FITTINGS			1	
SUBLETP	HYD HOSE			1	
SUBLETP	WATER HOSE			1	
SUBLETP	WATER PUMBING			1	
150-5506	NOZZLE (#02, 04			1 N	
150-5762	BULKHEAD (04NF-			1 N	
153-098	SPRAY HOSE (300			1	
	SPRAY HOSE (3000)				
153-461P	QDC BODY (3/8")			1	
213-419	PRESSURE GAUGE			1	
	PRESSURE GAUGE (5000 PSI)				
240UC	YELLOW VAC UNLO			1 N	
421BU	WATER PUMP BUSH			1 N	

110000006 SEGMENT TOTAL==> 4885.90

SEGMENT# 3 C 00071 NA 04/01/24 04/01/24 04/01/24
VACUUM LOW
VACUUM ISSUES. UNIT HAS LOW VACUUM. FOUND ENGINE WOULD NOT
REV UP TO FULL THROTTLE HAD TO MAKE SOME ADJUSTMENTS TO GET
FULL RPM AND STILL HAS LOW VACUUM. FOUND THE VAC FILTER
CANISTER IS RUSTED THROUGH THE BOTTOM AND WILL NEED TO BE
REPLACED. PULLED VAC CANISTER AND HAD A NEW BOTTOM WELDED ON
IT AND PAINTED
P-0500 PMD FILTER

3 N
CONTINUED ON PAGE 03

X

Customer Signature

Printed Name

Thank You For Your Business!

INVOICE TO: [REDACTED]
[REDACTED]
[REDACTED]

Branch SALT LAKE CITY		
Date 07/25/24	Time 23:03:24 (B)	Page 03
Account No [REDACTED]	Phone No [REDACTED]	Inv No W13167
Ship Via		Purchase Order
		Salesperson 614

www.ditchwitchrockies.com

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
028294	YELLOW VAC PDM-500	1	971214		
WELD/SUBLET WELDING 1 N					
LABOR FOR WELDING PROVIDED BY MATT AT BMF					

11000006 SEGMENT TOTAL==> 4144.65

SEGMENT# 4 C 00071 NA 04/01/24 04/01/24 04/01/24

MISC REPAIRS
INSTALLED ALL NEW ELECTRICAL CABLES GOING TO BATTERY,
ENGINE AND HYD PUMP AND ROUTED CORRECTLY. CUT PLATE AND
MADE A BATTERY HOLD DOWN BRACKET. INSTALLED ALL NEW BELTS
FOR BLOWER AND WATER PUMP. REMOVED AND REPLACED VAC FILTERS.
SECURED WATER TANK. UNIT
IS OPERATING CORRECTLY

SUBLETP	BATTERY CABLES	1
SUBLETP	BELTS/BOLTS	1

11000006 SEGMENT TOTAL==> 1194.44

SEGMENT# 5 C 00071 NA 04/01/24 04/01/24 04/01/24

UNIT NOT CHARGING
AFTER RUNNING UNIT, FOUND BATTERY IS NOT BEING CHARGED.
PULLED FRONT OF ENGINE APART TO TEST REGULATOR; IT IS NOT
TESTING TO SPEC. ORDERED AND INSTALLED NEW ALTERNATOR.
UNIT IS NOW CHARGING AGAIN.

BW300-30'	3"X30' HOSE	1
SUBLETP	REGULATOR	1

PARTS 380.00
CONTINUED ON PAGE 04

X

Customer Signature

Printed Name

Thank You For Your Business!

SHIP TO: IN STORE PICKUP

INVOICE TO: [REDACTED]
[REDACTED]
[REDACTED]

Branch SALT LAKE CITY		
Date 07/25/24	Time 23:03:24 (B)	Page 04
Account No [REDACTED]	Phone No 3 [REDACTED]	Inv No W13167
Ship Via		Purchase Order
		Salesperson 614

www.ditchwitchrockies.com

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
028294	YELLOW VAC	1	971214		
	PDM-500				
11000006				LABOR SUBLET SEGMENT TOTAL==>	827.57

***** WORK ORDER TOTALS *****

PARTS	
LABOR	
SUBLET	
SHOP SUPPLIES	
SUB TOTAL==>	
UT STATE 4.85%	
UT-SALT LAKE 2.4%	
UT-SA-SALT LAKE CITY 0.5%	
ON ACCOUNT	13586.28

JV

X

Customer Signature

Printed Name

Thank You For Your Business!

0:

SHIP TO: IN STORE PICKUP

INVOICE TO:

Branch SALT LAKE CITY *REPRINT*		
Date 07/25/24	Time 23:03:24 (B)	Page 01
Account No [REDACTED]	Phone No [REDACTED]	Inv No W13167
Ship Via	Purchase Order	
		Salesperson 614

www.ditchwitchrockies.com

SERVICE INVOICE

STK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
028294	YELLOW VAC PDM-500	1	971214		

SEGMENT# 1 C 00071 NA 04/01/24 04/01/24 04/01/24

NO START

INSPECT UNIT AND BUILD QUOTE FOR NEEDED REPAIRS.

PULLED UNIT IN SHOP FOR NO START/INSPECTION FOUND UNIT HAD
BAD FUEL AND INCORRECT LINES REMOVED FUEL TANK AND CLEANED
OUT INSTALLED ALL NEW FUEL LINE WITH NEW FILTER ADDED 5 GAL
OF FRESH GAS GOT UNIT TO START AND RUN

FI	FREIGHT IN	1	30.44	
PCX	PRIORITY CHARGE	2 N	15.00	
001-032	FUEL - DIESEL	4	6.47	
194-669	FUEL FILTER (04	1	8.59	

FUEL FILTER (04H-04H, IN-LINE)"

11000006

PARTS	
LABOR	
SEGMENT TOTAL==>	1399.91

SEGMENT# 2 C 00071 NA 04/01/24 04/01/24 04/01/24

WATER SYSTEM REPAIRS

LOOKED INTO WATER SYSTEM AND FOUND THE SUPPLY LINES FROM
THE TANK TO THE PUMP WERE BROKEN INSTALLED NEW FITTINGS AND
NEW BALL VALVE WITH
NEW SUPPLY LINES ON TANK AND WINTERIZE TANK. TESTED WATER
SYSTEM AND FOUND THE PUMP IS LEAKING OUT OF THE HEAD. UNIT
IS MISSING AN UNLOADER VALVE AND A PRESSURE GAUGE. THE
PRESSURE HOSE WILL NEED TO BE REPLACED.

PLUMBED ALL NEW WATER SYSTEM GOT ALL NEW
FITTING AND WATER PUMP AND UNLOADER PLUMBED UNLOADER AND
GAUGE TO WATER PUMP AND INSTALLED NEW VALVE FOR WATER AND
ANTIFREEZE SUPPLY LINES INSTALLED ALL NEW WATER SYSTEM

CONTINUED ON PAGE 02

X

Customer Signature

Printed Name

• **SERVICE CHARGES:** Accounts over 30 days are subject to a 1.5% service charge (annual rate 18%), and all costs of collection including reasonable attorney's fee.

• **RETURNS:** A restocking fee of 15% will be applied to all returned parts. Ditch Witch reserves the right to increase the restocking fee or deny returns for items with damaged packaging or any wear.

Thank You For Your Business!