

SERVICE INVOICE

[Redacted] [Redacted] [Redacted]		[Redacted] [Redacted] [Redacted]		Invoice Number: 1136699010719010322 Invoice Date: 6/29/2018 Location: 53 Work Order Number: 1863499 Payment Type: Account Tech:	Page: 1 of 24
Bus: [Redacted] Mob: [Redacted]	Prv: [Redacted]	Bus: [Redacted] Mob: [Redacted]	Prv: [Redacted]		

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

PWR-900-006 Retail

COMPLAINT:

POWER COMBINE INSPECTIONS

CORRECTION:

PERFORMED POWER COMBINE INSPECTIONS PER INSPECTIONS SHEET

Labor:	Parts:	OL&M:	Misc:	Sub-Total:
\$0.00	\$0.00	\$0.00		

9500/6949/FHDM/20 Retail

COMPLAINT:

03 SHAFT & BEARING FEEDER HOUSE DRUM - RECONDITION

CORRECTION:

RECONDITIONED FEEDER HOUSE DRUM SHAFT & BEARING

Removed mounting hardware and links.
 Removed front dust shield.
 Loosened and separated chain.
 Removed front drum.
 Replaced bearings and bearing retainers.
 Replaced shaft as necessary.
 Reassembled front drum.
 Adjusted chain tension.



JOHN DEERE

Part Number	Description	Quantity	Unit Price	Net Price	Extended Price	Taxed Ind
11M7059	COTTER PIN	1.00				
14M7291	FLANGE NUT	1.00				
19M7399	CAP SCREW	1.00				
45M7040	Pin Fastener	2.00				
H131087	BUSHING	2.00				
H138753	HOUSING	2.00				
JD8551	Eccentric Locking Collar	2.00				

SERVICE INVOICE

Bus: [REDACTED] Prv: [REDACTED] Mob: [REDACTED] Mob: [REDACTED]		Invoice Number: 1136699010719010322 Invoice Date: 6/29/2018 Location: 53 Work Order Number: 1863499 Payment Type: Account Tech: [REDACTED]	Page: 2 of 24
--	--	--	---------------

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/6949/FHDM/20 Retail JD8552 Ball Bearing 2.00 N

Labor:	Parts: \$	OL&M:	Misc:	Sub-Total:
--------	-----------	-------	-------	------------

9500/3351/CV/10 Retail
 COMPLAINT:
 04 BEARING CONVEYOR - REMOVE & INSTALL

CORRECTION:
 REMOVED & INSTALLED CONVEYOR BEARING

Removed feeder house drive chain and feeder house conveyor chain.
 Opened feed plate door to access bottom side of shaft.
 Removed slip clutch from upper shaft.
 Loosened set screws on gears.
 Removed stripper plates from each side of feeder house.
 Slid gears to the center off shaft.
 Removed 6 bolts from bearing holders.
 Slid shaft to the right off feeder house.
 Removed shaft out the bottom of the feeder house.
 Removed bearings from each end of shaft.
 Put new bearings onto shaft.
 Reinstalled in reverse order.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AE46606	Bearing	1.00				
AH109788	Tapered Roller Bearing	1.00				
AH116232	Chain Sprocket	1.00				
H99303	Washer	1.00				

Labor:

9500/6070/FD/10 Retail
 COMPLAINT:
 05 PLATES FEED - REMOVE & INSTALL

SERVICE INVOICE

[Redacted] [Redacted] [Redacted]		[Redacted] [Redacted] [Redacted]		Invoice Number: 1136699010719010322 Invoice Date: 6/29/2018 Location: 53 Work Order Number: 1863499 Payment Type: Account
Bus: [Redacted] Prv: [Redacted] Mob: [Redacted]	Bus: [Redacted] Prv: [Redacted] Mob: [Redacted]	Tech: [Redacted]		Page: 3 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/6070/FD/10 Retail

CORRECTION:

REMOVED & INSTALLED FEED PLATES

Raised feeder house to full up position and lowered safety stop.

Opened stone trap door.

Opened upper feeder house door seal.

Removed feed plate and hinge.

Installed in reverse order.

REMOVED FEED PLATE DOOR. CUT A PIECE OF METAL TO PUT BY THE HINGE. INSTALLED AND WELDED UP IRON.

INSTALLED FEED PLATE.

Labor:

9500/4164/LFHR/10 Retail

COMPLAINT:

06 SPROCKET LOWER FEEDER HOUSE RIGHT HAND - REMOVE & INSTALL

CORRECTION:

REMOVED & INSTALLED LOWER FEEDER HOUSE RIGHT HAND SIDE SPROCKET

Loosened and removed feeder house drive chain.

Loosened set screw if applicable.

Slid off sprocket and replaced.

Set to specification.

Reinstalled chain and tightened to specification.

Ran and verified operation.



JOHN DEERE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH125782	Chain Sprocket	1.00				N

Labor:

9500/3353/SAB/25 Retail

COMPLAINT:

07 BEVEL GEAR SHOE AUGER BACKLASH - ADJUST

SERVICE INVOICE

Customer Information [Redacted] [Redacted] [Redacted]		Invoice Information Invoice Number: 1136699010719010322 Invoice Date: 6/29/2018 Location: 53 Work Order Number: 1863499 Payment Type: Account	
Technician Information Bus: [Redacted] Priv: [Redacted] Mob: [Redacted]		Tech: [Redacted] Page: 4 of 24	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/3353/SAB/25 Retail

CORRECTION:

ADJUSTED SHOE AUGER BEVEL GEAR BACKLASH

Applied PM 38654 where gears were and spun for full coverage.
 Installed the woodruff keys.
 Aligned gears until they were fully meshed and backed off 0.75 mm or 1/32 in.
 Tightened clamps.
 Reassembled in reverse.

Labor:

9500/1163/BG/A/10 Retail

COMPLAINT:

08 KEY BEVEL GEAR ALL - REMOVE & INSTALL

CORRECTION:

REMOVED & INSTALLED ALL BEVEL GEAR KEYS

Locked feeder house up.
 Removed final drive shaft from left side.
 Loosened bolts on clamps.
 Slid bevel gear away.
 Removed key.
 Installed in reverse order.



JOHN DEERE

Part Number	Description	Quantity	Unit Price	Net Price	Extended Price	Taxed Ind
H167587	KEY	6.00				N

Labor:

9500/6060/CFH/A/10 Retail

COMPLAINT:

09 RASP BARS CHROME WITHOUT FEEDER HOUSE REMOVED - REMOVE & INSTALL

CORRECTION:

SERVICE INVOICE

		Invoice Number:	1136699010719010322
		Invoice Date:	6/29/2018
		Location:	53
		Work Order Number:	1863499
		Payment Type:	Account
Tech:		Page: 5 of 24	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/6060/CFH/A/10 Retail
REMOVED & INSTALLED ALL CHROME RASP BARS WITHOUT FEEDER HOUSE REMOVED

Lowered feeder house and removed key.
Removed upper cylinder door and plate.
Removed pin from dual range cylinder gear box.
Removed all cylinder filler plates.
Replaced rasp bars one at a time.
Tightened cap screw with square washer and locked nut to spec.
Installed filler plates.
Installed top feeder house plate and upper cylinder door.
Ran combine and checked operation.

CUSTOMER PROVIDED RASP BARS

Labor:

9500/6914/9 Retail
COMPLAINT:
10 CONCAVE - LEVEL

CORRECTION:
LEVELED CONCAVE

Leveled concave per TM1401 120-05-31.
Installed remote control to concave actuator.
Adjusted concave to manufacturer specs.
Checked for full range of motion.
Adjusted indicator.



JOHN DEERE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7276	Nut	2.00				N
H143610	EYEBOLT	1.00				N

Labor:

SERVICE INVOICE


	Invoice Number:	1136699010719010322
	Invoice Date:	6/29/2018
	Location:	53
	Work Order Number:	1863499
	Payment Type:	Account
Tech:		Page: 6 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/4251/13 Retail
 COMPLAINT:
 11 BRAKE ASSEMBLY - BLEED

CORRECTION:
 BLEED BRAKE ASSEMBLY AND ADJUST BRAKES

Left cap loose and put a 36 in. clear plastic hose on right bleed screw on master cylinder.
 Raised it higher than the screw and end in a container and opened 1/4 of a turn.
 Added fluid to reservoir until there were no air bubbles in the tube.
 Closed screw and locked peddles together.
 With tube still in place opened 1/4 turn and slowly pressed peddles to the floor.
 Installed tube on left slave cylinder and opened bleed screw.
 Pressed peddles to the floor until no air bubbles.
 Installed tube on right slave cylinder and unlocked peddles.
 Opened bleed screw and pressed peddle to the floor, did until no air bubbles.
 Installed on left bleed screw of master cylinder and locked peddle together.
 Opened 1/4 of turn and peddles to floor until no air bubbles.
 Road tested.

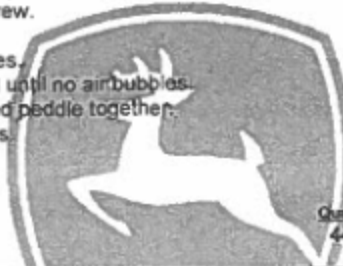

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
PMK2812-0406	BULK HOSE	44.00				

Labor:

9500/6404/UTD/10 Retail
 COMPLAINT:
 12 CHAIN UPPER TAILING DRIVE - REMOVES & INSTALL

CORRECTION:
 REMOVED & INSTALLED UPPER TAILING DRIVE CHAIN

Removed shield and loosened tightener.
 Removed chain.
 Reassembled in reverse order.
 USED CHAIN THAT CUSTOMER PROVIDED.

JOHN DEERE

SERVICE INVOICE

Invoice Number:	1136699010719010322
Invoice Date:	6/29/2018
Location:	53
Work Order Number:	1863499
Payment Type:	Account
Tech:	Page: 7 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/6404/UTD/10 Retail

Labor:

9500/4179/UT/B/10 Retail

COMPLAINT:

13 PADDLES BOTH UPPER TAILING - REMOVE & INSTALL

CORRECTION:

REMOVED & INSTALLED BOTH UPPER TAILING PADDLES

Opened and removed paddle access door from top of tailing elevator.
Loosened and removed paddle drive chain.
Removed mounting bolts and nuts from paddle.
Removed paddle.
Rotated paddle shaft and repeated for other paddle.
Installed in reverse order.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H131639	PADDLE	4.00				

Labor:

9500/1357/UFH/10 Retail

COMPLAINT:

14 BELT UPPER FEEDER HOUSE - REMOVE & INSTALL

CORRECTION:

JOHN DEERE

SERVICE INVOICE

	Invoice Number:	1136699010719010322
	Invoice Date:	6/29/2018
	Location:	53
	Work Order Number:	1863499
	Payment Type:	Account
	Tech:	Page: 8 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/1357/UFH/10 Retail

REMOVED & INSTALLED UPPER FEEDER HOUSE BELT

Loosened tensioner for upper belt.
 Removed strap on electric clutch module.
 Removed bolt on reel pump brace arm and twisted arm up to get belt out.
 Loosened reverser bracket.
 Removed belt for reverser.
 Installed new belt.

Reinstalled all parts in reverse order.
 HAD TO REMOVE THE FEEDER HOUSE REVERSER BELT TO GET TO THE UPPER FEEDER HOUSE DRIVE BELT.
 INSTALLED NEW FEEDER HOUSE UPPER DRIVE BELT. INSTALLED REVERSER BELT. ADJUSTED TENSION ON
 REVERSER BELT. TIGHT ED UP UPPER BELT. USED BELT THE CUSTOMER PROVIDED.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH209763	SEAL	1.00				
AH211578	SEAL	1.00				
H129208	PIVOT	1.00				
H203610	BOOT	1.00				
H77698	Tie Band, 14.5-in.	1.00				



Labor:

9500/6203/RDS/10 Retail

COMPLAINT:

15 ACTUATOR REEL SPEED - REMOVE & INSTALL

CORRECTION:

JOHN DEERE

SERVICE INVOICE

	Invoice Number:	1136699010719010322
	Invoice Date:	6/29/2018
	Location:	53
	Work Order Number:	1863499
	Payment Type:	Account
Tech:		Page: 9 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/6203/RDS/10 Retail
REMOVED & INSTALLED REEL SPEED ACTUATOR

Unplugged reel speed actuator.
Removed bolts from bracket.
Lifted off actuator.
Transferred parts to new actuator.
Installed actuator on valve.
Attached to combine.
Plugged electrical back in.
Verified operation.
REMOVED REEL SPEED ACTUATOR. TOOK ACTUATOR APART AND CLEANED UP. CHECKED ALL COMPONENTS, OK.
TIGHTENED UP SCREWS IN BOARD. INSTALLED COVER. INSTALLED ACTUATOR BACK ON MACHINE. BROUGHT IN
HEADER AND TESTED, WORKS OK.

Labor:

9500/1357/BTR/25 Retail
COMPLAINT:
16 BELT BEATER - ADJUST

CORRECTION:
ADJUSTED BEATER BELT

Loosened tension bolt jam nut.
Turned tension nut till washer lined up with gauge.
Tightened jam nut.



JOHN DEERE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H129207	PIVOT	1.00				

Labor:

9500/6203/CF/10 Retail
COMPLAINT:
17 ACTUATOR CLEANING FAN - REMOVE & INSTALL

SERVICE INVOICE

					Invoice Number: 1136699010719010322
					Invoice Date: 6/29/2018
					Location: 53
					Work Order Number: 1863499
					Payment Type: Account
					Tech: Page: 0 of 24
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:	
JOHN DEERE 9500	4251	H09500X635890	215574PLP		

9500/6203/CF/10 Retail

CORRECTION:

REMOVED ACTUATOR. INSTALLED NEW WORM GEAR AND PARTS. INSTALLED ACTUATOR. WHEN TEST RUNNING MACHINE, THE ACTUATOR WENT BAD. INSTALLED NEW ACTUATOR KIT ON MACHINE. HAD TO MAKE A PIN FOR THE NEW ACTUATOR HOUSING.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7059	COTTER PIN	1.00				
14M7382	16MM LH JAM NUT	4.00				
AH206452	BUSHING	2.00				
AH210762	Shaft	1.00				
H177749	Washer	1.00				
H205401	TRUNNION	1.00				
H25099	SNAP RING	1.00				
KXE10059	Actuator Kit	1.00				
R64059	Washer	1.00				



Labor: :

9500/5160/UCF/10 Retail

COMPLAINT:

18 SHEAVES UPPER CLEANING FAN - REMOVE & INSTALL

CORRECTION:

REMOVED BELT. REMOVED OUTER ADJUSTMENT BRACKET. REMOVED OUTER SHEAVE. CLEANED UP THE SHAFT. WELDED UP THE PIN HOLE THAT LOCKS THE TWO PULLEYS. INSTALLED NEW BEARING ON OUTER SHEAVE. INSTALLED NEW OUTER SHEAVE. INSTALLED NEW BELT. REMOVED ACTUATOR. DISASSEMBLED AND INSTALLED NEW SHAFT. PUT ACTUATOR BACK ON THE MACHINE. INSTALLED ADJUSTMENT BRACKET.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH127496	Pulley	1.00				

SERVICE INVOICE

	Invoice Number:	1136699010719010322
	Invoice Date:	6/29/2018
	Location:	53
	Work Order Number:	1863499
	Payment Type:	Account
Tech:		Page: 1 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/5160/UCF/10 Retail
H140404 V-Belt 1.00

Labor:

9500/3060/PIT/10 Retail
COMPLAINT:
19 SHAFT PITMAN - REMOVE & INSTALL

CORRECTION:

REMOVED SHOE DRIVE BELT. REMOVED LEFT SIDE PITMAN ARMS AND BEARINGS. REMOVED THE SHOE SHAFT BEARING. TOOK THE PULLEY OFF OF THE RIGHT SIDE. REMOVED BEARING FLANGE TO THE SHOE SHAFT. REMOVED THE PITMAN SHAFT. GOT USED PARTS. TOOK APART THE CLEANING FAN LEFT SIDE. REMOVED THE DRIVE PULLEYS. REMOVED THE BEARING. CUT OFF THE SHOE SHAFT BRACKET. INSTALLED UPDATED SHOE SHAFT BEARING BRACKET/ CLEANING FAN BEARING BRACKET. INSTALLED A NEW BEARING ON THE CLEANING FAN. INSTALLED DRIVE PULLEYS. INSTALLED SHOE SHAFT BEARING. WENT TO THE RIGHT SIDE AND DID THE SAME THING. INSTALLED SHOE SHAFT. TOOK APART THE PITMAN ARMS AND INSTALLED NEW BEARINGS. INSTALLED PITMAN BEARINGS. CENTERED SHAFT ON THE RIGHT SIDE FOR THE BELT. TIGHTENED UP THE LOCK COLLARS ON THE SHOE SHAFT.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH125975	Ball Bearing	2.00				
AH139297	Ball Bearing	1.00				
AH225510	Bearing	1.00				
AL14674	Locking Collar	1.00				
AZ10044	Locking Collar	1.00				
H133621	Pressed Flanged Housing	1.00				
H150268	SHAFT KEY	1.00				
H84026	HOOK	8.00				

Labor:

9500/6404/TEP/25 Retail
COMPLAINT:

SERVICE INVOICE

Invoice Number: **1136699010719010322**
Invoice Date: **6/29/2018**
Location: **53**
Work Order Number: **1863499**
Payment Type: **Account**
Tech: _____ Page: 2 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/6404/TEP/25 Retail
20 CHAIN TAILING ELEVATOR PADDLE - ADJUST

CORRECTION:
ADJUSTED TAILING ELEVATOR PADDLE CHAIN.

Labor: _____

9500/6404/LT/25 Retail
COMPLAINT:
21 CHAIN LOWER TAILING DRIVE - ADJUST

CORRECTION:
ADJUSTED LOWER TAILING DRIVE CHAIN.
USED CHAIN THAT CUSTOMER PROVIDED.



Labor: _____

9500/5077/PRS/30 Retail
COMPLAINT:
22 ACCUMULATOR PRESSURE - TEST

CORRECTION:
TESTED PRESSURE ACCUMULATOR

Checked accumulator pressure.
Verified that it is within Deere specs.
HOOKED UP NITROGEN BOTTLE AND GAUGE TO ACCUMULATORS. ADJUSTED FRONT ACCUMULATOR DOWN TO 1100
PSI. REAR ACCUMULATOR IS RIGHT ON SPEC.

JOHN DEERE

Labor: _____

9500/5051/HF/10 Retail
COMPLAINT:



SERVICE INVOICE

	Invoice Number:	1136699010719010322
	Invoice Date:	6/29/2018
	Location:	53
	Work Order Number:	1863499
	Payment Type:	Account
Tech:		Page: 3 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/5051/HF/10 Retail

23 VALVE HYDRAULIC STACK - REMOVE & INSTALL

CORRECTION:

REMOVED & INSTALLED HYDRAULIC STACK VALVE

Removed and installed hydraulic stack valve.

Ran and verified proper operation.

TOOK MACHINE AROUND TO THE WASH BAY AND WASHED OFF VALVE STACK. INSTALLED A NEW NUT ON THE WIRING HARNESS DUE TO BEING BROKE. DID NOT SEE ANYTHING LEAKING AFTER RUNNING MACHINE.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R77458	CONNECTOR	1.00				
R78064	ELECTRICAL	2.00				

Labor:



9500/4461/HSV/E/10 Retail

COMPLAINT:

26 LINE HYDRAULIC STACK VALVE EACH - REMOVE & INSTALL

CORRECTION:

REMOVED & INSTALLED EACH HYDRAULIC STACK VALVE LINE

Removed and installed hydraulic stack valve line.

Ran and verified no leaks were present.

REMOVED LINE AND CAPED OFF. BRAZED LINE WHERE HOLE WAS. PUT A PIECE OF HOSE OVER THE BRAZE TO KEEP ANOTHER LINE FROM RUBBING ON THE STEEL LINE. TIED UP THE PRESSURE LINE, HOSE. INSTALLED THE STEEL LINE.

Labor:

9500/1357/SCJD/10 Retail

COMPLAINT:

27 BELT STRAW CHOPPER JACKSHAFT FRONT DRIVE - REMOVE & INSTALL

SERVICE INVOICE

				Invoice Number:	1136699010719010322
				Invoice Date:	6/29/2018
				Location:	53
				Work Order Number:	1863499
				Payment Type:	Account
				Tech:	Page: 4 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/1357/SCJD/10 Retail

CORRECTION:

REMOVED & INSTALLED STRAW CHOPPER JACKSHAFT FRONT DRIVE BELT.
INSTALLED NEW SENSOR AND TONE WHEEL ON CHOPPER SHAFT.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7280	Bolt	1.00				
AH131320	Switch	1.00				
AH161839	MAGNET	1.00				
H125380	V-Belt	1.00				
H168924	Stainless Steel Screw	2.00				
P48347	O-Ring	2.00				
TY6341	SD Polyurea Grease	2.00				

Labor:

9500/7052/CHR/10 Retail

COMPLAINT:

28 FRAME CHAFFER - REMOVE & INSTALL

CORRECTION:

REMOVED CHAFFER AND SIEVE ELEMENTS. REMOVED REAR SHAKER PAN. UNWIRED GRAIN LOSS SENSORS. REMOVED SHOE DRIVE BELT. REMOVED CHAFFER FRAME CUT TIN SIDE SUPPORTS AWAY FROM THE FRAME. GOT SOME THICKER IRON AND WELDED IN TO PLACE ON THE SIDES OF THE CHAFFER FRAME. REMOVED SIDE SEALS. INSTALLED NEW SIDE SEALS AND FLAT STRAP. RIVETED ON. INSTALLED CHAFFER FRAME AND CENTERED. INSTALLED SIEVE AND CHAFFER ELEMENTS. INSTALLED REAR SHAKER PAN. INSTALLED GRAIN LOSS SENSOR WIRING HARNESS. REMOVED REAR SHOE SUPPLY AUGER BLOCKS AND HOUSING. INSTALLED 2 NEW BLOCKS ON THE SECOND SHOE AUGER. INSTALLED REAR SHOE SUPPLY AUGER HOUSING.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7059	COTTER PIN	1.00				
19M7732	CAP SCREW	2.00				
19M7943	CAP SCREW	2.00				
19M8486	CAP SCREW	-2.00				

SERVICE INVOICE

	Invoice Number:	1136699010719010322
	Invoice Date:	6/29/2018
	Location:	53
	Work Order Number:	1863499
	Payment Type:	Account
Tech:		Page: 5 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/7052/CHR/10 Retail

H129207	PIVOT	1.00
H131169	V-Belt	1.00
H137188	Seal	2.00
H142188	Bearing	2.00
H175540	SEAL	2.00

Labor:

9500/3351/RSW/A/10 Retail

COMPLAINT:

29 BEARINGS REAR STRAW WALKER ALL - REMOVE & INSTALL

CORRECTION:

REMOVED REAR STRAW WALKER BLOCKS AND SHAVED OFF MATERIAL ON BLOCKS TO TIGHTEN BLOCKS UP ON CRANKS. RE-INSTALLED BLOCKS AND CHECKED STRAW WALKER TIMING.

Labor:

9500/1909/SWG/E/10 Retail

COMPLAINT:

30 SENSOR STRAW WALKER GRAIN LOSS EACH - REMOVE & INSTALL

CORRECTION:

REMOVED & INSTALLED EACH STRAW WALKER GRAIN LOSS SENSORS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE55969	Grain Loss Sensor	2.00				

Labor:

9500/6933/CP/20 Retail

COMPLAINT:

SERVICE INVOICE

	Invoice Number:	1136699010719010322
	Invoice Date:	6/29/2018
	Location:	53
	Work Order Number:	1863499
	Payment Type:	Account
Tech:		Page: 6 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X835890	215574PLP	

9500/6933/CP/20 Retail
32 KNIFE BANK CHOPPER - RECONDITION

CORRECTION:
RECONDITIONED CHOPPER KNIFE BANK

Removed lock pin from left side.
Removed rod.
Made necessary repairs.
Installed in reverse order.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH89918	BRACKET	3.00				
Labor:						

9500/1909/HVT/E/10 Retail
COMPLAINT:
33 SENSOR HARVEST TRAK EACH - REMOVE & INSTALL

CORRECTION:
REMOVED & INSTALLED EACH HARVEST TRAK SENSOR

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AXE55969	Grain Loss Sensor	1.00				
Labor:						

9500/4323/SRC/E/10 Retail
COMPLAINT:
34 STEERING CYLINDER BALL JOINT - REMOVE & INSTALL

CORRECTION:
REMOVED & INSTALLED STEERING CYLINDER BALL JOINT.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

SERVICE INVOICE

				Invoice Number: 1136699010719010322
				Invoice Date: 6/29/2018
				Location: 53
				Work Order Number: 1863499
				Payment Type: Account
				Tech: Page: 7 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/4323/SRC/E/10 Retail
AH204612 Tie Rod End 2.00

Labor:

9500/7559/SPD/LS/10 Retail
COMPLAINT:
35 BUSHINGS SPINDLE - REMOVE & INSTALL (Left side)

CORRECTION:
REMOVED & INSTALLED LEFT SIDE SPINDLE BUSHING

Jacked up and supported one side of rear axle.
Removed wheel and tie rod.
Attached appropriate lifting device.
Removed cap screws and pins from top and bottom of spindle pivot.
Removed spindle from pivot bracket.
Replaced bushings and seals.
Reinstalled in reverse order.
Greased spindle pivot bushings.
Torqued all hardware including wheel bolts to proper specification.



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H102206	Thrust Bearing	2.00				
H158884	BUSHING	3.00				

Labor:

9500/7559/SPD/RS/10 Retail
COMPLAINT:
36 BUSHINGS SPINDLE - REMOVE & INSTALL (Right side)

CORRECTION:

SERVICE INVOICE

Invoice Number:	1136699010719010322
Invoice Date:	6/29/2018
Location:	53
Work Order Number:	1863499
Payment Type:	Account
Tech:	Page: 8 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/7559/SPD/RS/10 Retail

REMOVED & INSTALLED RIGHT SIDE SPINDLE BUSHING

Jacked up and supported one side of rear axle.
 Removed wheel and tie rod.
 Attached appropriate lifting device.
 Removed cap screws and pins from top and bottom of spindle pivot.
 Removed spindle from pivot bracket.
 Replaced bushings and seals.
 Reinstalled in reverse order.
 Greased spindle pivot bushings.
 Torqued all hardware including wheel bolts to proper specification.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H102206	Thrust Bearing	2.00				
H158884	BUSHING	2.00				
R78027	COVER	1.00				

Labor:

9500/1427/E/10 Retail

COMPLAINT:

37 LIGHT ASSEMBLY EXTERNAL EACH - REMOVE & INSTALL

CORRECTION:

REMOVED & INSTALLED EACH EXTERNAL LIGHT ASSEMBLY

Removed screws or bolt that holds assembly on machine.
 Unhooked harness and removed assembly.
 Installed in reverse order.
 CHECKED LIGHTS. BULBS WERE OK. DIAGNOSTICS LEAD TO MAIN CIRCUIT BOARD FAILURE. INSTALLED NEW CIRCUIT BOARD. ALL CHECKS OK.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH122139	Circuit Breaker	1.00				
AH145699	Circuit Board	1.00				

SERVICE INVOICE

Invoice Number:	1136699010719010322
Invoice Date:	6/29/2018
Location:	53
Work Order Number:	1863499
Payment Type:	Account
Tech:	Page: 9 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/1427/E/10 Retail
AH201526 RELAY 2.00

Labor:

9500/9002/CRH/62 Retail
COMPLAINT:
38 COMBINE CRACKS & HOLES - WELD

CORRECTION:
WELDED COMBINE CRACKS & HOLES

Cleaned area and prepared area to be welded.
Welded cracks and holes as required.
Painted as required.
WELDED BRACES ON RIGHT SIDE OF SEPARATOR SHELL TO REINFORCE SIDE SHEET THAT HAD MULTIPLE CRACKS.



Labor:

9500/1047/PCV/10 Retail
COMPLAINT:
39 PISTON PRIMARY COUNTERSHAFT VARIABLE SPEED DRIVE - REMOVE & INSTALL

CORRECTION:
REMOVED & INSTALLED PRIMARY COUNTERSHAFT VARIABLE SPEED DRIVE PISTON

Started and ran separator.
Slowed cylinder speed to the slowest speed.
Shut off machine.
Disconnected hydraulic oil line.
Removed six cap screws from piston assembly.
Removed piston.
Reassembled in reverse order.

JOHN DEERE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

SERVICE INVOICE

Invoice Number:	1136699010719010322
Invoice Date:	6/29/2018
Location:	53
Work Order Number:	1863499
Payment Type:	Account
Tech:	Page:0 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/1047/PCV/10 Retail		
H97306	SEAL	1.00

Labor:

9500/5183/SCT/10 Retail
 COMPLAINT:
 40 PULLEY SECONDARY COUNTERSHAFT TIGHTENER - REMOVE & INSTALL

CORRECTION:
 REMOVED & INSTALLED SECONDARY COUNTERSHAFT TIGHTENER PULLEY

Removed secondary countershaft belt shield.
 Loosened secondary belt.
 Removed tightener pulley.
 Reassembled in reverse order.
 Adjusted belt.

CUSTOMER PROVIDED PARTS



Labor:

9500/1357/SSW/10 Retail
 COMPLAINT:
 41 BELT SHOE STRAW WALKER CONVEYOR AUGER - REMOVE & INSTALL

CORRECTION:
 REMOVED & INSTALLED SHOE STRAW WALKER CONVEYOR AUGER BELT

Loosened and removed clean grain elevator belt.
 Loosened and removed tailings elevator belt.
 Loosened and removed secondary countershaft belt.
 Loosened shoe straw walker conveyor auger belt adjuster and removed belt.
 Reassembled in reverse order.
 Adjusted all belts.

JOHN DEERE

SERVICE INVOICEInvoice Number: **1136699010719010322**Invoice Date: **6/29/2018**Location: **53**Work Order Number: **1863499**Payment Type: **Account**Tech: **Page:1 of 24**

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/1357/SSW/10 Retail**Labor:****9500/5163/CGEA/10 Retail****COMPLAINT:****43 BOLT CLEAN GRAIN ELEVATOR CHAIN ADJUSTING - REMOVE & INSTALL****CORRECTION:****REMOVED & INSTALLED CLEAN GRAIN ELEVATOR CHAIN ADJUSTING BOLT**

Loosened and removed jam nut.

Removed bolt from mount.

Replaced and assembled in reverse order.

ALSO ADJUSTED CLEAN GRAIN ELEVATOR CHAIN.**Job Total:****9500/7358/CGEA/10 Retail****COMPLAINT:****44 BRACKET CLEAN GRAIN ELEVATOR CHAIN ADJUSTING - REMOVE & INSTALL****CORRECTION:****REMOVED & INSTALLED CLEAN GRAIN ELEVATOR CHAIN ADJUSTING BRACKET**

Removed shield.

Loosened and removed belt.

Removed pulleys.

Removed bearing.

Removed and installed bracket.

Reassembled and adjusted chain.

JOHN DEERE**Labor:**

SERVICE INVOICE

Invoice Number:	1136699010719010322
Invoice Date:	6/29/2018
Location:	53
Work Order Number:	1863499
Payment Type:	Account
Tech:	Page:2 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/1357/FND/10 Retail

COMPLAINT:

47 BELT FAN DRIVE - REMOVE & INSTALL

CORRECTION:

REMOVED & INSTALLED FAN DRIVE BELT

Removed fan belt drive tightener.

Removed fan drive belt.

Installed new fan drive belt.

Installed fan belt drive tightener.

Ran and verified operations.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AE41319	GAUGE	2.00				
AH96292	Idler	1.00				
H132808	V-Belt	1.00				
H134214	GUIDE	1.00				

Labor:

9500/6074/FNB/10 Retail

COMPLAINT:

48 TIGHTENER FAN DRIVE BELT - REMOVE & INSTALL

CORRECTION:

REMOVED & INSTALLED FAN DRIVE BELT TIGHTENER

Removed fan drive belt.

Removed tensioner from bracket.

Replaced tensioner.

Assembled in reverse order.

Labor:

SERVICE INVOICE

Invoice Number:	1136699010719010322
Invoice Date:	6/29/2018
Location:	53
Work Order Number:	1863499
Payment Type:	Account
Tech:	Page:3 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/7706/FUT/65 Retail

COMPLAINT:

49 LINES FUEL RETURN - RESEAL

CORRECTION:

RESEALED FUEL RETURN LINES

Removed lines from system.

Removed old seals.

Installed new seals.

Installed lines back onto system.

REMOVED AND INSTALLED NEW HAND FUEL PRIMER PUMP. ALSO INSTALLED NEW CHECK VALVE DUE TO FUEL BLEEDING BACK.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AR81825	Hand Primer	1.00				
RE33542	Check Valve	1.00				

Labor:

9500/1072/10 Retail

COMPLAINT:

50 RAIN CAP - REMOVE & INSTALL

CORRECTION:

REMOVED & INSTALLED RAIN CAP

REPAIRED ORIGINAL RAIN CAP

Labor:

9500/7281/TEI/10 Retail

COMPLAINT:

51 DOOR TOP ELEVATOR INSPECTION - REMOVE & INSTALL

SERVICE INVOICE

Invoice Number:	1136699010719010322
Invoice Date:	6/29/2018
Location:	53
Work Order Number:	
Payment Type:	
Tech:	Page: 4 of 24

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500	4251	H09500X635890	215574PLP	

9500/7281/TE/10 Retail
 CORRECTION:
 REMOVED & INSTALLED TOP ELEVATOR INSPECTION DOOR

Labor:

ATTENTION: Part(s) values for this invoice have changed. Original Invoice Parts Sale Value =
 INVOICE CONTAINS DISCOUNT

Miscellaneous Charges:
 SERVICE ACCESSORIES

Customer PO No:
 Tax Exempt No:
 Advisor:



*** DOCUMENT COPY ***

Job Total:
 Sales Tax:
 Grand Total: \$14,605.85

JOHN DEERE

TERMS AND CONDITIONS

Terms are Net 30. A Finance Charge of 2% per month which is an annual rate of 24% will be added to all past due invoices. Please note there will be a fee on all returned checks. Invoices can be viewed at anytime on our customer portal at the following <https://ave-plp.dealercustomerportal.com>.

Received by: _____ Date: _____