

**Complaint:** Check out wheel chair lift and make sure fully functional.

**Cause:** Customer request

(Inspection)

Labor      **Correction:**  
Chassis / Chassis / Checked out wheel chair lift and found several issues. Lift would not work.  
-Found problems with a solenoid so release wouldn't work, and a micro switch quit working for the stow for the lift.  
-Special ordered in parts, performed several repairs and installed a new micro switch for lift stow.  
-Checked wiring in battery box for lift power. - Created: 6/19/2024 Completed: 7/2/2024

Parts      MICRO SWITCH - 4561896

Parts      Part-Misc electrical parts - 007

N

N

N

**Complaint:** Replace all reflective stripping needed.

**Cause:** Customer request

(Inspection)

Labor      **Correction:**  
Chassis / Chassis / Install amber round reflective circle  
Replace both front and rear school bus stickers.  
Replace alot of reflective tape all way around bus.  
R&R 2x interior emergency window stickers. - Created: 6/26/2024 Completed: 7/1/2024

Parts      DECAL- EMERGENCY WINDOW BLUEBIRD - 10005804

Parts      REFLECTOR- RED BLUEBIRD - 02146702

Parts      REFLECTOR- AMBER BLUEBIRD - 02146710

Parts      SIGN- SCHOOL BUS BLUEBIRD - 00002726

Parts      Part-Freight - 007

Parts      TAPE- REFLECTIVE 2" BLUEBIRD Price per Foot - 01635028

Parts      TAPE- REFLECTIVE 1" BLUEBIRD Price per Foot - 01717529

**Complaint:** Rear emergency latch not working properly.

**Cause:** Customer request

(Inspection)

Labor      **Correction:**  
Chassis / Chassis / Disassembled latch, drilled out rivits, cleaned dirt out of latch, lubed up and repaired minor markings causing latch to have hitch in it and not operate correctly. - Created: 6/28/2024 Completed: 6/28/2024

Parts      Brake Cleaner-OTCB - OTCB

N

N

**Complaint:** Rear heater motor had quit working and the heater core is plugged with dirt and debris

**Cause:** Customer request

		Amount	Taxable
Labor	<b>Correction:</b> Chassis / Chassis / Rear heater motor had quit working and the heater core is plugged with dirt and debris -Removed heater core to replace both blower motors in rear heater and pressure washed heater core. - Created: 6/28/2024 Completed: 7/2/2024	\$280.00	N
Parts	MOTOR- BLOWER BLUEBIRD - 10013870	\$434.93	N
Parts	Electrical Connector- Blue 16-14 AWG Circular Ring Terminal Crimp Connect (61481628) BOW-23828 - 23828	\$4.39	N
Parts	Electrical Connector- Blue Butt Connector 16-14 AWG Heat Shrink Crimp-On (61478855) BOW-23846 - 23846	\$7.28	N
Parts	FILTER- AIR 10 MICRON - 00015895	\$139.58	N
		\$866.18	

**Complaint:** Repair light issues.

**Cause:** Customer request

(Inspection)

Labor	<b>Correction:</b> Chassis / Chassis / Repair a bunch of misc light issues. -5 dome light blubs were burnt out -Light bulb for the switches back lighting is burnt out -Left rear clearance light needs to be changed(Changed out the cover) -Removed and cleaned out several other light lens that had dirt in lens. -Front lens covers are cracked and weathered and need replaced. Parts are on order. -R&R both lens. - Created: 6/28/2024 Completed: 7/3/2024	\$245.00	N
Parts	Lighting- 14 Volt Miniature Wedge Lamp (54109103) (6215) 194 - 194	\$3.28	N
Parts	Lighting- 13.5 Volt, Automotive Miniature Lamp (54109046) - 67	\$22.50	N
Parts	LENS TURN SIGNAL BB - 02157287	\$150.58	N
		\$421.36	

Freight Charge- Chair Lift Parts

Unit: 1 VIN: 1BAAKGPA41F098487

2001 Blue Bird

Chassis: 2 Miles

\$3,150.00

\$2,187.18

\$63.20

N



2310

7/15/2024

Service Order	Terms	Due Date	Authorizer	Customer PO	Unit #
2694	Due Upon Receipt	7/15/2024			1

Item	Description	Quantity	Rate	Amount	Taxable
------	-------------	----------	------	--------	---------

Complaint: Bus Safety Inspection Annual

Cause: Customer request

Labor      **Correction:**  
Chassis / Chassis / Full Dot and safety inspection on school bus. Extra Time Spent.  
-5 dome light blubs were burnt out  
-light bulb for the switches back lighting is burnt out  
-Rear heater motor had quit working and the heater core is plugged with dirt and debris.  
-Fire extinguisher expires in July  
-Rear emergency exit latch not operating good.  
-Left rear clearance light needs to be changed  
-Needs reflective tape replaced where it has came off  
-Emergency exit instruction stickers need replaced on the windows  
-Dash odometer does not read on gauge.  
Price gauge.  
-Wheel chair lift not working properly and door wont open.  
-Brake pot needs replaced. - Created: 6/5/2024 Completed: 6/28/2024

N

Complaint: School Bus Full Service Annual

Cause: Customer request

Labor      **Correction:**  
Chassis / Chassis / -Change engine oil and filter.  
-Change both fuel filters  
-Change air filter  
-Greese chassis - Created: 6/5/2024 Completed: 6/28/2024

N

Parts      Filter Oil- Lube Filter Spin On P550428 - P550428

N

Parts      Filter- Fuel Filter - P550785

N

Parts      Filter- Fuel filter Water Separator Cartridge - P553226

N

Parts      Filter Hydraulic- Allison Bus Hydraulic Filter Spin On Donaldson P550606 - P550606

N

Description		Taxable
Parts	Filter Air- Air Filter Primary Donaldson P127075 - P127075	N
Parts	Rotella- 15W-40 Engine Oil (Bulk- 55 gal) (Gal) 108767 550045148 - Rotella 15W-40 Bulk	N
Parts	O'Reilly- ATF Premium Oil (Qt) - ORO ATF	N
Parts	Amsoil Grease #2 Red - Amsoil GPTR1CR	N
<b>Complaint:</b> Service engine light goes on and off.		
<b>Cause:</b> Customer request		
(Inspection)		
Labor	<b>Correction:</b> Chassis / Chassis / Hooked up computer and had a few inactive codes, performed diagnostics and lead me to check fuel pressure switch, unhooked sensor and had fuel leaking through, needs new sensor. Installed new fuel pressure switch. - Created: 6/5/2024 Completed: 6/27/2024	N
Parts	CUMMINS PRESSURE SWITCH - 3408705	N
<b>Complaint:</b> Replace weather stripping around rear emergency door and wheel chair lift door.		
<b>Cause:</b> Customer request		
(Inspection)		
Labor	<b>Correction:</b> Chassis / Chassis / -R&R door seal on rear door. - Created: 6/5/2024 Completed: 6/28/2024	N
Parts	DOOR REAR EMERGENCY WEATHERSTRIP - 10073183	N
<b>Complaint:</b> Buzzer going off might be from window or e hatch.		
<b>Cause:</b> Customer request		
(Inspection)		
Labor	<b>Correction:</b> Chassis / Chassis / Check out and buzzer on e door. needs to be shimmed or adjusted. Adjusted edoor buzzer and adjusted door latch. - Created: 6/18/2024 Completed: 6/28/2024	N
<b>Complaint:</b> R&R drivers side rear axle brake pot.		
<b>Cause:</b> Customer request		
(Inspection)		
Labor	<b>Correction:</b> Chassis / Chassis / R&R brake chamber, had to heat up and reuse clevis off the old one, adjusted brake on that wheel. - Created: 6/19/2024 Completed: 7/1/2024	N
Parts	Nut- Hex 5/8-11 Grade 8 Steel Yellow Dichromate (05724463) MP39607 - MP39607	N
Parts	Washer- Lock 5/8" AISI 4037 Split Alloy Steel (70995972) 39731 - 39731	N
Parts	Washer- Flat 5/8" Carbon Steel (64711211) 500019 - 500019	N