

SERVICE INVOICE: RA138001246:02
REFERENCE: 18661772

DATE ARRIVED	DATE INVOICE	SALES TYPE	ADVISOR	TERMS	CUSTOMER PO#
8/21/2024	9/12/2024	SRM		CASH	
YEAR	MAKE	MODEL	VIN	ENGINE HOURS	IN SERVICE
2004	Mack	CV713	1M2AG11C44M010247	0	Component Serial #
					ODOMETER
					536945

Sold Operations

JOB #1 200

SERVICE - GENERAL ENGINE REPAIR

COMPLAINT
CAUSE
CORRECTION

ENGINE RUNS SLUGGISH -
DIAG LOSS OF POWER
TEST DROVE FOUND TO BE UNPOWERED PULLED BACK INTO SHOP HEARD KNOCKING IN FRONT VALVE
COVER PULLED VALVE COVER TO INSPECT. PERFORMED VALVE CHECK ON FRONT 3 FOUND VALVES TO HAVE
PROPER CLEARANCE. INSTALLED VALVE COVER SO NOTHING WOULD GET INTO ENGINE OVER NIGHT GOING
TO HAVE RUSS LOOK AT TRUCK FURTHER IN THE MORNING. WASHED FRONT AXLE TO INSPECT FOR
CRACKS FOUND NO CRACKS AT THIS TIME. REMOVED EXHAUST AND FOUND IT NEEDED NEW EXHAUST
CLAMPS, PARTS ON ORDER

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXT. PRICE
	LABOR 200	ENGINE RUNS SLUGGISH		
1	138M/25166488	SENSOR		
1	138V/25173266	TEMPERATURE SENSOR		

Prepay: \$0.00 Parts: \$112.11 Labor: \$660.00 FRT: \$0.00 Misc: \$0.00 S

JOB #2 258

SERVICE - AFTERTREATMENT SYSTEMS & FAULT TRACING

COMPLAINT
CAUSE
CORRECTION

REPLACE MUFFLER -
MUFFLER RESTRICTED
REPLACED MUFFLER AND EXHAUST CLAMPS TIGHTENED ALL CLAMPS

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXT. PRICE
	LABOR 258	REPLACE MUFFLER		
1	138M/8181264	EXHAUST PIPE CLAMP		
1	138M/20477610	EXHAUST PIPE CLAMP		
1	138O/EEM-1895	MUFFLER		
1	FRT	FREIGHT		
4	138M/25105731	FLANGE SCREW		
1	138M/25168140	CLAMP		
1	FRT	FREIGHT		

Sold Operations (Cont.)

JOB #4 330

SERVICE - REPLACE CLUTCH ASSEMBLY

COMPLAINT
CAUSE
CORRECTIONREPLACE CLUTCH ASSEMBLY -
CLUTCH REPLACEMENT

REMOVED ALL LINES AND HOSES AS WELL AS PTO PUMP, REMOVED TRANSMISSION, CLEANED TRANSMISSION PULLED SIDE COVERS AND PTO FOUND THE PTO TO HAVE METAL SHAVINGS IN IT AS WELL AS THE TRANSMISSION LETTING CUSTOMER KNOW, INSTALLED PILOT BEARING INTO FLYWHEEL AND THEN INSTALLED FLYWHEEL TORQUED TO SPEC, INSTALLED NEW CLUTCH TORQUED TO SPEC, TRANSFER PARTS TO NEW TRANSMISSION, SET LASH ON PTO, TRANSFERED COMPONENTS TO NEW TRANSMISSION RAISED TRUCK TO PUT TRANS UNDER TRUCK CLEANED ALL BELL HOUSING BOLTS READY FOR INSTALL, INSTALLED TRANSMISSION AND MOTOR MOUNTS TORQUED TO SPEC, HOOKED LINES UP AND SHIFTER AS WELL AS PTO PUMP, HOOKED DRIVELINE BACK UP WITH NEW CLAMPS TORQUED TO SPEC HOOKED ALL REMAINING CONNECTORS UP AND TEST DROVE TRUCK RUNS AS IT SHOULD WITH NO FURTHER ISSUES AT THIS TIME. CHECKED TRANS FLUID AFTER TEST DRIVE AND GREASED TRANS GREASE ZERKS

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 330	REPLACE CLUTCH ASSEMBLY		3,990.00
2	37293	INLAND TRUCK PARTS COMPANY - SALINA		
1	138M/25502395	SHAFT		
1	138M/25100046	BALL BEARING		
1	138M/1000-CLU20893551H	CLUTCH, 15.5X2.9SPR 6PDL C		
20	138X/500400040S60810QT	SPX S6 GME40 DR		
8	138M/25167342	INSULATOR		
1	138X/755.CB200TL	BRAKE 2		
1	CREDIT	DIAMOND WARRANTY 2 YEAR GUARANTEE REPLACE		
1	138M/20706312	SEALANT		
1	138X/T310MLONGBOXWEL	REMAN TRANS		
1	138X/T310MLONGBOXWEL-CORE	REMAN TRANS CORE		
1	138X/13MK5709SAL	8 BOLT .020 GASKET		
3	138X/13MK5708SAL	8 BOLT .010 GASKET		
2	138M/21078756	SET SCREW		
2	138M/8846-020053	NYLON TUBING 3/8OD X 100C		
1	138M/8846-016260	NYLON AIR BRAKE TUBE UNIO		
1	138V/85108980	TUBE		
2	138M/85132551	KIT		
18	138X/500400040S60810QT	SPX S6 GME40 DR		
-1	138X/T310MLONGBOXWEL-CORE	REMAN TRANS CORE		

\$13,532.91

JOB #5 300

SERVICE - GENERAL TRANSMISSION REPAIR

COMPLAINT
CAUSE
CORRECTIONREMOVE REAR TRANSMISSION FOR MAGNET -
REMOVE MAGNET

REMOVED THE SPEED SENSOR MAGNET FROM THE REAR OF TRANSMISSION, FOUND THE MAGNET TO BE HAVE CAUSED DAMAGE IN THE TRANSMISSION, WILL NEED TO TAKE THE TRANSMISSION APART TO SEE THE EXTENT OF DAMAGE.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 300	REMOVE REAR TRANSMISSION FOR MAGNET		
1	FRT	FREIGHT		
1	138X/808010SAL	YOKE WITH SPEEDO GEAR		
1	FRT	FREIGHT		

\$489.99

JOB #6 300

Sold Operations (Cont.)

SERVICE - GENERAL TRANSMISSION REPAIR

COMPLAINT
CAUSE
CORRECTION

HELP WITH TRANSMISSION -
HELP INSTALL TRANSMISSION
HELP PULL TRANS BOLTS AND ENGINE MOUNTS CHAIN ENGINE UP. HELP STAB TRANSMISSION AND
INSTALL MOTOR MOUNT. PUT LINKAGE ON CLUTCH AND ADJUSTED FREE TRAVEL. PUT IN TEMP SENDER.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 300	HELP WITH TRANSMISSION		
Sold Operations Totals				
Prepay: \$0.00 Parts: \$0.00 Labor: \$750.00 FRT: \$0.00 Misc: \$0.00 Sublet: \$0.00				
Prepay: \$0.00 Parts: Labor: FRT: \$134.26 Misc: \$1,012.00 \$16,148.50				

	ESTIMATED	BILLED
LABOR		
PARTS		
MISC		
FREIGHT		
SUBLET		
PREPAY		
SUBTOTAL		
SHOP SUPPLIES		
MISC SUPPLIES		
TAX		
TOTAL		\$17,793.69