

Date	07/25/24	Time	23:03:24 (B)	Page	02
Account No	[REDACTED]	Phone No	[REDACTED]	Inv No	W13167
Ship Via				Purchase Order	
				Salesperson	

SERVICE INVOICE

STK#/FLEET# 028294 YELLOW VAC PDM-500 HRS 1 PIN/EIN 971214 WARRANTY DATE HRS

PI	FR	2	
P-1044	FREIGHT IN	2	
SUBLETP	YELLOW VAC PUMP	1 N	
SUBLETP	FITTINGS	1	
SUBLETP	HYD HOSE	1	
SUBLETP	WATER HOSE	1	
150-5506	WATER PUMBING	1	
150-5762	NOZZLE (#02, 04	1 N	
153-098	BULKHEAD (04NP-	1 N	
	SPRAY HOSE (300	1	
153-461P	SPRAY HOSE (3000)		
213-419	QDC BODY (3/8")	1	
	PRESSURE GAUGE	1	
240UC	PRESSURE GAUGE (5000 PSI)		
421BU	YELLOW VAC UNLO	1 N	
	WATER PUMP BUSH	1 N	

11000006

SEGMENT TO

SEGMENT# 3 C 00071 NA
VACUUM LOW

04/01/24 04/01/24 04/01/24

VACUUM ISSUES. UNIT HAS LOW VACUUM. FOUND ENGINE WOULD NOT
REV UP TO FULL THROTTLE HAD TO MAKE SOME ADJUSTMENTS TO GET
FULL RPM AND STILL HAS LOW VACUUM. FOUND THE VAC FILTER
CANISTER IS RUSTED THROUGH THE BOTTOM AND WILL NEED TO BE
REPLACED. PULLED VAC CANISTER AND HAD A NEW BOTTOM WELDED ON
IT AND PAINTED

P-0500

PMD FILTER

3 N 4
CONTINUE

07/25/24	23:03:24 (B)	Page 03
Account No	Phone No	Inv No
		W13167
Ship Via	Purchase Order	
	Salesperson	614

SERVICE INVOICE

www.ditchwitchrockies.com

STK#/FLEET#
028294

YELLOW VAC
PDM-500

HRS PIN/EIN
1 971214

WARRANTY DATE HRS

WELD/SUBLET

WELDING
LABOR FOR WELDING PROVIDED BY MATT AT
BMF 1 N

11000006

SEGMENT TO

SEGMENT# 4 C 00071 NA
MISC REPAIRS

04/01/24 04/01/24 04/01/24

INSTALLED ALL NEW ELECTRICAL CABLES GOING TO BATTERY,
ENGINE AND HYD PUMP AND ROUTED CORRECTLY. CUT PLATE AND
MADE A BATTERY HOLD DOWN BRACKET. INSTALLED ALL NEW BELTS
FOR BLOWER AND WATER PUMP. REMOVED AND REPLACED VAC FILTERS.
SECURED WATER TANK. UNIT
IS OPERATING CORRECTLY

SUBLETP
SUBLETP

BATTERY CABLES 1
BELTS/BOLTS 1

11000006

SEGMENT T

SEGMENT# 5 C 00071 NA
UNIT NOT CHARGING

04/01/24 04/01/24 04/01/24

AFTER RUNNING UNIT, FOUND BATTERY IS NOT BEING CHARGED.
PULLED FRONT OF ENGINE APART TO TEST REGULATOR; IT IS NOT
TESTING TO SPEC. ORDERED AND INSTALLED NEW ALTERNATOR.
UNIT IS NOW CHARGING AGAIN.

BW300-30'
SUBLETP

3"X30' HOSE 1
REGULATOR 1

CONTINU

Date	Time	Page
07/25/24	23:03:24 (B)	04
Account No	Phone No	Inv No
[REDACTED]	3 [REDACTED]	W13167
Ship Via	Purchase Order	
		Salesperson
		614

www.ditchwitchrockies.com

SERVICE INVOICE

STK#/FLEET#

028294

YELLOW VAC
PDM-500

HRS PIN/EIN

1 971214

WARRANTY DATE

HRS

LABOR

SUBLET

SEGMENT TOTAL==>

11000006

SUB TOTAL==>

12609.07

JV

Date	07/25/24	Time	23:03:24 (B)	Page	01
Account No	Phone No		Inv No		
			W13167		
Ship Via	Purchase Order				
		Salesperson			

STK#/FLEET#
028294 YELLOW VAC
PDM-500

HRS PIN/BIN
1 971214

WARRANTY DATE HRS

SEGMENT# 1 C 00071 NA
NO START

04/01/24 04/01/24 04/01/24

INSPECT UNIT AND BUILD QUOTE FOR NEEDED REPAIRS.
PULLED UNIT IN SHOP FOR NO START/INSPECTION FOUND UNIT HAD
BAD FUEL AND INCORRECT LINES REMOVED FUEL TANK AND CLEANED
OUT INSTALLED ALL NEW FUEL LINE WITH NEW FILTER ADDED 5 GAL
OF FRESH GAS GOT UNIT TO START AND RUN

FI	FREIGHT IN	1
PCX	PRIORITY CHARGE	2 N
001-032	FUEL - DIESEL	4
194-669	FUEL FILTER (04	1
FUEL FILTER (04H-04H, IN-LINE)"		

11000006

SEGMENT T

SEGMENT# 2 C 00071 NA
WATER SYSTEM REPAIRS

04/01/24 04/01/24 04/01/24

LOOKED INTO WATER SYSTEM AND FOUND THE SUPPLY LINES FROM
THE TANK TO THE PUMP WERE BROKEN INSTALLED NEW FITTINGS AND
NEW BALL VALVE WITH
NEW SUPPLY LINES ON TANK AND WINTERIZE TANK. TESTED WATER
SYSTEM AND FOUND THE PUMP IS LEAKING OUT OF THE HEAD. UNIT
IS MISSING AN UNLOADER VALVE AND A PRESSURE GAUGE. THE
PRESSURE HOSE WILL NEED TO BE REPLACED.
PLUMBED ALL NEW WATER SYSTEM GOT ALL NEW
FITTING AND WATER PUMP AND UNLOADER PLUMBED UNLOADER AND
GAUGE TO WATER PUMP AND INSTALLED NEW VALVE FOR WATER AND
ANTIFREEZE SUPPLY LINES INSTALLED ALL NEW WATER SYSTEM

CONTINUED ON PAGE 02