

Invoice No.

33123

INVOICE**Customer**Name
Address
City
Phone**Misc**Date 3/31/2023
Order No.
Rep
FOB

Qty	Description	Unit Price	TOTAL
1	Parts and sublet machining Engine kit, additional seals, gaskets, turbocharger, manifold temperature and air sensors, turbo drain tube, engine harness repair harness, fan belt vating and machining of components, sealants and inserts		
1	Labor Disassemble and clean, rebuild engine, repaired damaged components as necessary, replaced electronic unit injectors, turbocharger, engine sensors, repaired melted and shorted wiring harness from ecu to air temp sensor in manifold. Checked and set all clearances to spec. Machine broken flywheel housing broken bolts and install inserts. Reinstall all components and mounts. Cylinder block required sleeve in #1 cyl to repair excessive damage from damage due to piston ring failure. Block was decked .003" and cyl head also resurfaced.		

SubTotal \$
Shipping \$
6.25%**Payment**

Select One...

Tax Rate(s)

TOTAL \$ 11,665.18

Comments

Name

CC #

Expires

Office Use Only

Komatsu 6.7L Sn 73239835