SE MILEAGE IN / OUT LICENSE VIN TEAR MAKE/MUDEL 386313/386313 T6730 3ALXFB006EDFT8104R137911TX BLUE FREIGHT 14 FREIGHTLINER PAYMENT RATE DEL. DATE PROD. DATE WARR. EXP. **PROMISED** PO NO 26DEC17 0.00 CHG 25NOV13 DD30JUL13 17:00 27NOV17 R.O. OPENED ENG: 06R0322314-DDES-60 READY OPTIONS: 08:32 27NOV17 15:54 26DEC17 TOTAL NET LINE OPCODE TECH TYPE HOURS A CHECK AND ADVISE FOR EXCESSIVE BLOW BY AND GOING THROUGH 5 GALLONS OF OIL EVERY 15,000 MILES OIL COMING OUT OF FILL TUBE AND DIPSTICK / CUSTOMER PROVIDING ALL PARTS ALCED OF SHALL SHE SEE SEE ELON 168 S-60 9442 of CP regar stra come, dee po saun great sug ses 1 DDE/R23522122 A/CMP TF550 CORE CHARGE C 4.86 5 1147*4520* NON-CHLORINATED BRAKE CLN 49.98 2 8281 J B WELD 7.28 1147*7014* SPRAY ELECTRIC MOTOR CLEA 17.60 1 LUB/105 LUBRIPLATE 14.08 6 DDE/23511870 SEAL 3.93 6 DDE/05104701 SEAL RING 10.00 1 DDE/08929357 BOLT 10 ZSH550045126G FLUID 22.00 15.99 2 1000*AFROA053* NITRITE FREE OAT EXTENDED 2.80 23-13202-000 SEAL #8 23-13201-000 SEAL-MINI STAT-O-SEAL PLUS 6 3.74 2 DN/23530573 ELEMENT-OIL FILTER 16.80 80.07 1 5839*AF25139M* AIR FILTER -1 DDE/R23522122 CORE RETURN SUBL TEXAS INDUSTRIAL RADIATOR 169684 PO#050648S 58.00 brought unit to shop and found major oil leak at rear of engine. removed air filter and found gto be very dirty and not oem. removed inlet to turbo and found signs of dirt ingestion from air cleaner. removed cac piping and found same signs of dirt. removed inlet to air compressor and found minor residue of engine oil. removed discharge line and found wet oil coming from compressor. removed drain valve from wet tank and found oil to run out and a 2" wide strip oil in in the bottom. also found oil at outlet of air drier. will inform customer. customer requested air compressor replaced and inframe. drained coolant, removed cac piping, rain tray, rad strut rods, upper ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREONIS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMEDAT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE. DESCRIPTION TOTALS STATEMENT OF DISCLAIMER STATEMENT OF DISCLAIMER
The factory warranty constitutes all of the warranties with respect to the sale of this item/stems. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/stems. LABOR AMOUNT PARTS AMOUNT GAS, OIL, LUBE SUBLET AMOUNT **EPA CHARGES TOTAL CHARGES** MANUFACTURER'S REPRESENTATIVE. LESS INSURANCE

CUSTOMER SIGNATURE

SALES TAX

PLEASE PAY THIS AMOUNT

(SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON

SER\ COLOR YEAR MAKE/MODEL VIN LICENSE MILEAGE IN / OUT TAG 14 FREIGHTLINER FREIGHT 3ALXFB006EDFT8104R137911TX 386313/386313 T6730 DEL. DATE PROD. DATE WARR. EXP. PROMISED PO NO. RATE PAYMENT 25NOV13 DD30JUL13 17:00 27NOV17 0.00 CHG 26DEC17 R.O. OPENED READY OPTIONS: ENG: 06R0322314-DDES-60 08:32 27NOV17 15:54 26DEC17 LINE OPCODE TECH TYPE HOURS LIST NET TOTAL rad hose, evacuated ac, removed cac, sent cac to be cleaned. removed rocker cover, jakes, rocker shafts, cam hold down, front cam gear cover, cam bolt, installed tool. removed cam. removed fuel, coolant and elec to cyl head. removed all head bolts and head. found several scored liners. drained oil, removed oil pan, regulator, oil pump, removed all pistons and liners. found block with extreme electolosis above lower coolant seal surfaces. informed customer. customer informed fitzgerald. fitzgerald suggested using jb weld to fill in hoiles so o rings do not gt torn durring liner instllation. cleaned block, bolt holes and counter bore surfaces. used elec cleaner to remove any residue to make sure jb weld sticks. filled in holes with jb weld and let set for 24 hours. came back in and used flapper wheel to remove excess. found several spots tat needed to be built back up. filled in low spots and let set for 24 hours. used flapper wheel to removed excess, found surfaces smooth enough i believe o rings will be okay during install. used solvent and brake clean and cleaned block thoroghly to remove all debris from jb weld. r/r all main bearings with thrust bearings. torqued all to spec. found crank end play in spec. installed liners, pistons with new rod bearings and torqued to spec. drilled exhaust manifold bolt from #6 cyl and helix coiled installed manifold with new gaskets and torqued to spec. installed head to block with new gasket and bolts. torqued to spec. installed new cam bearings and installed cam in time. verified cam timing. torqued cam bolt and thrust plate with new seals. installed cam hold downs and torqued to spec. verified cam gear lash is correct . installed cover plate with new gasket. installed rocker shafts and torqued to spec. adjusted all intake and exhaust vive lash, adjusted all injector settings and timing, installed jakes and set valve lash. torqued all jam nuts. installed inj elec, fuel and coolant lines to cyl h ead. installed rocker cover with new gasket. instlled all elec and secured with zip ties. installed upper rad hose, coolant res, rain tray anfd windshield wipers. installed oil pump, suction sump and baypass with new seals and torqued to spec. installed oil pan with new seal. changed fuel filters and filled with installed cac, cac piping, condensor and charged ac. installed rad ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREON IS ACCURATE UNLESS OTHERWISE SHOWN. SERVICES DESCRIBED WERE PERFORMEDAT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE. RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE. DESCRIPTION TOTALS STATEMENT OF DISCLAIMER The factory warranty constitutes all of the warranties with respect to the sale of this item\tens. The Seiler hereby expressly disclaims all warranties either express or LABOR AMOUNT PARTS AMOUNT GAS, OIL, LUBE implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor SUBLET AMOUNT **EPA CHARGES** Seller authorizes a ume for arry other person to or it arry liability in with the sale of this **TOTAL CHARGES** LESS INSURANCE SALES TAX (SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON **CUSTOMER SIGNATURE** PLEASE PAY THIS AMOUNT

SE COLOR YEAR MAKE/MODEL VIN LICENSE MILEAGE IN / OUT TAG FREIGHTLINER FREIGHT 3ALXFB006EDFT8104R137911TX 386313/386313 T6730 PROD. DATE WARR, EXP. DEL. DATE **PROMISED** PO NO RATE PAYMENT INV. DATE 5NOV13 DD30JUL13 17:00 27NOV17 0.00 CHG 26DEC17 R.O. OPENED READY OPTIONS: ENG: 06R0322314-DDES-60 08:32 27NOV17 15:54 26DEC17 LINE OPCODE TECH TYPE HOURS LIST NET TOTAL strut rods. r/r air compressor, filled with coolant untill coolant came out of upper rad hose vent. topped off coolant and started engine. found 60 oil psi cold. let run. took to steam bay and washed engine. sent unit on test drive and found no issues. checked and found no leaks, tagged air compressor for core, parked unit in gravel, gave ro and keys to foreman. *********** WE ARE THE BEST EQUIPPED ALLISON AUTOMATIC TRANSMISSION REPAIR AND OVERHAUL FACILITY IN THE AREA. WE HAVE A NEW DYNOMETER ON SITE FOR TESTING AND DIAGNOSIS ON THESE TRANSMISSIONS PLEASE CALL 210-666-7184 OR 210 666 7175 FOR DETAILS. WE HAVE A LARGE PARTS INVENTORY, AND CAN KEEP YOUR DOWNTIME TO A MINIMUM 地球球 地球球 康根超速度規利 ON BEHALF OF SERVICING DEALER, I HEREBY CERTIFY THAT THE INFORMATION CONTAINED HEREONIS ACCURATE UNLESS OTHERWISE SHOWN, SERVICES DESCRIBED WERE PERFORMEDAT NO CHARGE TO OWNER. THERE WAS NO INDICATION FROM THE APPEARANCE OF THE VEHICLE OR OTHERWISE, THAT ANY PART REPAIRED OR REPLACED UNDER THIS CLAIM HAD BEEN CONNECTED IN ANY WAY WITH ANY ACCIDENT, NEGLIGENCE OR MISUSE, RECORDS SUPPORTING THIS CLAIM ARE AVAILABLE FOR (1) YEAR FROM THE DATE OF PAYMENT NOTIFICATION AT THE SERVICING DEALER FOR INSPECTION BY MANUFACTURER'S REPRESENTATIVE. TOTALS DESCRIPTION STATEMENT OF DISCLAIMER The factory warranty constitutes all of the warranties with respect to the sale of this itemvitiens. The Seller hereby expressly disclaims all warranties either express or LABOR AMOUNT PARTS AMOUNT GAS, OIL, LUBE including any of merchantab SUBLET AMOUNT fitness for a particular Seller neither assum a particular purpose.
either assumes nor
any other person to
or it any liability in
with the sale of this **EPA CHARGES** Seller authorizes a ume for TOTAL CHARGES LESS INSURANCE SALES TAX (SIGNED) DEALER, GENERAL MANAGER OR AUTHORIZED PERSON (DATE) **CUSTOMER SIGNATURE** PLEASE PAY THIS AMOUNT 9959.32