MILE 13	6432 1 G C E C 1 4 Z 1 3 Z 2 5 3 7 5 8  MAKE MODEL COLOR CHEVROLET SILVERADO WHITE O	PHONE	10/03/2022 TIME IN 15:51 PROM. 15:11 10/10/2022 WRITCR
(1)	CUSTOMER STATES THEY HAD TO DRIVE IT BACK FROM A JOB GOING 30MPH ON A DIRT ROAD IT WOULD NOT SHIFT AND HAD A MESSAGE THAT STATED TRANSMISSION HOT TECHNICIAN INSPECTED VEHICLE, FOUND TRANSMISSION FLUID LEVEL LOW, FLUID IS BURNT. TECHNICIAN FOUND THE TRANSMISSION FLUID PUMP AND CLUTCHES HAVE FAILED, TRANSMISSION REQUIRES REPLACEMENT. TECHNICIAN REMOVED AND REPLACED TRANSMISSION, FLUSHED TRANSMISSION COOLER, FILLED TRANSMISSION FLUID. (Tech:32) A	Labor T32 80 24229174 (REMAN TRANSMIS) 1 19001 (KOOLERKLEAN) 1 19286293 (DEXRON V1) 7 61323 (EXH FLANGE GAS) 1 61089 (EXH SEAL) 1 Total Labor Total Parts  Total Repair (Customer)	
(2)	REPLACE LEAKING OIL PRESSURE SENSOR AND CONNECTOR UPON VEHICLE INSPECTION, TECHNICIAN FOUND THE ENGINE OIL PRESSURE SENSOR LEAKING, OIL PRESENT IN SENSOR CONNECTOR AS WELL. TECHNICIAN REMOVED AND REPLACED ENGINE OIL PRESSURE SENSOR AND CONNECTOR. (Tech:32) A	Labor T32 11 12677836 (SENSOR) 1 19368669 (CONNECTOR KIT) 1 Total Labor Total Parts	
(3)	REPLACE SPARK PLUGS AND WIRES FOR P0300 UPON VEHICLE INSPECTION, TECHNICIAN FOUND DIAGNOSTIC TROUBLE CODE P0300, MULTIPLE CYLINDER MISFIRE. TECHNICIAN REMOVED AND REPLACED SPARK PLUGS AND SPARK PLUG WIRES. TECHNICIAN CLEARED DIAGNOSTIC TROUBLE CODE, CODE DID NOT RETURN AFTER REPAIR. (Tech:32) A	Labor T32 16 19299585 (SPARK PLUG) 8 88862385 (WIRE KIT) 1 Total Labor	
	OTHER SUGGESTED ITEMS FOUND: -MASS AIR FLOW SENSOR \$221.20 -INTAKE MANIFOLD GASKETS \$249.95 -EVAP VENT VALVE & CANISTER \$517.98 (Tech:32) A	Labor T32 Total Repair (Customer )	
			-

Lan

To

CUSTOMER'S SIGNATURE W/C	INT. CUSTOMER
	Labor Farts Sublet/Fees Enviro Fees Oil/Grease Sub Total Tax Total (Due) 4080.80