

SERVICE INVOICE

STK# / FLEET#

015962 DOZER
D41P-6

HRS PIN/EIN
5502 B21468

WARRANTY DATE HRS

SUBLETP
14X-60-31130

HOSES
CAP

2
1 M

PARTS
LABOR
SUBLET

10000000

REPAIR SUB TOTAL==>

2096.2

SEGMENT# 3 C 2720 NA

07/15/24 07/29/24 07/22/24

CONTROLS IN CAB

COMPLAINT:

CONTROLS IN CAB.

CORRECTION:

INSTALLED A NEW RETURN SPRING.

REMOVED BELL CRANKS. CLEANED, GREASED AND REINSTALLED. THE PEDAL IS STILL NOT RETURNING TO UP RIGHT POSITION.

FI

124-43-52671

14X-54-12781

FREIGHT IN

SPRING

DAMPER

1
1-M
2 M

10000000

REPAIR SUB TOTAL==>

1769.9

SEGMENT# 4 C 2720 NA

07/15/24 07/17/24 07/22/24

INSPECT MACHINE

COMPLAINT:

INSPECT MACHINE.

CORRECTION:

INSPECTED THE MACHINE. SOME ITEMS CUSTOMER ALREADY SAID HE WILL HANDLE.



SERVICE INVOICE

STK# / FLEET#
015962 DOZER
D41P-6

HRS	PIN/EIN	WARRANTY DATE	HRS
6110-21-6530	PIN		2 M
6110-21-6540	PIN		2 M
6110-23-6520	BOLT		4 M
6136-11-4450	BAND		2 M
6207-81-7190	BAND		2 M

11000000 REPAIR SUB TOTAL==> 3164.54

SEGMENT# 2 C 2720 NA 07/15/24 08/06/24 07/22/24

HYD OIL LEAK

COMPLAINT:

HYDRAULIC OIL LEAK.

CORRECTION:

TRACED HYDRAULIC LINES. REMOVED BELLY PANS. REMOVED SEAT.

INSTALLED NEW HYDRAULIC LINES.

REINSTALLED SEAT.

RAN THE MACHINE TO CHECK FOR LEAKS, FOUND HYDRAULIC LEAK.
REMOVED HOSE AND ORDERED ONE.

INSTALLED THE NEW HYDRAULIC LINE.

REINSTALLED BELLY PANS.

INSTALLED A NEW HYDRAULIC TANK CAP. REINSTALLED SIDE COVER
IN CAB.

FI FREIGHT IN 2 16.49 32.98

CONTINUED ON PAGE 03

RE
nt
20

Inv

SERVICE INVOICE

TK#/FLEET#		HRS	PIN/EIN	WARRANTY DATE	HRS
15962	DOZER	5502	B21468		
	D41P-6				

CUSTOMER REPAIR:
 TRACK PADS AND LOOSE BOLTS.
 BROKEN AND MISSING WINDOWS.
 DOOR HANDLES.
 BROKEN DASH SIDE COVER.

 ITEMS APPROVED TO CHECK OUT FURTHER. THE CUSTOMER GAVE
 REAL APPROVAL:

LOW COOLANT (POSSIBLE RADIATOR REPAIR).
 OIL COOLER HOSES AT THE FRONT.
 STRAIGHTEN GRILL SO HOSES DON'T RUB.
 OIL FROM BELLY PAN.
 LOWER COVER IN FRONT MISSING BOLTS.
 VECEL AND THROTTLE ISSUE - CUST CANCELLED BECAUSE HE WAS
 NG TO HAVE TO BUY A FUEL SOLENOID.
 NCHING PEDDLE STICKING.
 ISSING BOLTS ON FINGER GUARD (RADIATOR).

 
 NGS TO ASK CUSTOMER:
 RIGHT LEFT CYLINDER LEAKING ROD SEAL. Q
 LOWER AND UPPER BLADE MOUNT BALLS. Q
 MISSING LOWER RADIATOR COVER.
 MISSING FRONT HOOD MOUNTS.
 ENGINE AIR FILTER HOUSING NOT CLAMPED IN. Q
 IL LEAKS VALVE BODY AREA (POSSIBLY RELATED TO LINES TO
 COOLER).
 IL LEAKS FROM BELLY PANS.
 BATTERY HOLD DOWNS. Q
 BATTERY CABLE AND POST. Q

CONTINUED ON PAGE 05

CAUTION: BE WARY OF ANY REQUEST TO CHANGE PAYMENT INSTRUCTIONS

WIRING INSTRUCTIONS SHOULD BE CONFIRMED BY PHONE: (405) 495-7820 BEFORE SENDING FUNDS VIA WIRE OR ACH.

Thank You!



See reverse side for Terms and Conditions

