

Invoice 7585

BILL TO

DATE
09/02/2022

PLEASE PAY
\$19,808.27

MAKE-MODEL
PETERBILT 379

SERIAL-VIN
1XP5DB9X57D743776

MILES-HOURS
279094 UNIT# 167

DESCRIPTION	QTY	RATE	AMOUNT
parts MCOH3569946 INFRAME KIT C-15	1		4,570.71T
parts SHIM LINER 9Y3368	1		650.00T
parts PISTON COOLING JET M-2764637	6		393.90T
parts KIT HEAD BOLT MCBC15HBK	1		391.24T
parts KIT EXHAUST STUD MCBC15ESK	1		325.00T
parts PUMP OIL M-1614113	1		641.18T
parts REGULATOR TEMP M-2477133	2		125.00T
parts REMAN CYLINDER HEAD (MIDWESTERN)	1		2,950.00T
parts AIR FILTER RS3534	2		337.50T
parts ROTELLA 15W40	11		198.00T
parts 1R1808 OIL FIILTER	1		65.00T
parts ANTIFREEZE ELC 50/50 OAT	14		210.00T
parts SPACER PLATE M-6I4421	1		409.11T

DESCRIPTION

QTY

RATE

AMOUNT

LABOR

1

5,500.00

PERFORMED INFRAME OVERHAUL, REPLACED ALL PARTS LISTED ABOVE. INSTALLED NEW FUEL INJECTOR ON # 5 CYLINDER FOUND BROKEN SPRING ON INJECTOR.

LABOR

1

1,000.00

COUNTERBORE ALL 6 CYLINDERS

LABOR

1

937.50

INSTALLED NEW WATER PUMP, PURCHASED PUMP ON CUSTOMERS ACCOUNT, ALSO REPLACED LOWER RADIATOR HOSES. DRILLED AND REPAIRED THREADS IN ROCKER BASE. TROUBLEHOOT JAKE BRAKES NOT OPERATING DURING TEST DRIVE, REMOVED VALVE COVERS AND CHECKED SOLENOIDS, WIRING, CONNECTORS, TESTED HARNESS FROM ECM TO SOLENOIDS, INSTALLED TEST ECM, FOUND ECM TO BE FAULTY AND WILL HAVE TO BE REPLACED FOR JAKE BRAKES TO OPERATE.

NEWLY REBUILD ENGINES MUST RUN AT A MINIMUM TEMPERATURE OF 180 DEGREES AND 75% LOAD FOR FIRST 3-4 HOURS OF RUN TIME, WITH IDLE KEPT AT A MINIMUM DURING THIS TIME. INTERSTATE MCBEE RECOMMENDS THE USE OF A DYNAMOMETER FOR THIS BREAK IN. FAILURE TO USE PROPER BREAK-IN PROCEDURE WILL VOID INTERSTATE MCBEE WARRANTY.

CHANGE OIL AND FILTER AFTER FIRST 5000 MILES
ADJUST OVERHEAD AFTER FIRST 20,000 MILES

SUBTOTAL

TAX (0.098)

TOTAL

TOTAL DUE

\$19,808.27

THANK YOU.