

Unit 2002 BLUEBIRD LTC 40

VIN/Serial No:1BAGNBJA32F206443

Plate:

Keyboard:

Odom/Hrs:132,886

1-MASTER SWITCH IN COACH INTERMITTANT

Description:UNABLE TO GET THE ORIGINAL SWITCH. INSTALLED A BIGGER AND HEAVY DUTY SWITCH IN DASH PANEL.

Parts

Part #	Qty	Description
GV-RS1003	1.00	6 PRONG ON/OFF ROCKER SWITCH

Labor

Description	Technician
	207VJK

www.masterstransport

2-HEADLIGHTS ARE DIM, CHECK AND ADVISE

Description:FOUND ONE HEADLIGHT BURNT OUT. INSTALLED A NEW HEADLIGHT AND FOUND THIS HEADLIGHT TO BE A LOT BRIGHTER THAN THE ORIGINAL. CUSTOMER COMPLAINT WAS HEAD LIGHTS ARE DIM. WE INSTALLED ANOTHER HEADLIGHT ON THE OTHER SIDE AND HEADLIGHTS ARE A LOT BRIGHTER NOW.

Parts

Part #	Qty	Description
GV-3898	1.00	LTC 40 LOW BEAM HEADLIGHT
GV-3899	1.00	LTC40 HIGH BEAM HEADLIGHT

Labor

Description	Technician
	207VJK

3-RIGHT WIPER ARE IS POSSIBLY STRIPPED.

Description:INSTALLED A NEW WIPER ARM ON THE PASSANGER SIDE OF COACH.

Parts

Part #	Qty	Description
3V-6959	1.00	LTC 40 WINDSHEILD WASHER PUMP
3V-02100816	1.00	KNURLED
3V-01983600	1.00	WIPER ARM ASSY, PANTOGRAPH, 31,

Labor

Description	Technician
	207VJK

4-SUMMER PREVENTATIVE INSP PROGRAM

Description: TECH PERFORMED INSP AND LISTED THE DEFECTS FOUND. A ESTIMATE WAS MADE AND EMAIL TO THE CUSTOMER. TECH ALSO DOT INSP THE COACH AND INSTALLED THE STICKER ON THE COACH AND PLACED THE INSP COPY INSIDE

Parts

Part #	Qty	Description
GV-416-SN	1.00	CLEAR DOT OVERLAY
GV-401-FC-02	1.00	ANNUAL DOT INSPECTION FORM W/

Labor

Description	Technician
	207VJK

5-TAIL LIGHT UPGRADE

Description: BLUE BIRD DOES NOT MAKE A UP GRADE FOR THIS COACH.

GRADE A DETAIL

Description: TECH 201 AND 200 PERFORMED A GRADE A DETAIL ON THIS COACH

Labor

Description	Technician
	200ESB
	201SMB

7-TAG AXLE SHOCK LEAKS

Description: TECH REPLACED THE LEAKING SHOCK

Parts

Part #	Qty	Description
GV-2930	1.00	LTC 40 TAG AXLE SHOCK

Labor

Description	Technician
	207VJK

8-FIRE EXTINGUISHER OUT OF DATE

Description: TECH 207 INSTALLED A FIRE EXT PER DOT REGULATIONS.

Parts

Qty Description
1.00 5LB FIRE EXTINGUISHER

Description

Technician
207VJK

9-TRANS OUTPUT SHAFT LEAKING.

Description: TECH 207 REMOVED THE DRIVE LINE AND YOKE FROM THE TRANSMISSION AND INSTALLED A NEW SEAL AND PUT YOKE BACK ON TRANSMISSION. TECH INSTA FLUID LEVEL.

Parts

Part #	Qty	Description
GV-29552705	1.00	ALLISON LTC 40 OUTSHAFT SEAL

Labor

Description	Technician
	207VJK

10-EXHAUST TIP AT MUFFLER VERY LOOSE

Description: TECH TIGHTEN CLAMP

Labor

Description	Technician
	207VJK

11-AIR DRYER NEEDS SERVICING

Description: TECH 207 R&R AD9 AIR DRYER AND TESTED.

Parts

Part #	Qty	Description	
GV-109685X	1.00	AD-9 AIR DRYER	\$2

Labor

Description	Technician
	207VJK

12-BRACE IN ENGINE COMPLETELY BROKEN

Description: TECH REMOVED THE BRACE AND WELDED BACK TOGETHER AND INSTALLED BA

Labor

Description	Technician
	207VJK

TECH R&R AIR FILTER
Parts
Part #
GV-49998

Labor	Qty	Description
Description	1.00	AIR FILTER

Technician
207VJK

14-FLEX SERVICE A

Description: TECH PERFORMED A COMPLETE SERVICE AND TOPPED OFF ALL FLUID LEVELS

Parts	Qty	Description
Part #	44.00	OIL, 15W40
GV-BLK-15W40	1.00	OIL FILTER
GV-LFP9001	1.00	COOLANT FILTER
GV-LFW4071	1.00	FUEL FILTER
GV-LFF1223		

Labor
Description

Technician
207VJK

MA:
Total Due: (\$4,575.60)
\$0.00

Summary

Unit	Job	Job Total
2002 BLUEBIRD LTC 40	1-MASTER SWITCH IN COACH INTERMITTANT	
2002 BLUEBIRD LTC 40	2-HEADLIGHTS ARE DIM, CHECK AND ADVISE	
2002 BLUEBIRD LTC 40	3-RIGHT WIPER ARE IS POSSIBLY STRIPPED.	
2002 BLUEBIRD LTC 40	4-SUMMER PREVENTATIVE INSP PROGRAM	
2002 BLUEBIRD LTC 40	5-TAIL LIGHT UPGRADE	
2002 BLUEBIRD LTC 40		
2002 BLUEBIRD LTC 40	7-GRADE A DETAIL	
2002 BLUEBIRD LTC 40	8-TAG AXLE SHOCK LEAKS	
2002 BLUEBIRD LTC 40	9-FIRE EXTINGUISHER OUT OF DATE	
2002 BLUEBIRD LTC 40	10-TRANS OUTPUT SHAFT LEAKING.	
2002 BLUEBIRD LTC 40	11-EXHAUST TIP AT MUFFLER VERY LOOSE	
2002 BLUEBIRD LTC 40	12-AIR DRYER NEEDS SERVICING	
2002 BLUEBIRD LTC 40	13-BRACE IN ENGINE COMPLETELY BROKEN	
2002 BLUEBIRD		
2002 BLUEBIRD		

Tax: _____
 Total: _____
 Less Deposits: _____
 Total Due: _____

Total 4,419.06

Unit 2002 BLUEBIRD LTC 40

Detail

VIN/Serial No: 1BAGNBJA32F206443

Plate:

Keyboard:

Odom/Hrs: 132,886

1-MASTER SWITCH IN COACH INTERMITTANT

Description:

Parts

Part #	Qty	Description
Misc-	1.00	1793 SWITCH

Labor

Description

Technician
207VJK

2-HEADLIGHTS ARE DIM, CHECK AND ADVISE

Description:

Parts

Part #	Qty	Description
Misc-	1.00	HEAD LIGHT LOW 3898 HIGH 3899

Labor

Description

Technician
207VJK

3-RIGHT WIPER ARE IS POSSIBLY STRIPPED.

Description:

Parts

Part #	Qty	Description
Misc-	1.00	WIPER ARM 4049
Misc-	1.00	WIPER BUSHING
Misc-	1.00	WASHER PUMP 6959

Labor

Description

Technician
207VJK

4-SUMMER PREVENTATIVE INSP PROGRAM

Description:

Labor

Description

Technician
207VJK

5-TAIL LIGHT UPGRADE

Description:

Labor

Description

Technician

Description	Technician
	207VJK

6-KANSAS STATE DEPARTMENT OF EDUCATION INSPECTION.

Description:

Labor

Description	Technician
	207VJK

7-GRADE A DETAIL

Description:

Labor

Description	Technician
	200ESB 201SMB

8-TAG AXLE SHOCK LEAKS

Description:NEEDS BOTH SHOCKS REPLACED

Parts

Part #	Qty	Description
Misc-	2.00	TAG AXLE SHOCK 2930

Labor

Description	Technician

9-FIRE EXTINGUISHER OUT OF DATE

Description:

Parts

Part #	Qty	Description
GV-466425	1.00	5LB FIRE EXTINGUISHER

Labor

Description	Technician
	207VJK

10-TRANS OUTPUT SHAFT LEAKING.

Description:

Parts

Part #	Qty	Description
Misc-	1.00	MATCH OUTPUT SHAFT SEAL
GV-BLK-ATF	10.00	65 GAL UNIV ECO ULTRA MP AUTO

Labor

Description Technician
207VJK

11-EXHAUST TIP AT MUFFLER VERY LOOSE

Description:

Labor

Description Technician
207VJK

12-AIR DRYER NEEDS SERVICING

Description:

Parts

Part #	Qty	Description
GV-109685X	1.00	AD-9 AIR DRYER

Labor

Description Technician
207VJK

13-BRACE IN ENGIENE COMPLETELY BROKEN

Description:

Labor

Description Technician

14-AIR FILTER

Description:

Parts

Part #	Qty	Description
GV-49998	1.00	AIR FILTER
Misc-	0.00	FILTER IS IN STOCK

Labor

Description Technician
207VJK

15-FLEX SERVICE A

Description:

Parts

Part #	Qty	Description
GV-BLK-15W40	40.00	OIL, 15W40

Labor

B

DATE	CUSTOMER ORDER NO.	DATE IN SERVICE	ENGINE MODEL	PUMP NO.	EQUIPMENT MAKE
09-MAY-2013			ISB		BLUE BIRD
		FAIL DATE	ENGINE SERIAL NO.	CPL NO.	EQUIPMENT MODEL
		07-MAY-2013	73222634	CPL307100	LTC-40
		PARTS DISP.	MILEAGE/HOURS	PUMP CODE	UNIT NO.
			32386		16

QUANTITY ORDERED	BACK ORDERED	QUANTITY SHIPPED	PART NUMBER	DESCRIPTION	PRODUCT CODE	UNIT PRICE	AMOUNT
------------------	--------------	------------------	-------------	-------------	--------------	------------	--------

OSN/MSN/VIN 4CF284992

COMPLAINT

CHECK ENGINE LIGHT. DERATED

CHECK FOR COOLANT LEAK AT RADIATOR OVER FLOW

SERVICE UNIT

CAUSE

DSSBCC1184

SUCKION TUBE IN THE DEF TANK CRACKED.

COOLANT TANK CRACKED.

SERVICE

CORRECTION

DSSBCC1184


CHECKED FOR FAULTS. HAD ACTIVE FAULT 3574 FOR DEF LINE PRESSURE. REMOVED THE FITTINGS AND LINES FROM THE DEF. CHECKED FOR BLOCKAGE. ALL WERE OK. REMOVED THE DEF DOSER INJECTOR. PERFORMED TEST FOR AIR IN THE SYSTEM. FOUND AIR IN THE SYSTEM. HOOKED UP REMOTE LINE AND INSTALLED INTO THE TANK. RAN TEST AND HAD NO AIR. THE SUCKION TUBE IN THE TANK IS CRACKED. THE TUBE IS BLUEBIRD. PART. REMOVED THE TANK AND REPLACED THE TUBE. INSTALLED THE TANK AND PERFORMED TEST. HAD NO AIR AND THE FAULT WENT INACTIVE. CHECKED FOR COOLANT LEAK. FOUND THE HOLDING TANK WAS CRACKED. DRAINED THE COOLANT. REMOVED THE TANK AND REPLACED. FILLED WITH COOLANT. CHANGED THE OIL AND FILTER. CHANGED THE AIR CLEANER AND THE FUEL FILTER. GREASED THE BUS. FOUND THE WIRING HARNESS GOING ACROSS THE ENGINE WAS RUBBING AND THE CLAMPS WERE OFF. INSTALLED THE CLAMPS. FOUND THE WIRING WAS RUBBING ON THE FRAME ON THE RIGHT SIDE. SECURED THE WIRING. RAN THE ENGINE AND PERFORMED REGEN. HAD NO FAULTS.

DID NOT REPLACE THE FUEL FILTER ON THE FRAME. THE FILTER WAS BACK ORDERED FROM BLUEBIRD.

COVERAGE

BILLABLE

REMARK

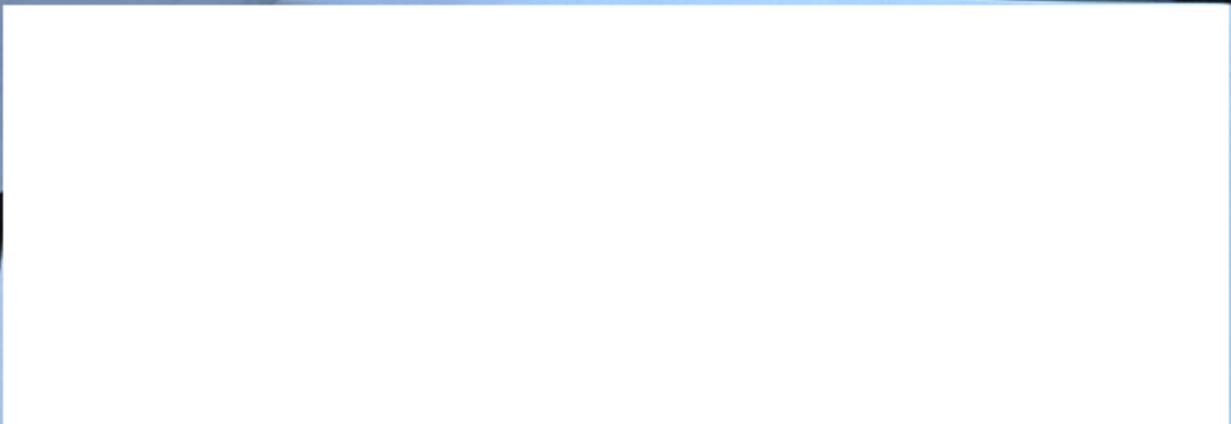

CUSTOMER ORDER NO.	DATE IN SERVICE	ENGINE MODEL	PUMP NO.	EQUIPMENT MAKE
SHIP VIA	FAIL DATE	ENGINE SERIAL NO.	CPL NO.	BLUE BIRD
SALESPERSON	PARTS DISP.	MILEAGE/HOURS	PUMP CODE	EQUIPMENT MODEL
1404		32386		LTC-40
UNIT NO.	16			

QUANTITY ORDERED	BACK ORDERED	QUANTITY SHIPPED	PART NUMBER	DESCRIPTION	PRODUCT CODE	UNIT PRICE	AMOUNT
------------------	--------------	------------------	-------------	-------------	--------------	------------	--------

QUANTITY ORDERED	BACK ORDERED	QUANTITY SHIPPED	PART NUMBER	DESCRIPTION	PRODUCT CODE	UNIT PRICE	AMOUNT
			OSN/MSN/VIN	4CF284992			
				DOUG 5-9-13 1:50			
1			1 LF3970	PAC, LF	FLG		
5			5 VV70509	PREMIUM BLUE OIL (GAL)	VALVOLINE		
1			1 FF5632	PAC, FF (S)	FLG		
1			1 2888114	KIT,AFM MOUNTING	CECO		

PARTS:
PARTS COVERAGE CREDIT:
TOTAL PARTS:
SURCHARGE TOTAL:
LABOR:
LABOR COVERAGE CREDIT:
TOTAL LABOR:
MISC.:
MISC. COVERAGE CREDIT:
TOTAL MISC.:
SHOP SUPPLIES
TAXES:

TAX EXEMPT NUMBERS: KS KS1N2U252M



TOTAL AMOUNT: US \$ 679.13

DATE

Description	Qty	Rate	Amount
Activity Bus			
Labor-Traced out Bad Heater Control	1.5		
Plug Fuse 20amp	3		
267047			
Environmental fee	1		

Total	\$104.85
-------	----------



Keeping You On the Road!

Description	3/9/2011	Due on receipt	3/9/2011
Activity Bus	Qty	Rate	Amount

Labor-Service call to tighten belts
Mileage-Service Call

0.75
24

#15

Total \$84.75

Description	Qty	Rate	Amount
-------------	-----	------	--------

Activity Bus

Labor-R & R Block Heater

2

Mileage-Delivery

24

Labor-Delivery

0.5

Total

\$198.50

Description	Qty	Rate	Amount
-------------	-----	------	--------

Activity Bus #15

Water Pump 3800737RX	1		
1028 Hose Clamp	3		
1016 Hose Clamp	1		
GS Coolant Hose Per In 1 3/4 Green RBR 24828	3.5		
Prime Antifreeze Coolant Gal	2		
Metric Cap Screw 12X80 73382	1		
Sal Ring CU3892095	1		
Gasket CU 3027924	1		
Tube/Water CU 3821718	1		
Seal Cover Kit RW5079K	1		
Labor-R & R Water Pump Water Tube, Seal Cover Kit	4.5		
Freight	1		
Environmental Fee	1		

Total			\$1,029.54
--------------	--	--	-------------------