

Invoice 7459

BILL TO

DATE
05/19/2022

PLEASE PAY
\$0.00

MAKE-MODEL

SERIAL-VIN

MILES-HOURS

PETERBILT

1xp5db9x96d894859

1304352 UNIT # 702

ACTIVITY	QTY	RATE	AMOUNT
parts ENGINE OVERHAUL KIT MCOH3569946			4,483.81T
parts TUBE AS JET 2764637	2		231.50T
parts CYLINDER HEAD C15 REMAN 62238	1		2,650.00T
parts LINER INSERT 9Y3368	6		621.36T
parts HEATER HOSE 389676799	1		13.55T
parts SPACER PLATE 6I4421	1		375.09T
parts FUEL LINE H-175	1		5.38T
parts ROTELLA 15W40	11		187.00T
parts COOLING SYSTEM FLUSH 5566	2		33.90T
parts R134A FREON	5.50		145.75T
parts POWER STEERING FLUID 8971212	2		19.98T
parts ANTIFREEZE ELC 50/50	12		180.00T
parts HYD HOSE 8U-08769 GASKET 2380296 GASKET	1		500.00T

PAID

ACTIVITY	QTY	RATE	AMOUNT
6I4558 FITTING 8736897 HARDWARE 5573828			
parts PAG OIL 8698	1		12.00T
LABOR COUNTERBORE ALL 6 CYLINDERS	1		1,000.00
LABOR PERFORM INFRAME OVERHAUL WITH ALL PARTS LISTED ABOVE. COUNTERBORED ENGINE FOR .030 SHIMS. INSTALLED INFRAME OVERHAUL KIT, OIL PUMP, THERMSOTATS, CYLINDER HEAD WAS COMPLETE REMAN FROM MIDWESTERN ENGINE REBUILDERS. ENGINE HAD BROKEN RINGS AND SCORED CYINDERS BEACUSE OF DIRT ENTRY INTO SYSTEM, FOUND A ROLL OF TAPE UNDER DRIVER SIDE AIR FILTER. NEW AIR FILTERS, FUEL FILTERS, OIL, AND FILTER WERE INSTALLED DURING REPAIR. FLUSHED COOLING SYSTEM AND REFILLED WITH NEW COOLANT. FOUND ACTIVE CODE FOR FUEL TEMP SENSOR, REPAIRED HARNES RIGHT NEAR ECM TO CORRECT PROBLEM. AC SYSTEM INOP, FOUND COMPRESSOR HAS POWER, BUT WILL NOT ENGAGE CLUTCH.	1		5,250.00
SHOP SUPPLIES SHOP SUPPLIES FEE	1		225.00T
PARTS PURCHASED ON CUSTOMER ACCOUNT ACCOUNT MHC T00485600892455 HEAD BOLTS, SPACER PLATE, EXHAUST HARDWARE, OIL PUMP, ETC NEWLY REBUILD ENGINES MUST RUN AT A MINIMUM TEMPERATURE OF 180 DEGREES AND 75% LOAD FOR FIRST 3-4 HOURS OF RUN TIME, WITH IDLE KEPT AT A MINIMUM DURING THIS TIME. INTERSTATE MCBEE RECOMMENDS THE USE OF A DYNAMOMETER FOR THIS BREAK IN. FAILURE TO USE PROPER BREAK-IN PROCEDURE WILL VOID INTERSTATE MCBEE WARRANTY. ENGINE WILL NEED OTHER OIL LEAKS FIXED SOON, FRONT HOUSING, AND REAR HOUSING LEAKING.			
LABOR TROUBLESHOOT AC SYSTEM, FOUND COMPRESSOR TO HAVE POWER TO CLUTCH BUT NOT OPERATING. REPLACED	1		875.00

ACTIVITY	QTY	RATE	AMOUNT
COMPRESSOR, ACUMULATOR, ORFICE TUBE, FLUSHED SYSTEM, ADDED PAG OIL, VACUUMED CHARGED. SYSTEM WORKED VERY WELL.			
		SUBTOTAL	
		TAX (8.8%)	
		TOTAL	
		PAYMENT	17,661.54
		TOTAL DUE	\$0.00
			THANK YOU.