

BUS: 608-828-6887

COLOR	YEAR	MAKE/MODEL	1PDXX47S14EB15428	153830/153830	TT3983
BLU	04	Ford F-450	PO NO.	RATE	PAYMENT
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	0.00	CHGT
08JAN04			17:00 14OCT16		22NOV16

READY OPTIONS: STK:D0540 DLR:41H100 AXL:PP

LIST	NET	TOTAL
------	-----	-------

LINE 000000 EACH TYPE HOURS
 A REPLACE TRANSMISSION.....S/O UNIT SHOULD BE HERE
 7000A AUTOMATIC TRANSMISSION ASSEMBLY - REMOVE
 AND INSTALL OR REPLACE (7000) - L
 4752 CT
 6507 CT

- 1 1C3Z*7V000*DRM REMAN TRANSMISSION ASY
- CORE CHARGE C
- 1 3C3Z*7A095*AA OIL COOLER ASY
- 1 F75Z*7B229*GA BRACKET
- 1 E7TZ*7086*A GASKET
- 1 DY*1040* SENSOR - HEGO
- 1 NAP-31638 GASKET
- 1 XC3Z*7B395*DA CABLE ASY - SELECTOR LEVER CO
- 1 YC3Z*9A758*AB CABLE ASY - THROTTLE CONTROL
- 1 1C3Z*7V000*DRM CORE RETURN

MISC 1 MAP14K1160-POWERTRAIN CONTROL MODULE
 CT
 PARTS: LABOR: OTHER: TOTAL LINE A:

153830 REMOVED COMPONENTS FOR ACCESS & CLEARANCE TO REMOVE
 TRANSMISSION ASSEMBLY. REPLACEMENT TRANSMISSION FOR PTO APPLICATION NOT
 AVAILABLE, INSTALLED NON-PTO TRANSMISSION ASSEMBLY. NOTED WIRES ON
 EXHAUST GAS OXYGEN SENSOR CHAPPED & BARE, REPLACED SENSOR. INSTALLED
 SHIFT CABLE & BRACKET POWERTRAIN CONTROL MODULE TO ADAPT FOR CHANGE.
 REPLACED EXTERNAL OIL TO AIR COOLER CORE. TESTED COOLER FLOW RATE &
 TOPPED OFF FLUID LEVEL. ROAD TESTED OPERATION OF UNIT. NOTED THROTTLE
 POSITION SENSOR WOULD NOT REGISTER 100%. TESTED CIRCUITS & FOUND
 CONTROL CABLE STRETCHED. REPLACED CABLE & VERIFIED REGISTERING FULL
 THROTTLE.

B DURING ROAD TEST SERPENTINE BELT CAME OFF.
 6209A TENSIONER ASSEMBLY - DRIVE BELT - REPLACE
 (6B209/6A228) - L

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MSC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

BLU 04 Ford F-450 1FDXX47S14EB15428 153830/153830 TT3083
DEL. DATE PROD. DATE WARR. EXP. PROMISED PO NO. RATE PAYMENT INV. DATE
08JAN04 DE 17:00 14OCT16 0.00 CHGT 22NOV16
V.O. OPENED READY OPTIONS: STK:D0540 DLR:41H100 AXL:PP

17:46 13OCT16 16:51 22NOV16

LINE OPCODE TECH TYPE HOURS

1 NAP-25060750 SERP BELT
1 MON-3300015 TENSIONER

LIST NET TOTAL

PARTS:

153830 INSPECTED FRONT ENGINE ACCESSORY DRIVE SYSTEM COMPONENTS &
FOUND TENSIONER PULLEY FOR ENGINE DRIVEN HYDRAULIC PUMP BROKE. REMOVED
COMPONENTS AS NEEDED TO REPLACE TENSIONER PULLEY & SERPENTINE BELT.
TESTED ALIGNMENT OF BELT.

EST:

MISCELLANEOUS SUPPLIES CHARGES
REPLACEMENT TRANSMISSION
ORDERED 10-31-16

Thank you for choosing [redacted]. Your satisfaction is very important to us. If you are not completely satisfied with your visit, Please contact our managers: [redacted] (Body Shop) [redacted] (Truck Service)
Thank you, [redacted]



ISUZU



LINCOLN

DESCRIPTION	
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	4838.93