

INVOICE NO INVOICE DATE 2020-10-21

PAYMENT TERMS DUE ON RECEIPT

SERVICE INVOICE

CUSTOMER NO PAGE NO PROPERTY OF THE PROPERTY O

CUSTOMER PO

METER :0

LOCATION

ITEM /

DESCRIPTION

QTY

PRICE

CORE

TOTAL

SEGMENT 1 TOTAL:

134-2012 \$

PARTS
LABOR
MISC.

SALES TAX

INVOICE TOTAL (USD) 4,829.48

Note: Electrical Components are Non-Returnable. Up to a 15% restock fee may be applicable on all other components. Thank you for your business.



INVOICE NO JW0091279-1

INVOICE DATE 2020-10-21

PAYMENT TERMS DUE ON RECEIPT

INVOICE TO:

CUSTOMER NO PAGE NO BP0005070 1 CUSTOMER PO -----

WORK SITE:

V

SALESMAN:

CONTACT :

SERVICE ORDER

:SW0091279

REF:

CEDARAPIDS CRUSH/SCREEN MODEL: 3054 CRUSHER

CUST UNIT:

METER : 0

S/N:44924

SERVICE INVOICE

UNIT: EQ0018837

SEGMENT : 1 BEARING WENT OUT FIELD LABOR

SEGMENT TYPE: Chargeable CEDARAPIDS CRUSH/SCREEN

MODEL:3054 CRUSHER

S/N:44924 CUST UNIT: UNIT:E00018837

WORK SITE:

METER :0

LOCATION

WORK DESCRIPTION

BEARING WENT OUT

CAUSE:

10/19/20 DROVE TO CUSTOMER LOCATION IN EDNA KS. CONTACTED CUSTOMER AND WAS TAKEN TO THE IMPACT CRUSHER. CUSTOMER STATED THAT HE DRAIN VALVE HAD A HOLE IN IT FROM SOMETHING INSIDE THE CRUSHER. REMOVED THREE COVERS OFF OF THE OUTSIDE AND COULD SEE THAT SOMETHING WAS BEATING AROUND INSIDE. STILL COULD NOT GET A GOOD VISUAL, REMOVED THE SIDE COVER AND CONTINUED INSPECTION.

CORRECTION:

10/19/20 FOUND ONE OF THE BOX BOLTS HAD CAME OUT OF THE TOP CORNER. REPLACED WITH A BOLT THAT WOULD FIT GRADE 8 WITH A LOCK NUT. ADDED SILICONE AND INSTALLED THE BOLT INTO THE HOLE. IN ORDER TO INSTALL THE WASHER AND NUT HAD TO CUT A PLATE OUT OF THE SIDE WHERE THE SPRAY BAR WOULD GO. INSTALLED THE WASHER AND NUT. BEGAN TO WELD THE PLATE BACK IN. CUSTOMER NOTIFIED THAT LOCATION WAS CLOSING FOR THE DAY. PUT AWAY TOOLS, CLEANED WORK AREA AND RETURNED TO THE SERVICE CENTER.

10/20/20 TO COMPLETE THE REPAIR PURCHASED SILICONE, WELDING ROD AND A CONE WIRE BRUSH. RETURNED TO QUARRY LOCATION IN EDNA, KS. CLEANED ALL OF THE OLD SILICONE OFF OF THE SURFACES AND FINISHED WELDING. CLEANED ALL OF THE DEBRIS OUT OF THE BOX. ADDED SILICONE AND BOLTED THE COVER BACK ON. CLEANED THE INSPECTION COVER PLATES, SEALED, AND BOLTED THE COVER BACK ON. PUT AWAY TOOLS AND CLEANED WORK AREA. NOTIFIED CUSTOMER THAT REPAIR WAS COMPLETE SO THAT THEY COULD INSTALL THE DRAIN PIPE AND FILL WITH OIL. RETURNED TO THE SERVICE CENTER.

ITEM / Lot ID	DESCRIPTION	QTY	PRICE	CORE	TOTAL
LABOR	82195 GASKET MAKER SHOP SUPPLIES MILEAGE 10/19/20 MILEAGE 10/20/20 BEARING WENT OUT	2.00 1.00 234.00 234.00	25.99 75.00 3.50 3.50		

Sales Order

Date	S.O. No.
7/27/20	12715

Name / Address			Ship	To		
				P.O. No.	Ship Date 7/27/20	Ship Via
Item		Description			L	UPS ipped
Dip & Bake Surge Balance Rotor Replace Bearings Assemble, Test & Paint Record While Running Final Hi-Pot Final Checklist MAT FGHT	Take Pictures Disassemble Inspect, Tolerances Clean Bake Re-lead Dip & Bake Surge Balance Rotor Replace Bearings Assemble, Test & Paint Record While Running Final Hi-Pot Final Checklist MATERIAL FREIGHT Sales Tax	Pusker	f	notos		
				Total		\$6,245.34

Signature

VOICE NO	INVOICE DATE
F50152907-1	2019-01-04
	NT TERMS N RECEIPT

	USTOMER NO BP0005070	PAGE 1	NO	
	CUSTON	MER PO		

PARTS INVOICE

INVOICE TO:

SHIP TO:

Check Number :

Order taken by

	SMAN VIA (JPS - NEXT DAY	ORDER NO CONTACT NAME:	PS0152907 DEL	IVERY TERMS:	
POS.	SHIP	B/O PART NUMBER Lot ID	/ DESCRIPTION	WRH	PRICE	TOTAL
1	3	0 4503000339 Mfg Code COM	BRG	10100		
		Mfg Code COM				
	, 2	0 446020301 Mfg Code COM	COLLAR	10100		
800	1	0 PSHT Mfg Code	PARTS -SHIPPING &	HANDL		
		g.				

Serial No 020190104000000003

Que jui

1,558.01

ACCEPTANCE:	
DATE.	

Part charges
SHOP SUPPLIES 1.00
Misc charges
BEARING HAS FAILED LOCKED UP

MENT 1 TOTAL:

Spec. Madenary. 144-3012

Parts of Tooling/ From Other Vendors Will be sending Detailed List.

 DICE NO INVOICE DATE 047914-1 2018-01-24 PAYMENT TERMS NET 1 DAY

CUSTOMER NO BP0005070

PAGE NO 1

CUSTOMER PO Mike

SERVICE INVOICE

WORK SITE:

: NAI T:

SERVICE ORDER

:SWO047914

INVOICE TO:

LPIDS CRUSH/SCREEN MODEL: 3054 CRUSHER

S/N:44924

REF:

: 0

IT TYPE: Chargeable

CUST UNIT:

UNIT:EQ0018837

r :

1 BEARING HAS FAILED LOCKED UP

FIELD LABOR

CUST UNIT:

APIDS CRUSH/SCREEN MODEL: 3054 CRUSHER SITE:

S/N:44924

TNIT:EQ0018837

: 0

LOCATION

DESCRIPTION

ERAR RAPIDS JAW CRUSHER 5ABVGF3054 SER 44924

'0/30/17 - DROVE TO CUSTOMER'S LOCATION AND INSPECTED UNIT. FOUND THAT THE UNIT AS LEAKING OIL OUT OF THE LABYRINTH SEALS AT THE PITMAN AND SIDE BARINGS. ETERMINED THAT THE UNIT NEEDED TO BE REBUILT. THE BEARING AND THE SEALS NEEDED O BE REPLACED. TECHNICIANS BEGAN REMOVING THE HOPPER SIDES AND THE CATWALK BOVE THE JAW.

INFORMED THE CUSTOMER OF THE FINDINGS, CUSTOMER REQUESTED A QUOTE BEFORE DDITIONAL REPAIRS CAN BE MADE.

TION:

1/14/17 - 11/15/17 RETURNED TO CUSTOMER' S LOCATION AND CONTINUED REMOVING THE ATWALK. REMOVED THE BELT AND WHEEL GUARDS. BEGAN PREPARING THE SHEAVE AND EIGHT FOR REMOVAL. REMOVED ALL OIL AND GREASE LINES, REMOVED THE UPPER HOSING JOLTS FOR THE SIDE BEARINGS. USED PORT-A-POWER TO REMOVE THE TOGGLE PLATE SHIMS. EMOVED THE TOGGLE PLATE.

1/16/17 - ONCE THE CRANE ARRIVED AND WAS SET UP WE REMOVED THE SHEAVE AND FIGHT BY PRESSING THEM OFF. REMOVED THE BOTTOM BOLTS FOR THE SIDE BEARINGS. EMOVED THE JAW FROM THE HOUSING BY PRESS AND CRANE. LOADED IT INTO THE TRUCK LONG WITH THE SHEAVE, WEIGHT, AND TOGGLE PLATE TO RETURN TO THE SHOP FOR EPAIR/CLEANING.

1/17/17 - UNLOADED THE JAW FROM THE TRAILER AND BROUGHT IT INTO THE SHOP. LOCKED UP ONTO CRIBBING. REMOVED OTHER PARTS AND PLACED INTO THE WASH BAY FOR LEANING.

.1/20/17 - BEGAN CLEANING THE JAW AND PREPARING FOR DISASSEMBLY, REMOVED THE END ND OUTER SEALS AND END COVER OFF OF BOTH SIDE BEARINGS.

1/29/17 - ATTEMPTED TO REMOVE THE SIDE BEARINGS, FOUND THAT TECHNICIAN NEEDED A PECIALIZED TOOL TO REMOVE BEARING.

2/18 ONCE THE TOOL ARRIVED TO THE SHOP, THE SIDE BEARINGS WERE REMOVED FROM THE



OICE NO INVOICE DATE 2018-01-24

PAYMENT TERMS NET 1 DAY CUSTOMER NO PAGE NO PAGE NO CUSTOMER POMIKE

SHAFT.

12/19 REMOVED THE SHAFT FROM THE HOUSING AND BEGAN PREPAIRING TO DISSASSEMBLE PITMAN BEARING.

12/20 PRESSED BOTH PITMAN BEARING OFF OF THE SHAFT, BEGAN CLEANING AND PREPAIRING FOR REASSEMBLY

12/21 PLACED PITMAN BEARING IS OIL HEATED TO 260 DEGREES AND INSTALLED THEM ONTO THE SHAFT. CLEANED THE PITMAN HOUSING AND INSTALLED THE SHAFT BACK INTO THE HOUSING. INSTALLED THE PITMAN END CAPS AND PITMAN LABYRINTH SEALS.

12/27 INSTALLED THE SIDE BEARING END CAPS AND PLACED BEARINGS IN HOUSING AFTER CLEANING HOUSING.

12/28 INSTALLED THE SIDE BEARING SEALS, HOUSING, AND BEARING.

12/29 - BEGAN INSTALLING THE TAPER SLEEVE ONTO THE SHAFT AND PRESSING TO 50% OF THE ORIGINAL BENCH CLEARANCE OF .013 HAD TO MOVE THE ASSEMBLY OUTSIDE OF THE SHOP TO FINISH.

1/2 - INSTALLED THE INSTALLATION NUT AND WRENCH AND REMOVED BEARING CLEARANCE FROM BOTH BEARINGS.

1/3 INSTALLED THE SIDE COVER O-RINGS, SIDE COVERS, AND CLEANED THE SHAFT FOR OUTER LABYRINTH TO MATE WITH AN INTERFERENCE FIT, INSTALLED THE OUTER SEALS AND SHAFT KEYWAY.

1/4 FINISHED UP THE JAY BY INSTALLING FITTINGS AND CLEANING THE EXCESS GREASE AND DIRT FROM THE TOGGLE PLATE, SHEAVE, AND WEIGHT.

1/5 - LOADED THE JAW ONTO THE TRUCK FOR TRANSPORT. LOADED THE SHEAVE, WEIGHTS, AND TOGGLE PLATE.

1/10 - ONCE THE CRANE WAS SET UP AT CUSTOMER' S LOCATION, INSTALLED THE JAW, CAP BOLTS, SHEAVE, AND WEIGHT.

1/11 - INSTALLED THE TOGGLE PLATE AND ADDED SHIMS, INSTALLED ALL HOSES AND FITTINGS.


1/12 - INSTALLED BELTS AND GUARDS ONTO THE SHEAVE AND WEIGHT. INSTALLED THE HOPPER SIDES.

./13 - INSTALLED THE CATWALK AND WELDED CROSSWALK BACK ONTO THE MAINFRAME. INISHED INSTALLING THE CATWALK AND BOLTING ALL THE GUARDS DOWN.

./19 - CUSTOMER INDICATED THAT THE UNIT HAD NO OIL FLOW ON ONE SIDE BEARING
FTER RUNNING FOR 30 MINUTES.
ROVE TO CUSTOMER'S LOCATION AND INSPECTED UNIT. REMOVED THE LINE GOING TO THE
JIDE BEARING AND FOUND THAT THE LINE HAD BEEN FILLED WITH GREASE AND OTHER
CONTAMINANTS. PURGED THE LINE AND THOROUGHLY CLEANED OUT LINE AND ENSURED PROPER
LOW GOING TO BEARING.

USTOMER ALSO INDICATED THAT THE SHIMS NEED TO BE ADJUSTED. REMOVED 2 INCHES OFF THE CLOSED SIDE SETTING TO ALLOW LARGER DISCHARGE ROCK TO PASS THROUGH. ESTED THE UNIT AND FOUND NO ADDITIONAL ISSUES AT THIS TIME.

QTY

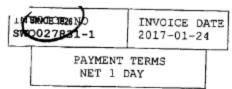

CUSTOMER PO

METER :0

SERVICE INVOICE

LOCATION LABETT KS

CUSTOM

ITEM / Lot ID

DESCRIPTION

QTY

PRICE

CORE

TOTAL

LABOR

SHIPPING HANDLING-M

1.00

CERAR RAPIDS JAW CRUSHER 5ABVGF3054

SEGMENT 1 TOTAL:

- m

134-3012 134-2012 134-2016


> PARTS LABOR MISC.

SALES TAX

INVOICE TOTAL (USD)

13,284.99

Note:

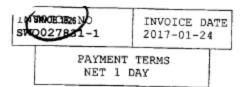

INVOICE TO:

SERVICE INVOICE

CUSTOM BP0005070 CUSTOMER PO -----

WORK SITE:

SALESMAN: CONTACT :

SERVICE ORDER

:SW0027831

REF:

CEDARAPIDS CRUSH/SCREEN MODEL: FSG6203-32 SCREEN METER :0

S/N:34H195P

CUST UNIT:

UNIT: EQ0020276

SEGMENT : 1 SEGMENT TYPE:Chargeable

CEDARAPIDS CRUSH/SCREEN MODEL:FSG6203-32 SCREEN

FIELD LABOR S/N:34H195P CHST DNITT:

UNIT: E00020276

WORK SITE: METER : 0

WORK DESCRIPTION

BEARING HAS FAILED LOCKED UP

CAUSE:

DROVE TO JOB SITE AND INSPECTED UNIT AND FOUND THAT DRIVEN SIDE HAS A LOT OF BRASS IN GEAR BOX, AND BEARINGS IS LOOSE FITTING TALK TO CUSTOMER ABOUT REPLACING ALL 6 BEARINGS AND TAPER LOCKS AND A COMPLETE SET OF GEARS, PLUS AN OIL SEAL FOR DRIVE SHAFT. NEED TO QUOTE JOB

CORRECTION:

1-11-2017 DROVE TO CUSTOMER'S LOCATION AND REMOVED BEARINGS AND GEAR SETS ON PLANT AND REPLACED ALL 6 BEARINGS AND 3 GEARS. WAITING ON THE NEW SEAL FOR GEAR BOX COVER TO ARRIVE.

RETURNED TO JOB SITE AND INSTALLED NEW SEAL IN SHAFT AND INSTALLED DRIVE BELT AND TESTED PLANT FOR PROPER OPERATION OF START UP AND RUN WORKING AS IT SHOULD. FOUND NO ADDITIONAL ISSUES AT THIS TIME.

COVERAGE :

275 miles round trip x2

ITEM / Lot ID	DESCRIPTION	QTY	PRICE CORE	TOTAL
090002 090001 620287 620258 12270 080002	ASSY LOC BRG SPHE GEAR SET (SET OF 3) WASHER S 10.30Z SILICN ASSY SEA ASSY WEA SHOP SUPPLIES MILEAGE QUARRY - SHIPG & HA	6 6 1 1 4 1 1 1.00 137.00 1.00	NE 40-1	

Quart

1		

No Date 9823 3/26/2014 47627

Sold To:		Ship to
Shipped VIA:	Terms: Net 30 Days	F.O.B. Gardner, Ks
UPS: Fedex	Truck Line:	Delivered: 10-Mar Pick-up

0-11	611			
Ordered	Shipped	Description		Amount
1	1	Re-wire Crushing Plant		
1	1	Ground Wire Test		
		134-2012 Quarky		
		134-0012		
		BuaRRY	ĺ	
		Court 1.		
			Sub Total	
			Freight	
- 1	1		Total Due:	\$33,580.00

Invoice

INVOICE NO INVOICE DATE
PSO029192-1 2015-10-29
PAYMENT TERMS

PAYMENT TERMS NET 1 DAY CUSTOMER NO BP0005070

PAGE NO

CUSTOMER PO VERBAL JOSE

PARTS INVOICE

POS. S	SHIP	B/0	PART NUM	BER /	DESCRIPTION	WRH	PRICE	TOTAL
		Mfg C	ode QJC					
14	8		086002002 ode QCR	9	PLATE, RETAINER 5064	11900		
15	8		07025428 oda QCR		CAPSCREW, INC X 2 LOCK	11900		
800	1	O C	COURT		QUARRY -SHIPPING & HA	ND		

Serial No 020151013030000

UPS GROUND 125V711F0368253351 125V711F0368102764

BRANCH 11500

6285

134-3012

INVOICE TOTAL (USD)	23,300.34
SUBTOTAL SALES TAX	
MISC CHARGES	
PARTS	

UPS #127327060350088139 10/12/15 BR.10300

ACCEPTANCE:	
DATE:	

. ., 1

PAYMENT TERMS
NET 1 DAY

Ti

CUSTOMER NO BP0005070

PAGE NO

CUSTOMER PO VERBAL JOSE

PARTS INVOICE

INVOICE TO:

SHIP TO:

Check Number :

Order taken by :

Quarry Tompactor

HALL, DAVID A. FEDEX PRIORITY SALESMAN ORDER NO PS0029192 DELIVERY TERMS: SHIP VIA CONTACT NAME: POS. SHIP B/O PART NUMBER / DESCRIPTION WRH PRICE TOTAL Lot ID 1 R 0 CR2704-HC25 5064 Imp 11900 Mfg Code ONI 10 0 CR-2699-3-CM40 LINER 11900 Mfg Code QVI 3 16 0 A0860020011 WEDGE, L 11900 Milita Code QUC 16 0 A0860020269 BRACKET 11900 Milita Code QUC 5 16 0 A0860020270 MASTER S 11900 Mifg Code QJC 16 0 A0860020062 SHIM, 1/ 11900 Mfg Code QJC 0 A0860020063 SHIM, .1 11900 16 Mfg Code QXC 11900 0 A0860020064 SHIM, .0 16 Mfg Code QJC 0 070034 CAPSCREW 11900 16 9 Hifg Code QJC COMPRESS 11900 0 A07453004 10 64 Hify Code QJC 11900 NUT NYLO 0 076000 11 16 Mfg Code QJC 11900 1"X4" SO 0 U1245A2 BOLT 12 20 Mrg Code OVI 11900 0 A0860020060 WEDGE, U 16 13 Mfg Code QJC