

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2294844
Bus Phone: [REDACTED]	Bus Phone: [REDACTED]	Invoice Date: 6/30/2015
Prv Phone: [REDACTED]	Prv Phone: [REDACTED]	Location: 24
		Work Order Number: 343350
		Payment Type: Finance
		Page: 1 of 1
		Work Performed By: CALE SCHOENING

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH		H09500S670625	HS670625M	

ALL/9027/62 Retail

CORRECTION:

THIS REPAIR ORDER IS FOR RETURN TRUCKING FOR COMBINE. ALSO WILL BE 10-CONCAVE INSERTS FOR CUSTOMER TO INSTALLED TO BE SHIPPED TO HIM IN HARRIS,MO.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH206756	INSERT	10.00	21.13	21.13	\$211.30	Y
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
P3750	SHIPPING & HANDLING	1.00	24.40	24.40	\$24.40	N
Labor: \$0.00		Parts: \$211.30	OL&M: \$0.00	Misc: \$24.40	Sub-Total: \$235.70	

Miscellaneous Charges:
Service Accessories

\$4.71

Finance Information

Customer PO No:	Type: Multi-use Acct US	Auth. No: 325469	Labor: \$0.00
Tax Exempt No:	Merchant No: 36000632		Parts: \$211.30
Advisor: LARRY SCHOENING	Card No: xxxxxxxxxx		OL&M: \$0.00
	Bill Code: 107	SHOP WORK HARVEST EQUIP.	Misc: \$29.11
	Credit Plan: 249	PURCHASE	Sales Tax: \$15.12
			Grand Total: \$255.53

*** DOCUMENT COPY ***

Ask about our exclusive 1 year warranty on parts & service.

TERMS AND CONDITIONS

Repayment Terms:

This purchase(s) is subject to the terms of the multi-use account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date:

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 1 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9010/501 Retail

CORRECTION:

MACHINE - PICK UP AND DELIVERY- THIS WILL BE SPLIT BETWEEN SERVICE DEPT. AND CUSTOMER. LARRY S. AND JEREMY AGREEMENT. 3/26/15.

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
P3901	MILEAGE DELIVERY LARGE AG	181.00	5.00	5.00	\$905.00	N
<i>Comments: bifr 3-30</i>						
S3980	DISCOUNTED TRUCKING	1.00	0.00	-905.00	(\$905.00)	N
Labor: \$0.00		Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$0.00	

ALL/9002/SHP/590 Retail

CORRECTION:

COMPLETED JOHN DEERE INSPECTION

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
S3970	INSPECTION DISCOUNT	1.00	0.00	-200.00	(\$200.00)	N
Labor: \$200.00		Parts: \$0.00	OL&M: \$0.00	Misc: (\$200.00)	Sub-Total: \$0.00	

ALL/9002/75 Retail

CORRECTION:

BLEW OFF COMBINE

Labor: \$169.50		Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$169.50	
-----------------	--	---------------	--------------	--------------	---------------------	--

9500/4179/SHF/A/10 Retail

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 2 of 22
		Work Performed By: GLEN SLOSS


Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/4179/SHF/A/10 Retail

REMOVED & INSTALLED SIDE HILL FEEDER HOUSE PADDLES ALL

Located support stand to put under feeder house.
Removed all shields and covers.
Released tension on spring and cable.
Removed back shaft speed sensor.
Removed hydraulic lines.
Removed primary gear case belt.
Removed upper feeder house belt.
Removed bolts holding feeder house on.
Rolled feeder house away from combine.
Installed in reverse order.

Pull paddle shaft out. Replace paddles and replace both bearings on shaft.

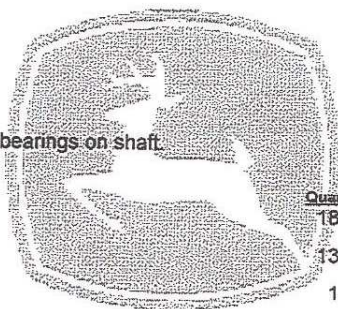

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7194	BOLT	18.00	1.41	1.41	\$25.38	Y
14M7400	LOCK NUT	13.00	1.66	1.66	\$21.58	Y
26H94	SHAFT KEY	1.00	2.25	2.25	\$2.25	Y
AE46699	PRESSED FL	2.00	11.40	11.40	\$22.80	Y
E76584	PRESSED FL	2.00	7.00	7.00	\$14.00	Y
H146237	PADDLE	2.00	146.22	146.22	\$292.44	Y
JD10007	BALL BEAR	1.00	31.06	31.06	\$31.06	Y
JD9407	BALL BEAR	1.00	20.25	20.25	\$20.25	Y
Labor: \$282.37		Parts: \$429.76	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$712.13	

9500/4177/CVP/10 Retail

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 3 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/4177/CVP/10 Retail
REMOVED & INSTALLED CONVEYOR PLASTIC GUIDES

Removed top doors from feeder house.
Removed 3 bolts from plastic strips.
Installed new strips with new bolts.

Replace top guides for feeder house chain.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
H171960	STRIP	3.00	25.77	25.77	\$77.31	Y
Labor: \$120.54		Parts: \$77.31	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$197.85	

9500/6339/TP/10 Retail
CORRECTION:
REMOVED & INSTALLED TOP SHAFT

Removed feeder house drive chain and feeder house conveyor chain.
Opened feed plate door to access bottom side of shaft.
Removed slip clutch from upper shaft.
Loosened set screws on gears.
Removed stripper plates from each side of feeder house. Slid gears to the center of shaft.
Removed 6 bolts from bearing holders.
Slid shaft to the right of feeder house.
Removed shaft out the bottom of the feeder house.
Installed in reverse order.

Replace top shaft and gears.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14H732	NUT	6.00	0.49	0.49	\$2.94	Y
14M7278	NUT	1.00	3.68	3.68	\$3.68	Y
26H103	SHAFT KEY	1.00	1.70	1.70	\$1.70	Y

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 4 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/6339/TP/10 Retail

H118583	CHAIN SPRO	3.00	62.63	62.63	\$187.89	Y
H118776	SET SCREW	6.00	3.64	3.64	\$21.84	Y
H147593	HOUSING	2.00	148.85	148.85	\$297.70	Y
H151566	SHAFT	1.00	534.40	534.40	\$534.40	Y
JD10020	BALL BEAR	1.00	45.00	45.00	\$45.00	Y
JD9373	BALL BEAR	1.00	68.60	68.60	\$68.60	Y

Labor: \$488.57 Parts: \$1,163.75 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,652.32

9500/6404/HFL/10 Retail

CORRECTION:

CHAIN HALF LINK - REMOVE & INSTALL- CHAIN WAS JUST REPLACED LAST YEAR CHECK CLOSER.
REMOVED & INSTALLED HALF LINK CHAIN

Look at chain, looked good.

Labor: \$27.63 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$27.63

9500/6906/UF/10 Retail

CORRECTION:

SHEET UPPER FLOOR - REMOVE & INSTALL REAR SEAL.
Replace seal and rubber seal at the top door.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7190	BOLT	8.00	0.84	0.84	\$6.72	Y
14M7296	FLANGE NUT	8.00	1.41	1.41	\$11.28	Y
H150133	SEAL	1.00	19.54	19.54	\$19.54	Y

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
		Invoice Date: 5/29/2015
		Location: 24
		Work Order Number: 334761
		Payment Type: Finance
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	
		Page: 5 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/6906/UF/10 Retail							
H173904	SEAL		1.00	88.51	88.51	\$88.51	Y
Labor: \$253.13	Parts: \$126.05	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$379.18			

9500/6404/FHD/10 Retail

CORRECTION:

CHAINS FEEDER HOUSE DRIVE - REMOVE & INSTALL ALL R.H. DRIVE CHAINS ON R.H. SIDE. DON'T REPLACE GUIDES.
REPLACE ALL CHAINS ALSO AND UPPER SPROCKET.
Replace all chains on right hand side of feeder house.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH135693	LINK CHAIN	1.00	139.52	139.52	\$139.52	Y
AH135694	LINK CHAIN	1.00	32.46	32.46	\$32.46	Y
Labor: \$114.33	Parts: \$171.98	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$286.31		

9500/5160/FHVS/25 Retail

CORRECTION:

ADJUSTED FEEDER HOUSE VARIABLE SPEED SHEAVES

Loosened upper feeder house drive belt.
Removed feeder house position sensor bracket if equipped.
Loosened upper variable sheave mounting bracket.
Adjusted reverser variable sheaves to 1/8 in. gap.
Tightened all hardware to spec.
Adjusted upper feeder house drive belt.
Reinstalled feeder house position sensor bracket if removed.

Labor: \$81.45	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$81.45
----------------	---------------	--------------	--------------	--------------------

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 6 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/7206/UFP/10 Retail

CORRECTION:

RETAINER UPPER FEEDER HOUSE FRAME PIVOT- REPLACE UPPER RETAINING BLOCKS IF NEEDED WHEN FEEDERHOUSE IS OFF.

Replace upper feeder house retainer and hooks.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H201727	RETAINER	2.00	48.51	48.51	\$97.02	Y
H201729	Retainer	2.00	40.64	40.64	\$81.28	Y
Labor: \$72.75		Parts: \$178.30	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$251.05	

ALL/9027/62 Retail

CORRECTION:

MISCELLANEOUS - WELD CRACKS ON R.H. SIDE OF SEP. AT CYLINDER DRIVE AREA.
Search for cracks, was well hidden high on left side. Clean area around crack. Weld crack

Labor: \$148.25	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$148.25
-----------------	---------------	--------------	--------------	---------------------

9500/6060/CLK/A/10 Retail

CORRECTION:

REMOVED & INSTALLED ALL CHROME RASP BARS

Removed upper cylinder door and plate.
Removed pin from dual range cylinder gear box.
Removed all cylinder filler plates.
Replaced rasp bars one at a time.
Tightened cap screw with square washer and locked nut to spec.
Installed filler plates.
Installed top feeder house plate.
Installed upper cylinder door.
Ran combine and checked operation.

Remove feeder house. Install feeder house.

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 7 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/6060/CLK/A/10 Retail

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7040	COTTER PIN	2.00	0.73	0.73	\$1.46	Y
AH151119	ANGLE	1.00	350.00	350.00	\$350.00	Y
AH205119	RASP BAR	1.00	613.43	613.43	\$613.43	Y
AH205120	RASP BAR	1.00	648.82	648.82	\$648.82	Y
AH205781	KIT	2.00	85.62	85.62	\$171.24	Y
H147486	COTTER PIN	2.00	0.78	0.78	\$1.56	Y
Labor: \$1,139.85		Parts: \$1,786.51	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,926.36	

9500/6403/A/25 Retail
CORRECTION:
ADJUSTED ALL CHAINS & BELTS

Loosened jam nuts.
Adjusted all chains and belts.
Tightened jam nuts.

Adjust belts on right side of machine.

Adjusted belts and chains. Remove half link from unload auger chain.

Labor: \$251.10	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$251.10
-----------------	---------------	--------------	--------------	---------------------

9500/4179/UT/B/10 Retail
CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
		Invoice Date: 5/29/2015
		Location: 24
		Work Order Number: 334761
		Payment Type: Finance
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	
		Page: 8 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/4179/UT/B/10 Retail

REMOVED & INSTALLED BOTH UPPER TAILING PADDLES

Opened and removed paddle access door from top of tailing elevator.
Loosened and removed paddle drive chain.
Removed mounting bolts and nuts from paddle.
Removed paddle.
Rotated paddle shaft and repeated for other paddle.
Installed in reverse order.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7396	LOCK NUT	4.00	1.29	1.29	\$5.16	Y
19M7868	SCREW	4.00	1.12	1.12	\$4.48	Y
H131639	PADDLE	2.00	3.16	3.16	\$6.32	Y
Labor: \$46.32		Parts: \$15.96	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$62.28	

9500/1357/UFH/10 Retail

CORRECTION:

REMOVED & INSTALLED UPPER FEEDER HOUSE BELT

Loosened tensioner for upper belt.
Removed strap on electric clutch module.
Removed bolt on reel pump brace arm and twisted arm up to get belt out.
Loosened reverser bracket.
Removed belt for reverser.
Installed new belt.
Reinstalled all parts in reverse order.

Install lower feeder house belt and adjust.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645 Bus Phone: 712-621-6055 Prv Phone: 712-621-6055	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645 Bus Phone: 712-621-6055 Prv Phone: 712-621-6055	Invoice Number: 2275218 Invoice Date: 5/29/2015 Location: 24 Work Order Number: 334761 Payment Type: Finance Page: 9 of 22 Work Performed By: GLEN SLOSS
--	--	---

Make/Model: JOHN DEERE 9500 SH	Meter: 6283	Serial Number: H09500S670625	Eq ID: HS670625M	Fleet No:
--	-----------------------	--	----------------------------	------------------

9500/1357/UFH/10 Retail H151952	V-BELT	1.00	135.88	135.88	\$135.88	Y
Labor: \$118.86	Parts: \$135.88	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$254.74		

9500/6338/TL/11 Retail
CORRECTION:
REMOVED TAILING ELEVATOR CHAIN HALF LINK

Removed half link from chain.
Reconnected chain and adjusted to spec.
Test ran.

Find half link. Remove. Adjust paddle chain and drive chain.

Labor: \$54.30	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$54.30
-----------------------	----------------------	-------------------------	---------------------	---------------------------

9500/5057/HY/E/10 Retail
CORRECTION:
DO THIS WHEN WE HAVE OILS DRAINED...HOSE HYDROSTATIC EACH- REMOVE & INSTALL ALL HYDROSTAT. HOSES THAT HAVE BUBBLES UNDER THE SKIN AS NEEDED.

REMOVE & INSTALL EACH HYDROSTATIC HOSE
Remove hose. Install new hose. Reinstall clamps.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH142758	HYDRAULIC	1.00	584.99	584.99	\$584.99	Y
T77613	O-RING	1.00	1.76	1.76	\$1.76	Y
T77814	O-RING	2.00	1.65	1.65	\$3.30	Y
T77857	O-RING	1.00	1.90	1.90	\$1.90	Y
T77932	O-RING	1.00	2.08	2.08	\$2.08	Y

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
		Invoice Date: 5/29/2015
		Location: 24
		Work Order Number: 334761
		Payment Type: Finance
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	
		Page: 10 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/5057/HY/E/10 Retail T78313	O-RING	2.00	4.37	4.37	\$8.74	Y
Labor: \$217.21	Parts: \$602.77	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$819.98		

9500/7052/CHAN/10 Retail

CORRECTION:

FRAME CHAFF SPREADER MAIN- REPLACE MISSING PIN.

Find a pin to fit. Clean out crop material so pin would go in. Install pin.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
A15147	SPRING LOC	1.00	1.05	1.05	\$1.05	Y
PP123	PICKER PI	1.00	0.87	0.87	\$0.87	Y
Labor: \$101.50	Parts: \$1.92	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$103.42		

9500/6933/CP/10 Retail

CORRECTION:

KNIFE BANK CHOPPER - REMOVE & INSTALL- TURN-

Pull knife bank and turn knives. Put back on.

Labor: \$53.80	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$53.80
----------------	---------------	--------------	--------------	--------------------

9500/1427/E/10 Retail

CORRECTION:

REPAIR REAR FLOOD LIGHTS OPERATION.

Found bad connection at plugs. Clean plugs.

Labor: \$50.56	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$50.56
----------------	---------------	--------------	--------------	--------------------

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 11 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/1408/SWS/10 Retail

CORRECTION:

STRAW WALKER PLUG SENSOR - REPAIR OPERATION.
REPLACED ACTUATOR AND ARM.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7012	COTTER PIN	2.00	0.33	0.33	\$0.66	Y
37M7072	SCREW	2.00	0.52	0.52	\$1.04	Y
AH134524	ARM	1.00	41.60	41.60	\$41.60	Y
AH150473	ACTUATOR	1.00	16.96	16.96	\$16.96	Y
H140628	NUT	2.00	1.34	1.34	\$2.68	Y
M84482	PIN FASTEN	1.00	7.54	7.54	\$7.54	Y
Labor: \$67.06		Parts: \$70.48	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$137.54	

9500/6927/LCG/10 Retail

CORRECTION:

AUGER LOWER CLEAN GRAIN - REMOVE & INSTALL, REPLACE SPROCKET AND BOTH BEARINGS AT THIS TIME.
Replace both bearings on lower clean grain auger.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7079	COTTER PIN	2.00	0.19	0.19	\$0.38	Y
AZ10044	ECCENTRIC	1.00	6.48	6.48	\$6.48	Y
AZ10045	ECCENTRIC	1.00	7.63	7.63	\$7.63	Y
H103264	PRESSED FL	2.00	1.90	1.90	\$3.80	Y
H133143	CHAIN SPRO	1.00	47.25	47.25	\$47.25	Y
H150269	SHAFT KEY	2.00	1.23	1.23	\$2.46	Y
H75952	Seal	1.00	14.05	14.05	\$14.05	Y
JD39102	BALL BEARI	1.00	19.30	19.30	\$19.30	Y

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 12 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/6927/LCG/10 Retail							
JD39103	BALL BEARI	1.00	18.70	18.70	\$18.70	Y	
Labor: \$271.01	Parts: \$120.05	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$391.06			

9500/3351/SWCRR/10 Retail

CORRECTION:

BEARING STRAW WALKER CRANKSHAFT REAR RIGHT - REMOVE & INSTALL BOTH BEARINGS.

Replace bearings on both sides.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH132823	BALL BEARI	1.00	40.49	40.49	\$40.49	Y
AH133191	ECCENTRIC	2.00	11.35	11.35	\$22.70	Y
H103265	PRESSED FL	4.00	4.22	4.22	\$16.88	Y
JD39104	BALL BEARI	2.00	35.91	35.91	\$71.82	Y
Labor: \$101.50	Parts: \$151.89	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$253.39		

9500/3351/SWCL/10 Retail

CORRECTION:

REMOVED & INSTALLED FRONT LEFT STRAW WALKER CRANKSHAFT BEARING

Removed crank shaft speed sensor.

Removed tone wheel.

Loosened and removed bearing lock collar.

Removed bearing and flange fittings.

Installed in reverse order.

Replace bearing on left front straw walker crank.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH133191	ECCENTRIC	1.00	11.35	11.35	\$11.35	Y

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 13 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	


9500/3351/SWCL/10 Retail							
AZ19427	BALL BEARI	1.00	43.21	43.21	\$43.21	Y	
H103265	PRESSED FL	2.00	4.22	4.22	\$8.44	Y	
Labor: \$217.21	Parts: \$63.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$280.21			

9500/3351/SWCRF/10 Retail

CORRECTION:

REMOVED & INSTALLED STRAW WALKER CRANKSHAFT RIGHT FRONT BEARING

Drained straw walker gear case oil if applicable.
Loosened secondary countershaft belt.
Loosened straw walker drive belt.
Removed secondary belt shield and tensioner pulley.
Removed secondary shaft pulley and hub.
Removed straw walker gear case pulley.
Removed pin from straw walker drive belt adjusting rod and removed rod.
Removed adjusting rod brackets from gear case.
Removed bolt and washer holding gear case to straw walker shaft.
Removed bolts from straw walker shaft bearing flanges.
Installed gear case puller.
Removed gear case from combine.
Removed bearing.
Reassembled in reverse order.
Adjusted belts.

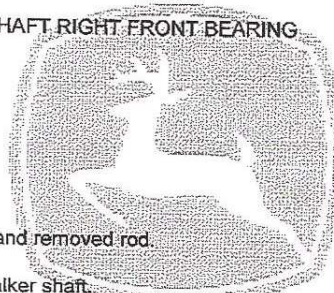

JOHN DEERE

Replace bearing on right hand front straw walker crank.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H103265	PRESSED FL	2.00	4.22	4.22	\$8.44	Y
Labor: \$434.42	Parts: \$8.44	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$442.86		

9500/3105/SWK/10 Retail

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 14 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/3105/SWK/10 Retail

GEAR CASE STRAW WALKER - REMOVE & INSTALL- MAKE SURE WE FILL WITH CORNHEAD GREASE WHEN OFF.
Pull straw walker gear case off. Check grease in case.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
24M7047	WASHER	3.00	0.89	0.89	\$2.67	Y
H138344	SHAFT KEY	1.00	4.49	4.49	\$4.49	Y
H155973	SCREW	1.00	2.61	2.61	\$2.61	Y
N134803	WASHER	1.00	3.32	3.32	\$3.32	Y

Labor: \$271.51 Parts: \$13.09 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$284.60

9500/1357/EG/A/10 Retail

CORRECTION:
REMOVED & INSTALLED ALL ENGINE BELTS

Removed outer most belt first, and then worked inward.
Put new belts on in reverse order.
Tightened all belts to specification.

Replace all engine belts and rotary screen jack shaft belt.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H101813	V-BELT	1.00	21.70	21.70	\$21.70	Y
H146636	V-BELT	1.00	13.85	13.85	\$13.85	Y
H153297	V-BELT	1.00	78.73	78.73	\$78.73	Y
H80896	V-BELT	1.00	11.57	11.57	\$11.57	Y

Labor: \$162.40 Parts: \$125.85 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$288.25

9500/7706/FUT/10 Retail

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712 621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 15 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/7706/FUT/10 Retail

LINES FUEL RETURN - REMOVE & INSTALL- REPAIR MASSIVE FUEL LEAK IN THIS AREA. CHECKOUT WATER PUMP CLOSER WHEN FUEL IS CLEANED UP.

Replace fuel return line to tank. Reroute line and tie up better.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R44302	TIE BAND	12.00	0.13	0.13	\$1.56	Y
TY22462	CLAMP	2.00	1.18	1.18	\$2.36	Y
TY22551	BULK HOSE	120.00	0.10	0.10	\$12.00	Y
Labor: \$140.61		Parts: \$15.92	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$156.53	

9500/3105/LA/10 Retail

CORRECTION:

REMOVED & INSTALLED LOADING AUGER GEAR CASE

Removed loading auger housing.
Removed shielding and rear cross auger cover from grain tank.
Removed belt.
Removed drive pulley.
Unbolted and removed gear case.
Installed gear case.
Torqued bolts.
Installed pulley and belt.
Installed removed shields.

Labor: \$325.82	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$325.82
-----------------	---------------	--------------	--------------	---------------------

9500/3105/LA/20 Retail

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
		Invoice Date: 5/29/2015
		Location: 24
		Work Order Number: 334761
		Payment Type: Finance
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Page: 16 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/3105/LA/20 Retail
GEAR CASE LOADING AUGER - REPLACED COMPLETE GEARCASE

Install new parts as needed.
Fill with oil.

Install new gear case. Install new drive pulley. Install new upper auger bearing.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7291	FLANGE NUT	1.00	3.07	3.07	\$3.07	Y
14M7589	LOCK NUT	1.00	3.30	3.30	\$3.30	Y
26M7008	SHAFT KEY	1.00	5.03	5.03	\$5.03	Y
49M4821	SHAFT KEY	1.00	2.43	2.43	\$2.43	Y
AH206089	KIT	1.00	185.64	185.64	\$185.64	Y
AH221847	PULLEY	1.00	110.40	110.40	\$110.40	Y
DE20100	GEAR CASE	1.00	1,842.64	1,842.64	\$1,842.64	Y
H136186	DRIVER	1.00	69.21	69.21	\$69.21	Y
TY26372	SYNTHETIC	5.00	20.48	20.48	\$102.40	Y

Labor: \$50.75

Parts: \$2,324.12

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$2,374.87

9500/7335/LGT/10 Retail

CORRECTION:

SWITCH LIGHT - REMOVE & INSTALL NEW SWITCH.

Mounting points were damaged on display panel. Glue switch to panel. Install missing switch knobs.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H150681	KNOB	2.00	6.40	6.40	\$12.80	Y

Labor: \$124.84

Parts: \$12.80

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$137.64

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail

Macedonia, IA 51549

Phone: (712) 486-2441

WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION
JEREMY CLARK
44848 HIGHWAY E
HARRIS MO 64645

JDC CONSTRUCTION
44848 HIGHWAY E
HARRIS MO 64645

Bus Phone: 712-621-6055

Prv Phone: 712-621-6055

Bus Phone: 712-621-6055

Prv Phone: 712-621-6055

SERVICE INVOICE

Invoice Number: 2275218

Invoice Date: 5/29/2015

Location: 24

Work Order Number: 334761

Payment Type: Finance

Page: 17 of 22

Work Performed By: GLEN SLOSS

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9500 SH

6283

H09500S670625

HS670625M

9500/7356/PZ/10 Retail

CORRECTION:

CAB BLOWER MOTOR PRESSURIZER -FAN NOISE, REPLACE IF NEEDED.
Remove buddy seat. Run fan. Could not detect any strange noises.

Labor: \$150.41

Parts: \$0.00

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$150.41

9500/1439/COA/10 Retail

CORRECTION:

MOTOR CONCAVE ACTUATOR LETS CONCAVE CREEP OPEN. REPAIR.
Replace actuator.

Part Number
AH170291

Description
ACTUATOR

Quantity
1.00

List Price
1,001.45

Net Price
1,001.45

Extended Price
\$1,001.45

Taxed Ind
Y

Labor: \$59.55

Parts: \$1,001.45

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$1,061.00

ALL/9010/2/38 Retail

CORRECTION:

REMOVE FRONT STRAW CHOPPER DOOR AND HAVE MERTES REPAIR IT.
Pull door off to be sent up to mertes for repair.

Reinstall door. Had to clearance the door to fit as it should.
REPAIR CHOPPER DOOR

\$43.47

OL&M Charges:

Description

REPAIR CHOPPER DOOR

Value
\$123.19

Labor: \$60.90

Parts: \$0.00

OL&M: \$123.19

Misc: \$0.00

Sub-Total: \$184.09

9500/4002/PDSA/10 Retail

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 18 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/4002/PDSA/10 Retail

REMOVE & INSTALL SEPERATOR DRIVE SHAFT U-JOINT ALL

Pull separator drive shaft and replace both u-joints. Install shaft and shields.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH207921	UNIVERSAL	2.00	105.53	105.53	\$211.06	Y
Labor: \$271.01		Parts: \$211.06	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$482.07	

9500/1718/10 Retail

CORRECTION:

FUEL TANK SENDER - REMOVE COVER OVER SENDER. CUSTOMER THINKS THAT THERE MAY BE WATER GETTING INTO FUEL TANK FROM TOP OF FUEL TANK SOMEWHERE

Fuel sender is on front side of tank and has no leaks at this time. Found no other things wrong at this time.

Labor: \$27.78	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$27.78
----------------	---------------	--------------	--------------	--------------------

ALL/1426/32 Retail

CORRECTION:

ELECTRICAL SYSTEM - DIAGNOSE AND REPAIR DIAL SPEED OPERATION. CUSTOMER STATES THAT THE HEADER CONTROL WORKS BUT NO DIAL-A-SPEED

Found actuator would not turn the valve. Take actuator off and test. Found board inside was bad. Replace board.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH139987	PRINTED CI	1.00	101.76	101.76	\$101.76	Y
Labor: \$126.88	Parts: \$101.76	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$228.64		

9500/6076/SHK/20 Retail

CORRECTION:

DRUM SIDE HILL - RECONDITION

Pull feederhouse drum out. Replace bearings and arms, the arms were bent. Adjust feeder house chain.

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Invoice Date: 5/29/2015
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 334761
		Payment Type: Finance
		Page: 19 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/6076/SHK/20 Retail

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7184	BOLT	7.00	0.73	0.73	\$5.11	Y
11M7059	COTTER PIN	2.00	0.33	0.33	\$0.66	Y
14M7298	FLANGE NUT	7.00	1.08	1.08	\$7.56	Y
AH126091	ARM	2.00	78.51	78.51	\$157.02	Y
H131087	BUSHING	2.00	9.98	9.98	\$19.96	Y
H138753	HOUSING	2.00	94.91	94.91	\$189.82	Y
H84026	HOOK	6.00	0.59	0.59	\$3.54	Y
JD8551	ECCENTRIC	2.00	8.06	8.06	\$16.12	Y
JD8552	BALL BEAR	2.00	17.87	17.87	\$35.74	Y
Labor: \$578.21		Parts: \$435.53	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,013.74	

9500/9002/CMS/41 Retail

CORRECTION:

COMBINE MACHINE SERVICE - PERFORM MAINTENANCE
CHANGE ALL FUEL FILTERS.

CHANGE DUAL RANGE OIL, CHANGE REVERSER OIL

Change engine gear case oil and filter.

Change hydraulic oil and filter.

Change hydro filter.

Change reverser oil.

Change primary countershaft gear case oil.

Change fuel filter and water separator. Larry said to.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH128449	HYDRAULIC FILTER	3.00	56.61	56.61	\$169.83	Y
AR86745	FILTER ELE	1.00	22.29	22.29	\$22.29	Y
AT81478	FILTER ELE	1.00	29.24	29.24	\$29.24	Y

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
		Invoice Date: 5/29/2015
		Location: 24
		Work Order Number: 334761
		Payment Type: Finance
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Page: 20 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/9002/CMS/41 Retail

TY26372	SYNTHETIC	5.00	20.48	20.48	\$102.40	Y
TY26408	GREASE	2.00	21.81	21.81	\$43.62	Y
TY6344Q	LOW VIS	78.80	4.26	4.26	\$335.69	Y
Labor: \$651.63		Parts: \$703.07	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,354.70	

9500/6961/10 Retail

CORRECTION:

CHECK OUT ALL CLEANING SHOE, CHAFFER, SIEVE AND LOWER CLEAN GRAIN AUGER TROUGH SEALS. THERE IS A RAG STUCK IN R.H. SIDE AT BOTTOM INSPECTION DOOR.

Found seals were bad around chaffer. Found clean grain door was worn out.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH133091	SEAL	35.00	0.55	0.55	\$19.25	Y
AH139391	DOOR	1.00	321.70	321.70	\$321.70	Y
H175540	SEAL	2.00	13.68	13.68	\$27.36	Y
H88769	ISOLATOR	80.00	0.22	0.22	\$17.60	Y
Labor: \$170.74		Parts: \$385.91	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$556.65	

9500/7052/CHR/10 Retail

CORRECTION:

FRAME CHAFFER - REMOVE & INSTALL-- REPLACE TOP SEAL ON L.H. SIDE.

Remove chaffer and sieves. Remove chaffer and sieve frames. Weld patches to inside of combine. Replace seals on chaffer and sieve frames. Drill out rivets in chaffer frame. Remove staples from sieve frame and drill holes for rivets. Reinstall chaffer and sieve frames. Reinstall chaffer and sieves. Test run combine.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7185	BOLT	2.00	0.77	0.77	\$1.54	Y
03M7248	BOLT	6.00	1.76	1.76	\$10.56	Y
14M7166	LOCK NUT	2.00	0.93	0.93	\$1.86	Y

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:


SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2275218
		Invoice Date: 5/29/2015
		Location: 24
		Work Order Number: 334761
		Payment Type: Finance
Bus Phone: 712-621-6055	Bus Phone: 712-621-6055	Page: 21 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/7052/CHR/10 Retail

14M7299	FLANGE NUT	6.00	1.89	1.89	\$11.34	Y
14M7396	LOCK NUT	5.00	1.29	1.29	\$6.45	Y
14M7400	LOCK NUT	4.00	1.66	1.66	\$6.64	Y
19M7786	SCREW	4.00	1.36	1.36	\$5.44	Y
19M7799	SCREW	5.00	1.88	1.88	\$9.40	Y
19M7943	CAP SCREW	2.00	3.77	3.77	\$7.54	Y
24H1283	WASHER	4.00	0.25	0.25	\$1.00	Y
AH133091	SEAL	35.00	0.55	0.55	\$19.25	Y
H126334	Lock Washer	4.00	1.62	1.62	\$6.48	Y
H133287	SEAL	2.00	13.75	13.75	\$27.50	Y
H133288	SEAL	2.00	7.93	7.93	\$15.86	Y
H137188	Seal	2.00	35.54	35.54	\$71.08	Y

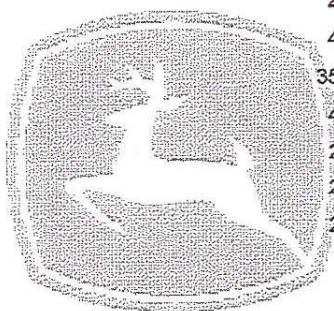

JOHN DEERE

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645 Bus Phone: 712-621-6055 Prv Phone: 712-621-6055	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645 Bus Phone: 712-621-6055 Prv Phone: 712-621-6055	Invoice Number: 2275218 Invoice Date: 5/29/2015 Location: 24 Work Order Number: 334761 Payment Type: Finance Page: 22 of 22 Work Performed By: GLEN SLOSS
--	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	6283	H09500S670625	HS670625M	

9500/7052/CHR/10 Retail						
M64720	RIVET	100.00	0.77	0.77	\$77.00	Y

Labor: \$1,574.27	Parts: \$278.94	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,853.21
-------------------	-----------------	--------------	--------------	-----------------------

Miscellaneous Charges:
Service Accessories

\$49.30

Finance Information

Customer PO No:	Type: Multi-use Acct US	Auth. No:	Labor: \$9,830.53
Tax Exempt No:	Merchant No:		Parts: \$10,713.55
Advisor: LARRY SCHOENING	Card No: xxxxxxxx		OL&M: \$123.19
	Bill Code: 705 - JD COMBINE PARTS/SERVICE		Misc: (\$150.70)
	Credit Plan: 120 DAYS NO PAYMENTS/NO INTEREST		Sales Tax: \$1,450.13
			Grand Total: \$21,966.70

*** DOCUMENT COPY ***

Ask about our exclusive 1 year warranty on parts & service.

JOHN DEERE

TERMS AND CONDITIONS

Repayment Terms: Customer Disclosure - This form must be signed by the customer to process the multi-use account transaction.

The following special terms, as described in the multi-use account credit agreement, apply to the attached invoice.

Up to 120 Days No Payments / No Interest Financing followed by the ANNUAL PERCENTAGE RATE (APR) applicable to your Account.

This purchase(s) is subject to the terms of the multi-use account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date:

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 4

Deliver To:

WARRANTY CUSTOMER WARRANTY CUSTOMER IA	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2105552 Invoice Date: 7/18/2014 Location: 24 Work Order Number: 311492 Payment Type: Account
Bus Phone: Prv Phone:	Bus Phone: 712-621-6055 Prv Phone: 712-621-6055	Page: 1 of 3 Work Performed By:

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5956	H09500S670625	HS670625M	

ALL/9997/1/23 Warranty

COMPLAINT:

PARTS WARRANTY REPAIR— REPLACE BATTERIES.
batteries bought at different dealership stamped 7-13-2013
SERVICE METER HOURS:

PREVIOUS INVOICE #:1122345

PREVIOUS INVOICE # DATE:7/13/2013

FAILED DATE:7/14/2014

FAILED PART #:ty25272

INSTALLED BY:customer

INSTALLED DATE:7-14-2013

DTAC CASE # IF APPLICABLE:


DIAGNOSTIC TIME:

CUSTOMER COMPLAINT: will not start

CAUSE:bad cell

CORRECTION: removed and installed new batteries

CORRECTION:

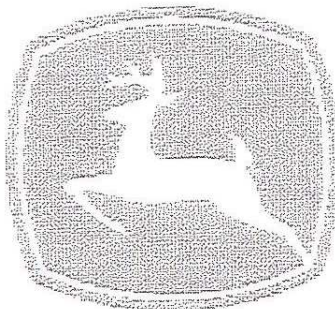

JOHN DEERE

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 4

Deliver To:

WARRANTY CUSTOMER WARRANTY CUSTOMER IA	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2105552 Invoice Date: 7/18/2014 Location: 24 Work Order Number: 311492 Payment Type: Account
Bus Phone: Prv Phone:	Bus Phone: 712-621-6055 Prv Phone: 712-621-6055	Page: 2 of 3 Work Performed By:

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5956	H09500S670625	HS670625M	

ALL/9997/1/23 Warranty
PARTS WARRANTY REPAIR

PREVIOUS INVOICE #:

PREVIOUS INVOICE # DATE:

FAILED DATE:

FAILED PART #:

INSTALLED BY:

INSTALLED DATE:


DTAC CASE # IF APPLICABLE:

DIAGNOSTIC TIME:

CUSTOMER COMPLAINT:

CAUSE:

CORRECTION:

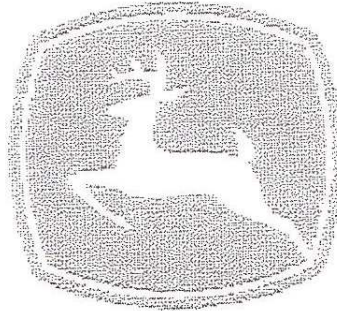

JOHN DEERE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY25272	DRY CHARGE	2.00	148.54	148.54	\$297.08	N

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 4	Deliver To:	Invoice Number: 2105552
WARRANTY CUSTOMER	JDC CONSTRUCTION	Invoice Date: 7/18/2014
WARRANTY CUSTOMER	44848 HIGHWAY E	Location: 24
IA	HARRIS MO 64645	Work Order Number: 311492
Bus Phone:	Bus Phone: 712-621-6055	Payment Type: Account
Prv Phone:	Prv Phone: 712-621-6055	Page: 3 of 3
		Work Performed By:

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5956	H09500S670625	HS670625M	


ALL/9997/11/23 Warranty
TY25272-CR CORE for:Dry Charged Battery -2.00 15.00 15.00 (\$30.00) N

Labor: \$0.00 Parts: \$267.08 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$267.08

Customer PO No:
Tax Exempt No: WARRANTY
Advisor: BRIAN WETZEL

*** DOCUMENT COPY ***

Ask about our exclusive 1 year warranty on parts & service.

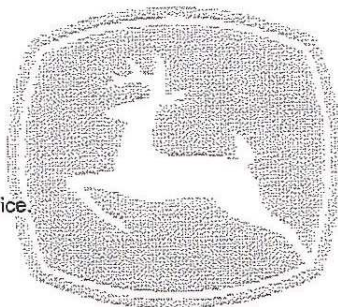

Labor: \$0.00
Parts: \$267.08
OL&M: \$0.00
Misc: \$0.00
Sales Tax: \$0.00
Grand Total: \$267.08

JOHN DEERE

Received by: Date:

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2103763
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 7/15/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 310657
		Payment Type: Finance
		Page: 1 of 4
		Work Performed By: TONY DASHNER

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5956	H09500S670625	HS670625M	

ALL/9027/62 Retail

CORRECTION:

INSTALL CONVEINENCE ELECTRICAL POWER STRIP IN CAB.

Installed power strip in cab.

Connected it to the 3 pin convenience outlet.

Soldered convenience plug onto the end of the power strip.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE37651	PLUG	1.00	45.96	45.96	\$45.96	Y
RE68495	FIELD INST	1.00	56.28	56.28	\$56.28	Y
Labor: \$228.91		Parts: \$102.24	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$331.15	

ALL/9010/2/38 Retail

CORRECTION:

MACHINE - CHECK FREON IN AC SYSTEM AND CHARGE IF NEEDED

Hooked up gauges and they were reading low.

Recovered the system.

Recovered 3 lbs 14 oz

Specification is 4 to 4.5.

Charged to 4.5

Tested operation.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY15951	REFRIGERANT 30 LB. CYLINDER	10.00	0.67	0.67	\$6.70	Y
Labor: \$288.52		Parts: \$6.70	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$295.22	

ALL/9010/38 Retail

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507


Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2103763
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 7/15/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 310657
		Payment Type: Finance
		Page: 2 of 4
		Work Performed By: TONY DASHNER

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5956	H09500S670625	HS670625M	

ALL/9010/38 Retail
CLEAN BATTERY CABLES, LOAD TEST BATTERIES .CHARGE BATTERIES... ADVISE CUSTOMER OF PROBLEM.
Charged batteries.
Cleaned cables and hooked up cables.
Load tested batteries.
Batteries Failed load test.
battery cable were corroded away.
Replaced batteries and cables.
Checked alternator output when i put new batteries in and it was not charging.
Hooked up wire for the alternator that was disconnected.

Filled coolant and tested operation.
Made sure that it did not leak or overheat.

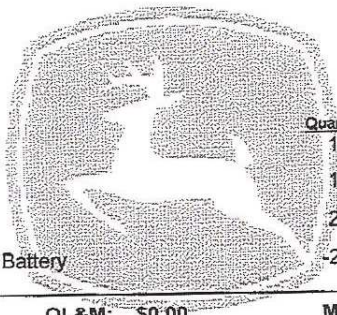

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH128413	BATTERY CA	1.00	57.47	57.47	\$57.47	Y
AH145256	BATTERY CA	1.00	64.17	64.17	\$64.17	Y
TY25272	DRY CHARGE	2.00	148.54	148.54	\$297.08	Y
TY25272-CR	CORE for:Dry Charged Battery	-2.00	15.00	15.00	(\$30.00)	Y
Labor: \$270.76		Parts: \$388.72	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$659.48	

9500/1353/10 Retail
CORRECTION:

JOHN DEERE

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION
JEREMY CLARK
44848 HIGHWAY E
HARRIS MO 64645

JDC CONSTRUCTION
44848 HIGHWAY E
HARRIS MO 64645

Bus Phone:
Prv Phone: 712-621-6055

Bus Phone: 712-621-6055
Prv Phone: 712-621-6055

Invoice Number: 2103763

Invoice Date: 7/15/2014

Location: 24

Work Order Number: 310657

Payment Type: Finance

Page: 3 of 4

Work Performed By: TONY DASHNER

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9500 SH

5956


H09500S670625

HS670625M

9500/1353/10 Retail
REMOVED & INSTALL RADIATOR

Drained coolant.
Removed clamps and hoses.
Removed air ducts.
Removed fan, fan shroud, and shields.
Removed air cleaner assembly.
Lifted out radiator.
Inspected seals around radiator.
Installed in reverse order.
Filled system with coolant.
Ran and tested.

Had some fins dented on new radiator. Straighten fins.
Ran for about an hour to make sure that it did not overheat.

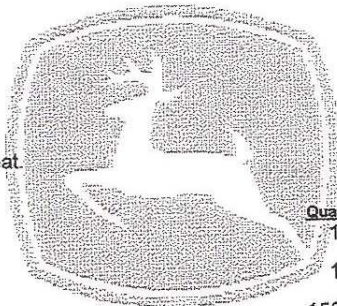

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH169362	RADIATOR	1.00	993.00	993.00	\$993.00	Y
AT162597	TANK	1.00	90.74	90.74	\$90.74	Y
H88769	ISOLATOR	150.00	0.22	0.22	\$33.00	Y
TY26575	COOL-GARD	1.00	14.88	14.88	\$14.88	Y

Labor: \$516.75

Parts: \$1,131.62

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$1,648.37

Gen- Retail
CORRECTION:
General Repairs-- PARTS ONLY NO LABOR, POWER SHAFT

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
---------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2103763
		Invoice Date: 7/15/2014
		Location: 24
		Work Order Number: 310657
		Payment Type: Finance
Bus Phone:	Bus Phone: 712-621-6055	Page: 4 of 4
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: TONY DASHNER

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5956	H09500S670625	HS670625M	

Gen- Retail S5302	SALES-AFTER SALES	1.00	500.00	500.00	\$500.00	N
----------------------	-------------------	------	--------	--------	----------	---

Labor: \$0.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$500.00	Sub-Total: \$500.00
---------------	---------------	--------------	----------------	---------------------

Miscellaneous Charges: \$49.30
Service Accessories

Finance Information

Customer PO No:
Tax Exempt No:
Advisor: LARRY SCHOENING

Type: Multi-use Acct US Auth. No: 638773
Merchant No: 36000632
Card No: xxxxxxxxxxxx9206
Bill Code: 705 - JD COMBINE PARTS/SERVICE
Credit Plan: 11303 - 150 DAYS NO PAYMENTS/NO INTEREST

Labor: \$1,304.94
Parts: \$1,629.28
OL&M: \$0.00
Misc: \$549.30
Sales Tax: \$208.84
Grand Total: \$3,692.36

*** DOCUMENT COPY ***

Ask about our exclusive 1 year warranty on parts & service.

JOHN DEERE

TERMS AND CONDITIONS

Repayment Terms: Customer Disclosure - This form must be signed by the customer to process the multi-use account transaction. The following special terms, as described in the multi-use account credit agreement, apply to the attached invoice. 150 Days No Payments and No Interest. Following the deferral period, the ANNUAL PERCENTAGE RATE (APR) applicable to your Account will apply to this purchase.

This purchase(s) is subject to the terms of the multi-use account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date:

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 5/27/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 297224
		Payment Type: Finance
		Page: 1 of 23
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

ALL/9002/SHP/590 Retail

CORRECTION:

COMPLETED JOHN DEERE INSPECTION

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
S3901	USE P3901	194.00	5.00	5.00	\$970.00	Y
Comments: BIFR 3-21						
Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$970.00	Sub-Total: \$1,170.00		

ALL/9010/2/38 Retail

CORRECTION:

MACHINE - DIAGNOSE OVERHEATING PROBLEM. COMBINE OVERHEATED WHEN WE BROUGHT FROM TOWN AND TAKING BACK.

Check out heating problem. Had to add 5 gals of coolant. Pressurize system. Run to find leak. Can not spot leak. It held pressure all weekend. Replace radiator cap. Tested, a little weak.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH148649	FILLER CAP	1.00	16.06	16.06	\$16.06	Y
TY26576	COOL-GARD	2.00	35.69	35.69	\$71.38	Y
Labor: \$313.81	Parts: \$87.44	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$401.25		

ALL/9010/3/38 Retail

CORRECTION:

MACHINE - DIAGNOSTIC TEST- REPAIR SIDE HILL LEVELING SETTLING PROBLEM. REPLACE SEAL KITS IN BOTH OF THE SIDE HILL LEVELING CYLINDER VALVE BLOCKS ON TOP.

Pull block off the top of right cylinder. Bleed valve, the ball was bad. Replace bleed vale and ball. Install o-ring kit in block. Pull block off left side, customer wanted it done also.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH96088	Plug	2.00	10.79	10.79	\$21.58	Y
AH96090	SEAL KIT	2.00	31.53	31.53	\$63.06	Y
H60816	BALL	2.00	2.08	2.08	\$4.16	Y

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION
JEREMY CLARK
44848 HIGHWAY E
HARRIS MO 64645

JDC CONSTRUCTION
44848 HIGHWAY E
HARRIS MO 64645

Bus Phone:
Prv Phone: 712-621-6055

Bus Phone: 712-621-6055
Prv Phone: 712-621-6055

Invoice Number: 2072661
Invoice Date: 5/27/2014
Location: 24
Work Order Number: 297224
Payment Type: Finance
Page: 2 of 23
Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

ALL/9010/3/38 Retail

H97288	GASKET	3.00	6.24	6.24	\$18.72	Y
L38718	BALL	2.00	0.78	0.78	\$1.56	Y

Labor: \$357.48 Parts: \$109.08 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$466.56

ALL/9027/62 Retail

CORRECTION:

MISCELLANEOUS - WELD FEEDERHOUSE FLOOR UNDER PADDLES. WELD FRAME ON L.H. SIDE OF CHAFF SPREADER FRAME. WELD CRACKS AT CENTER PIVOT OF REAR AXLE. WELD GRAIN TANK LINERS DOWN AS BEST THAT WE CAN.

Wedge patch panel down using wood block and pry bar. Spot welded in place so that patch would not hit auger any more. Spot welded entire patch on both sides and in the front of patches also. Used die grinder and carbide bit to v-notch cracks in center pivot and along spreader frame. Had to remove lower grease line completely in order to prevent damage to it from grinding and welding. Welded cracks and painted surfaces to prevent rusting. Installed grease line in place, removed rear grease line, and ground out crack in rear of pivot. Welded and painted. Installed grease line.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H127589	Clamp	2.00	3.34	3.34	\$6.68	Y

Labor: \$390.00 Parts: \$6.68 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$396.68

9500/3351/LFHR/10 Retail

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION
JEREMY CLARK
44848 HIGHWAY E
HARRIS MO 64645

JDC CONSTRUCTION
44848 HIGHWAY E
HARRIS MO 64645

Bus Phone:
Prv Phone: 712-621-6055

Bus Phone: 712-621-6055
Prv Phone: 712-621-6055

Invoice Number: **2072661**
Invoice Date: 5/27/2014
Location: 24
Work Order Number: 297224
Payment Type: Finance
Page: 3 of 23
Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/3351/LFHR/10 Retail
BEARING LOWER FEEDER HOUSE RIGHT HAND - REMOVE & INSTALL- REPLACE HOUSING AND BEARING AT THIS TIME.

Removed shiftable sprocket.
Removed toner wheel.
Removed bearing and housing.
Replaced parts as needed.
Set feeder house speed sensor to specification.

Remove slip clutch, tone wheel, and drive sprocket. Remove bearing housing and bearing. Found cracks in tin work where bearing mounts. Weld cracks. Replace bearing, housing, and missing bolts.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7193	BOLT	3.00	1.15	1.15	\$3.45	Y
14M7296	FLANGE NUT	3.00	1.41	1.41	\$4.23	Y
H93927	HOUSING	1.00	111.61	111.61	\$111.61	Y
JD9201	ECCENTRIC	1.00	6.97	6.97	\$6.97	Y
JD9202	BALL BEARI	1.00	22.01	22.01	\$22.01	Y

Labor: \$213.88 Parts: \$148.27 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$362.15

9500/6404/FHD/10 Retail
CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 5/27/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 297224
		Payment Type: Finance
		Page: 4 of 23
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/6404/FHD/10 Retail
REMOVED & INSTALLED FEEDER HOUSE DRIVE CHAIN

Removed shields.
Loosened feeder house drive chain idler.
Located master link and removed.
Removed drive chain.
Installed In reverse order.
Adjusted chain to spec.
Tightened idler.
Reinstalled shields.

Replace feeder house drive chain.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AH135693	LINK CHAIN	1.00	135.46	135.46	\$135.46	Y
Labor: \$52.16		Parts: \$135.46	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$187.62	

9500/4177/E/10 Retail

CORRECTION:

GUIDE EACH - REMOVE & INSTALL REPLACE FRONT WOOD GUIDE AND INSTALL BIG WASHERS ON BLOCK.

Loosened and removed feeder house drive chain.
Removed and installed feeder house drive chain guides.
Reinstalled drive chain and tightened to specification.
Ran and verified operation.

Replace both guides. Add extra washers to guides.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7400	LOCK NUT	4.00	1.66	1.66	\$6.64	Y
19M7347	CAP SCREW	1.00	3.02	3.02	\$3.02	Y

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 5/27/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 297224
		Payment Type: Finance
		Page: 5 of 23
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/4177/E/10 Retail							
19M7809	SCREW	2.00	3.23	3.23	\$6.46	Y	
19M7810	SCREW	3.00	3.15	3.15	\$9.45	Y	
19M7812	SCREW	1.00	3.77	3.77	\$3.77	Y	
28H1497	BUSHING	1.00	8.25	8.25	\$8.25	Y	
H128084	WASHER	4.00	7.00	7.00	\$28.00	Y	
H130530	GUIDE	2.00	48.60	48.60	\$97.20	Y	

Labor: \$26.08 Parts: \$162.79 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$188.87

9500/1357/RVD/10 Retail

CORRECTION:

REMOVED & INSTALLED REVERSER DRIVE BELT

Slowed feeder house speed to lowest speed.
Removed feeder house LH shield.
Lowered center idler.
Loosened spring carrier bolts to release pressure on sheave.
Removed belt and installed new one.
Adjusted belt to spec and reinstalled shield.

JOHN DEERE

Replace lower belt on reverser and adjust.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H161648	V-BELT	1.00	225.51	225.51	\$225.51	Y

Labor: \$197.41 Parts: \$225.51 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$422.92

9500/5160/RVD/10 Retail

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 5/27/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 297224
		Payment Type: Finance
		Page: 6 of 23
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/5160/RVD/10 Retail

SHEAVES REVERSER DRIVE - REMOVE & INSTALL - CHECK OUT LOWER SHEAVES CLOSER WHEN WE HAVE THE LOWER VAR. BELT. OUTER SHEAVES FOR WEAR. REPLACE OUTER SHEAVE PER JEREMY PHONE CALL 5/5/14.
Pull outer sheave off, key way bad. Cams bad also. Replace sheave, both cams, and seals.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH201417	PULLEY	1.00	399.13	399.13	\$399.13	Y
AH232574	CAM KIT	1.00	941.00	941.00	\$941.00	Y
Labor: \$249.14		Parts: \$1,340.13	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,589.27	

9500/7359/10 Retail

CORRECTION:
REMOVED & INSTALLED FIRE EXTINGUISHER

Unclipped holding clamp.
Removed extinguisher.
Installed in reverse order.

Mount fire extinguisher on ladder. Had to mount bracket first.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY15630	BRACKET	1.00	36.99	36.99	\$36.99	Y
TY26851	FIRE EXTIN	1.00	89.99	89.99	\$89.99	Y
Labor: \$26.08		Parts: \$126.98	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$153.06	

9500/4018/FDR/10 Retail

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION
JEREMY CLARK
44848 HIGHWAY E
HARRIS MO 64645

JDC CONSTRUCTION
44848 HIGHWAY E
HARRIS MO 64645

Bus Phone:
Prv Phone: 712-621-6055

Bus Phone: 712-621-6055
Prv Phone: 712-621-6055

Invoice Number: **2072661**
Invoice Date: 5/27/2014
Location: 24
Work Order Number: 297224
Payment Type: Finance
Page: 7 of 23
Work Performed By: GLEN SLOSS

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9500 SH

5954

H09500S670625

HS670625M

9500/4018/FDR/10 Retail
REMOVED & INSTALLED FINAL DRIVE VENT

Used a wrench and removed vent plug (top one).
Installed in reverse order.

Remove vent plugs and clean. Reinstall.

Labor: \$42.99

Parts: \$0.00

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$42.99

9500/4475/BS/44 Retail
CORRECTION:
FILLED BRAKE SYSTEM RESERVOIR

Removed cap and filled to proper level.
Installed cap.

Fill brake fluid.



Part Number
TY26180

Description
SUPER DUTY BRAKE FLUID

Quantity
1.00

List Price
4.47

Net Price
4.47

Extended Price
\$4.47

Taxed Ind
Y

Labor: \$34.40

Parts: \$4.47

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$38.87

9500/6404/UTD/10 Retail
CORRECTION:
CHAIN UPPER TAILING DRIVE - REMOVES & INSTALL
Replace upper tailings drive chain.

Part Number

Description

Quantity

List Price

Net Price

Extended Price

Taxed Ind

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 5/27/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 297224
		Payment Type: Finance
		Page: 8 of 23
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/6404/UTD/10 Retail
AH126007

ROLLER CHA

1.00 53.84 53.84 \$53.84 Y


Labor: \$52.16 Parts: \$53.84 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$106.00

9500/4164/UTC/10 Retail

CORRECTION:

SPROCKET UPPER TAILINGS PADDLE CHAIN - REMOVE & INSTALL. REPLACE BEARINGS AND TAILINGS CONVEYOR
UPPER SPROCKET. REPLACE TAILINGS CONVEYOR CHAIN

Loosened and removed upper and lower tailing drive chain.
Rotated conveyor paddle chain to locate master link.
Removed link.
Removed conveyor paddle chain.
Removed upper conveyor chain drive sprocket.
Removed inner and outer bearings and flange fittings.
Removed outer shaft cover plate.
Removed shaft and sprocket through outer opening.
Installed in reverse order.

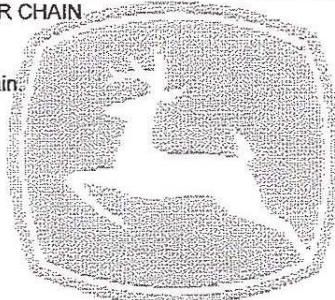

Replace upper tailings paddle chain sprocket and both bearings. Also replace chain.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH126239	ROLLER CHA	1.00	20.54	20.54	\$20.54	Y
AH131074	LINK CHAIN	1.00	261.42	261.42	\$261.42	Y
E10018	PRESSED FL	4.00	3.96	3.96	\$15.84	Y
H134603	CHAIN SPRO	1.00	44.51	44.51	\$44.51	Y
H205124	Spacer	1.00	11.13	11.13	\$11.13	Y
H84026	HOOK	4.00	0.58	0.58	\$2.32	Y

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 5/27/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 297224
		Payment Type: Finance
		Page: 9 of 23
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	


9500/4164/UTC/10 Retail

JD9313	BALL BEARI	2.00	17.00	17.00	\$34.00	Y
Labor: \$318.02	Parts: \$389.76	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$707.78		

9500/7555/90%Y/10 Retail

CORRECTION:
REMOVE PRIMARY SHAFT SHIELDING IN GRAIN TANK AND CLEAN DIRT OUT.

Removed drive shaft off of yoke on primary gear case.
Removed retaining nut on yoke.
Removed yoke.
Removed seal from gear case.
Installed new seal.
Installed yoke.
Installed nut and torqued to specification.
Installed driveshaft and torqued to specification.
Verified operation.

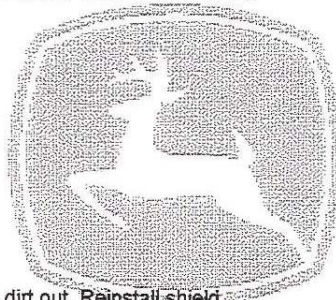

Remove primary shaft shield inside grain tank and clean dirt out. Reinstall shield.

Labor: \$91.51	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$91.51
----------------	---------------	--------------	--------------	--------------------

9500/6403/A/25 Retail

CORRECTION:
ADJUSTED ALL CHAINS & BELTS

Loosened jam nuts.
Adjusted all chains and belts.
Tightened jam nuts.

Adjust chain and belts.

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
		Invoice Date: 5/27/2014
		Location: 24
		Work Order Number: 297224
		Payment Type: Finance
Bus Phone:	Bus Phone: 712-621-6055	Page: 10 of 23
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/6403/A/25 Retail

Labor: \$203.68 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$203.68

9500/5051/RDS/20 Retail

CORRECTION:

VALVE REEL SPEED - REPAIR OIL LEAK AT HOSE ON VALVE.

Replace hose from reel pump to reel vale.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH131876	HYDRAULIC	1.00	62.99	62.99	\$62.99	Y
Labor: \$81.60	Parts: \$62.99	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$144.59		

9500/3351/FSW/A/10 Retail

CORRECTION:

BEARING FRONT STRAW WALKER CRANKSHAFT SEALS, REPLACE ALL ON FRONT AND CHECKOUT BEARINGS CLOSER. REPLACE FRONT STRAW WALKER CRANKSHAFT BEARING KITS PER PHONE CALL WITH JEREMY 5/9/14 SAID TO REPLACE.

Replace front bearings on straw walker crank and seals, all 4.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH168158	BEARING	4.00	55.66	55.66	\$222.64	Y
H154216	SEAL	8.00	16.55	16.55	\$132.40	Y
Labor: \$604.61	Parts: \$355.04	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$959.65		

9500/6404/UAD/10 Retail

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 5/27/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 297224
		Payment Type: Finance
		Page: 11 of 23
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/6404/UAD/10 Retail
REMOVED & INSTALLED UNLOADING AUGER DRIVE CHAIN

Loosened unloading auger drive chain tensioner.
Removed unloading auger drive chain.
Reinstalled drive chain and adjusted tensioner to proper spec.

Install new chain on unloading auger drive.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH126239	ROLLER CHA	1.00	20.54	20.54	(\$20.54)	Y
AH126837	LINK CHAIN	1.00	134.60	134.60	\$134.60	Y
Labor: \$52.16		Parts: \$114.06	OLE&M: \$0.00	Misc: \$0.00	Sub-Total: \$166.22	

9500/3351/LTS/10 Retail
CORRECTION:
BEARING LOWER TAILING ELEVATOR SHAFT OUTER - REMOVE & INSTALL BOTH OUTER SPROCKETS INNER
CONVEYOR SPROCKET AND BEARINGS BOTH SIDES.

Replace lower tailing elevator shaft bearings. Replace inter sprocket. Replace both outer sprockets and replace chain.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH121047	CHAIN SPRO	1.00	59.00	59.00	\$59.00	Y
AH126239	ROLLER CHA	1.00	20.54	20.54	\$20.54	Y
AH130572	CHAIN SPRO	1.00	56.00	56.00	\$56.00	Y
E10018	PRESSED FL	4.00	3.96	3.96	\$15.84	Y
H134603	CHAIN SPRO	1.00	44.51	44.51	\$44.51	Y

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE


JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 5/27/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 297224
		Payment Type: Finance
		Page: 12 of 23
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/3351/LTS/10 Retail						
JD9313	BALL BEAR	2.00	17.00	17.00	\$34.00	Y
Labor: \$104.33	Parts: \$229.89	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$334.22		

9500/5902/20 Retail
CORRECTION:
RECONDITIONED REEL PUMP DRIVE

Removed nut from pump shaft.
Removed pump drive assembly from pump.
Removed inner and outer bearings from drive assembly.
Cleaned all old grease from drive assembly cavity.
Installed new bearings and filled assembly with new grease.
Installed drive assembly onto pump.
Made sure woodruff key is in pump shaft.
Installed nut on pump shaft.
Torqued to specification.

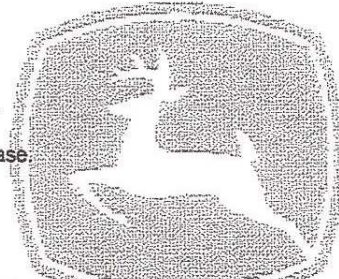

Pull reel pump off. Replace both bearings, nut, and shaft key. Install pump back on machine.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH201038	BALL BEAR	1.00	129.57	129.57	\$129.57	Y
AH201531	BALL BEAR	1.00	50.60	50.60	\$50.60	Y
B2984R	PLUG	1.00	0.40	0.40	\$0.40	Y
E59406	FLANGE NUT	1.00	1.17	1.17	\$1.17	Y
N34986	SHAFT KEY	1.00	3.72	3.72	\$3.72	Y
Labor: \$208.65	Parts: \$185.46	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$394.11		

9500/4164/UADE/10 Retail
CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
		Invoice Date: 5/27/2014
		Location: 24
		Work Order Number: 297224
		Payment Type: Finance
Bus Phone:	Bus Phone: 712-621-6055	Page: 13 of 23
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/4164/UADE/10 Retail

SPROCKET UNLOADING AUGER DRIVE EACH - REMOVE & INSTALL OUTER REAR MAIN DRIVE SPROCKET. [SMALL ONE]

Loosened unloading auger drive chain tensioner.
Removed each required sprocket to replace.
Reinstalled and adjusted drive chain.
Adjusted to specs.

Replace rear main drive sprocket the small on the unloading auger drive.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH128075	CHAIN SPRO	1.00	125.00	125.00	\$125.00	Y
Labor: \$52.16		Parts: \$125.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$177.16	

9500/6954/UAU/20 Retail

CORRECTION:

JACKSHAFT UNLOADING AUGER - RECONDITION, OUTER LOCK COLLAR IS LOOSE. REPLACE BOTH BEARINGS AND SHAFT.

Pull jack shaft out. Replace both bearings, lock collars, flanges and shaft keys. Reinstall shaft.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7190	BOLT	6.00	0.84	0.84	\$5.04	Y
14M7296	FLANGE NUT	6.00	1.41	1.41	\$8.46	Y
26M6787	SHAFT KEY	2.00	7.92	7.92	\$15.84	Y
AH133191	ECCENTRIC	2.00	11.13	11.13	\$22.26	Y
H103265	PRESSED FL	4.00	3.84	3.84	\$15.36	Y
H133024	COUNTERSHA	1.00	163.78	163.78	\$163.78	Y
JD39104	BALL BEARI	2.00	39.90	39.90	\$79.80	Y

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 5/27/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 297224
		Payment Type: Finance
		Page: 14 of 23
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/6954/UAU/20 Retail
P44478

SNAP RING

1.00 4.20 4.20 \$4.20 Y

Labor: \$312.98 Parts: \$314.74 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$627.72

9500/4319/SCJT/10 Retail

CORRECTION:

ROD STRAW CHOPPER JACKSHAFT TENSION - REMOVE & INSTALL IN PROPER POSITION.
Put straw chopper jackshaft tension back into place.

Labor: \$27.24 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$27.24

9500/7555/SFF/10 Retail

CORRECTION:

SEAL SIEVE FRAME - REMOVE & INSTALL REAR RUBBER SEAL ON REAR TAILINGS AUGER TROUGH AND SIEVE FRAME.

Pull chaffer and sieve out to check seals. Turn seal over on back of chaffer frame. Found seal bad on the front of cleaning fan.
Replace seal. Tried to fix seal on the left side of chaffer frame. Reinstall chaffer and sieve.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H133081	Weatherstrip	1.00	10.51	10.51	\$10.51	Y

Labor: \$816.42 Parts: \$10.51 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$826.93

9500/3351/RSW/A/10 Retail

CORRECTION:

BEARINGS REAR STRAW WALKER ALL - REMOVE & INSTALL SEALS AND CHECKOUT BEARINGS CLOSER WHEN OFF.
REPLACE REAR STRAW WALKER CRANKSHAFT BEARING KITS PER PHONE CALL WITH JEREMY ON 5/9/14 SAID TO REPLACE.

Replace all 4 rear straw walker crank bearings and the seals. Greased.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH168158	BEARING	4.00	55.66	55.66	\$222.64	Y

CONTINUED ON NEXT PAGE-->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 5/27/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 297224
		Payment Type: Finance
		Page: 15 of 23
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/3351/RSW/A/10 Retail
H154216

SEAL

8.00 16.55 16.55 \$132.40 Y

Labor: \$272.46 Parts: \$355.04 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$627.50

9500/4473/PCS/10 Retail

CORRECTION:

CLEAN OUT TUBE PRIMARY COUNTER SHAFT

Clean tube out on primary shaft.

Labor: \$87.45 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$87.45

9500/1049/ELL/10 Retail

CORRECTION:

PUMP ELECTRIC - REMOVE & INSTALL- REPLACE HOSE LEAKING FROM ELECTRIC PUMP.

Replace hose from fuel tank to filter.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH129058	HYDRAULIC HOSE	1.00	47.22	47.22	\$47.22	Y

Labor: \$10.80 Parts: \$47.22 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$58.02

9500/1357/ROD/10 Retail

CORRECTION:

REMOVED & INSTALLED ROTARY SCREEN DRIVE BELT

Removed old drive belt.

Pulled tension down.

Replaced belt and test ran.

Replace inter rotary screen drive belt.

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
Bus Phone:	Bus Phone: 712-621-6055	Invoice Date: 5/27/2014
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 297224
		Payment Type: Finance
		Page: 16 of 23
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/1357/ROD/10 Retail

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H146636	V-BELT	1.00	13.85	13.85	\$13.85	Y
Labor: \$49.29		Parts: \$13.85	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$63.14	

9500/1357/RS/10 Retail

CORRECTION:

BELT ROTARY SCREEN - REMOVE & INSTALL OUTER ROUND BELT
Replace outer rotary screen belt the round one.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H145158	ROUND BELT	1.00	55.34	55.34	\$55.34	Y
Labor: \$48.99		Parts: \$55.34	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$104.33	

9500/1353/70 Retail

CORRECTION:

WASH AND CLEAN RADIATOR AND ALL COOLERS.

Labor: \$27.58	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$27.58
----------------	---------------	--------------	--------------	--------------------

9500/7560/EGD/10 Retail

CORRECTION:

REMOVED & INSTALLED ENGINE GEAR CASE DIPSTICK O-RING

Removed the dipstick.
Removed the o-ring from the dipstick.
Installed new o ring.
Put dipstick back into gear case.
Replace both o-rings on dip stick.

CONTINUED ON NEXT PAGE-->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION
JEREMY CLARK
44848 HIGHWAY E
HARRIS MO 64645

JDC CONSTRUCTION
44848 HIGHWAY E
HARRIS MO 64645

Bus Phone:
Prv Phone: 712-621-6055

Bus Phone: 712-621-6055
Prv Phone: 712-621-6055

Invoice Number: 2072661

Invoice Date: 5/27/2014

Location: 24

Work Order Number: 297224

Payment Type: Finance

Page: 17 of 23

Work Performed By: GLEN SLOSS

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9500 SH

5954

H09500S670625

HS670625M

9500/7560/EGD/10 Retail

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
A4730R	O-RING	2.00	2.28	2.28	\$4.56	Y
<hr/>						
Labor: \$14.67	Parts: \$4.56	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$19.23		

9500/7317/TK/10 Retail

CORRECTION:

LIGHT TANK - REMOVE & INSTALL- REPAIR LIGHT OPERATION. REPAIR TWO BULBS THAT ARE OUT ON REAR HOOD.

Replace 2 bulbs in rear tail lamps.

Grain tank lamp found bad ground.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
AR62407	BULB	2.00	3.06	3.06	\$6.12	Y
Labor: \$109.17		Parts: \$6.12		OL&M: \$0.00		Misc: \$0.00
				Sub-Total: \$115.29		

9500/9002/CMS/41 Retail

CORRECTION:

PERFORMED MAINTENANCE COMBINE COMPLETE MACHINE SERVICE

Change fuel filter
Change water separator filter
Change engine oil and filter
Change engine gear case oil and filter
Change hydro filter
Change hydraulic oil and filter
Change reverser oil
Change primary countershaft gear case oil
Change dual ranger oil
Blow out engine air filters
Blow out cab filters
Change transmission oil
Grease

JOHN DEERE

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:


SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661 Invoice Date: 5/27/2014 Location: 24 Work Order Number: 297224 Payment Type: Finance Page: 18 of 23 Work Performed By: GLEN SLOSS
Bus Phone: Prv Phone: 712-621-6055	Bus Phone: 712-621-6055 Prv Phone: 712-621-6055	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/9002/CMS/41 Retail

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH128449	HYDRAULIC FILTER	3.00	53.86	53.86	\$161.58	Y
AR86745	FILTER ELE	1.00	21.21	21.21	\$21.21	Y
AT81478	FILTER ELE	1.00		27.82	\$27.82	Y

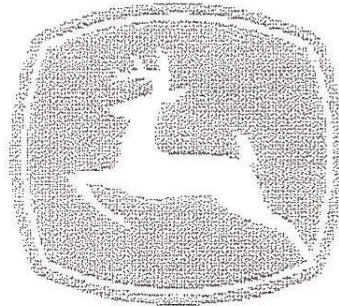

JOHN DEERE



40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 2072661
		Invoice Date: 5/27/2014
		Location: 24
		Work Order Number: 297224
		Payment Type: Finance
Bus Phone:	Bus Phone: 712-621-6055	Page: 23 of 23
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	5954	H09500S670625	HS670625M	

9500/6404/CV/10 Retail

Labor: \$66.24	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$66.24
-----------------------	----------------------	-------------------------	---------------------	---------------------------

Miscellaneous Charges:

Service Accessories \$49.30

Finance Information

Customer PO No:	Type: Multi-use Acct US	Auth. No: 94334	Labor: \$7,622.57
Tax Exempt No:	Merchant No: [REDACTED]		Parts: \$6,163.89
Advisor: LARRY SCHOENING	Card No: [REDACTED]		OL&M: \$0.00
	Bill Code: 705 - JD COMBINE PARTS/SERVICE		Misc: \$1,019.30
	Credit Plan: 11303 - 150 DAYS NO PAYMENTS/NO INTEREST		Sales Tax: \$1,036.44
			Grand Total: \$15,842.20

*** DOCUMENT COPY ***

Ask about our exclusive 1 year warranty on parts & service.

JOHN DEERE

TERMS AND CONDITIONS

Repayment Terms: Customer Disclosure - This form must be signed by the customer to process the multi-use account transaction.

The following special terms, as described in the multi-use account credit agreement, apply to the attached invoice.

150 Days No Payments and No Interest. Following the deferral period, the ANNUAL PERCENTAGE RATE (APR) applicable to your Account will apply to this purchase.

This purchase(s) is subject to the terms of the multi-use account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date:

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441

WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1933862
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Invoice Date: 9/26/2013
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 261035
		Payment Type: Finance
		Page: 1 of 2
		Work Performed By: DAN FLEMING

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9500 SH

5800

H09500S670625

HS670625M

MISC -F-0000425 Retail

COMPLAINT:

MISC REPAIR

Details:

Install GreenStar harness along with moisture sensor and mass flow. Install GS3 and receiver. Drove to his farm in Missouri to install. Had some software issues, sent down the brown box to update moisture sensor. Would not work, had missouri dealer send him key card to update. 330 miles


CORRECTION:

MISC REPAIR

Details:

Install GreenStar harness along with moisture sensor and mass flow. Install GS3 and receiver. Drove to his farm in Missouri to install. Had some software issues, sent down the brown box to update moisture sensor. Would not work, had missouri dealer send him key card to update.

Service Accessories

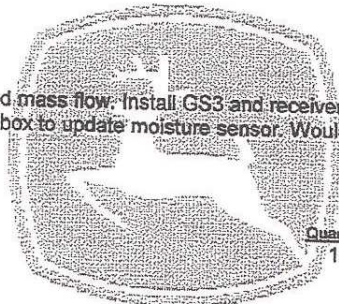

Part Number
AXE16786

Description
BRACKET

Quantity
1.00

List Price
239.79

Net Price
235.09

Extended Price
\$235.09

Taxed Ind
Y

JOHN DEERE

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441

WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645 Bus Phone: 7126214384 Prv Phone: 712-621-6055	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645 Bus Phone: 712-621-6055 Prv Phone: 712-621-6055	Invoice Number: 1933862 Invoice Date: 9/26/2013 Location: 24 Work Order Number: 261035 Payment Type: Finance Page: 2 of 2 Work Performed By: DAN FLEMING		
Make/Model: JOHN DEERE 9500 SH	Meter: 5800	Serial Number: H09500S670625	Eq ID: HS670625M	Fleet No:

/MISC -F-0000425 Retail
PF80773

WIRING HAR

1.00 126.42 126.42 \$126.42 Y

Labor: \$1,842.50

Parts: \$361.51

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$2,204.01

ATTENTION: Part(s) values for this invoice have changed. Original Invoice Parts Sale Value = \$455.26
INVOICE CONTAINS \$4.70 DISCOUNT

Miscellaneous Charges:
Service Accessories

\$45.96

Customer PO No: 75227 Tax Exempt No: Advisor: DAN FLEMING	Finance Information Type: Multi-use Acct US Auth: No: 635801 Merchant No: 36000321 Card No: 30000000000000001765 Bill Code: 107 - SHOP WORK HARVEST EQUIP. Credit Plan: 249 - PURCHASE
---	---

Labor: \$1,842.50
Parts: \$455.26
OL&M: \$0.00
Misc: \$45.96
Sales Tax: \$164.07

Grand Total: **\$2,507.79**

*** DOCUMENT COPY ***

Ask about our exclusive 1 year warranty on parts & service.

JOHN DEERE

TERMS AND CONDITIONS

Repayment Terms:

This purchase(s) is subject to the terms of the multi-use account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date:

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441

WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:


SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645 Bus Phone: 7126214384 Prv Phone: 712-621-6055	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645 Bus Phone: 712-621-6055 Prv Phone: 712-621-6055	Invoice Number: 1675284 Invoice Date: 10/23/2012 Location: 24 Work Order Number: 245257 Payment Type: Finance Page: 1 of 1 Work Performed By: DAN FLEMING
Make/Model: JOHN DEERE 9500 SH	Meter: H09500S670625	Eq ID: HS670625M

/MISC -F-0000425 Retail
COMPLAINT:
MISC REPAIR

CORRECTION:

MISC REPAIR—Repair header control-
Checked out header control operation, found nothing wrong. Drove through field and tried to get it to mess up.
Nothing messed up.
Also checked out sidehill operation.
Found it only tilted one way in auto mode.
Customer had me order sidehill control box and he would install.
Service Accessories

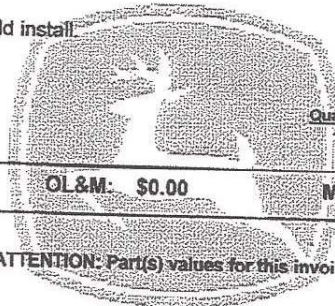

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH115905	CONTROL	1.00	1,314.53	1,314.53	\$1,314.53	Y
Labor: \$161.00		Parts: \$1,314.53	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,475.53	

Miscellaneous Charges:
Service Accessories

ATTENTION: Part(s) values for this invoice have changed. Original Invoice Parts Sale Value = \$1329.53

\$29.81

Customer PO No:
Tax Exempt No:
Advisor: DAN FLEMING

Finance Information

Type: Multi-use Acct US Auth. No: 548591
Merchant No: [REDACTED]
Card No: [REDACTED]
Bill Code: [REDACTED] - JD COMBINE PARTS/SERVICE
Credit Plan: 11243 - 120 DAYS NO PAYMENTS / NO INTEREST

Labor: \$161.00
Parts: \$1,329.53
OL&M: \$0.00
Misc: \$29.81
Sales Tax: \$106.43
Grand Total: \$1,626.77

*** DOCUMENT COPY ***

Ask about our exclusive 1 year warranty on parts & service.

TERMS AND CONDITIONS

Repayment Terms: Customer Disclosure - This form must be signed by the customer to process the multi-use account transaction.
The following special terms, as described in the multi-use account credit agreement, apply to the attached invoice.
120 Days No Payments and No Interest. Following the deferral period, the ANNUAL PERCENTAGE RATE (APR) applicable to your Account will apply to this purchase.

This purchase(s) is subject to the terms of the multi-use account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date:

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441

WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Internal Used Stock No. 115205 (Sold)	Internal Used Stock No. 115205 (Sold) JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64845	Invoice Number: 1667166
Bus Phone:	Bus Phone:	Invoice Date: 10/10/2012
Prv Phone:	Prv Phone:	Location: 24
		Work Order Number: 244387
		Payment Type: Account
		Page: 1 of 2
		Work Performed By: GLEN SLOSS
Make/Model:	Meter:	Serial Number:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625
		Eq ID: HS670625M
		Fleet No:

4420F370658 Internal

COMPLAINT:

CYLINDER FILLER PLATES, R&R OR REPLACE...

CORRECTION:


INSTALLED RASP BAR CYLINDER FILLER PLATES THAT WERE NOT WITH COMBINE WHEN IT CAME TO STORE FOR REPAIRS.

NOTE: For each additional plate, add 0.2 hours.

Remove filler plates.

Reinstall to specifications.

Service Accessories

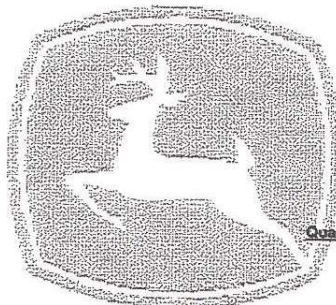

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

JOHN DEERE

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No:

Deliver To:

SERVICE INVOICE

Internal Used Stock No. 115205 (Sold)

Internal Used Stock No. 115205 (Sold)
JDC CONSTRUCTION
44848 HIGHWAY E
HARRIS MO 64645

Invoice Number: **1667166**

Invoice Date: 10/10/2012

Location: 24

Work Order Number: 244387

Payment Type: Account

Bus Phone:

Prv Phone:

Bus Phone:

Prv Phone:

Page: 2 of 2

Work Performed By: GLEN SLOSS

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9500SH 4WD COMBINE

5776

H09500S670625

HS670625M

4420F370658 Internal
H150837

DEFLECTOR

10.00

131.04

131.04

\$1,310.40

N

Labor: \$292.91

Parts: \$1,310.40

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$1,603.31


Miscellaneous Charges:
Service Accessories

\$32.07

Customer PO No:

Tax Exempt No: 1

Advisor: LARRY SCHOENING

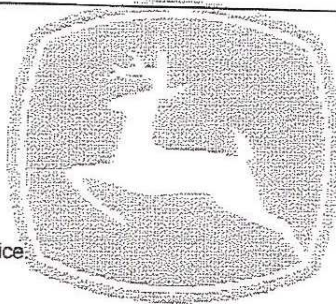

Labor: \$292.91

Parts: \$1,310.40

OL&M: \$0.00

Misc: \$32.07

Sales Tax: \$0.00

Grand Total: \$1,635.38

*** DOCUMENT COPY ***

Ask about our exclusive 1 year warranty on parts & service.

JOHN DEERE

Received by: Date:

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail

Macedonia, IA 51549

Phone: (712) 486-2441

WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Page: 1 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9500SH 4WD COMBINE

5776

H09500S670625

HS670625M

ALL/7000/QA/40 Retail

COMPLAINT:

MACHINE QUALITY ASSURANCE - INSPECT

INSPECT MACHINE QUALITY ASSURANCE

NOTE MACHINE HOURS

Note: Inspect the following areas:

LIGHT OPERATION

FREE OF OIL LEAKS

FLUID LEVELS

FILTERS (DATES)


SHIELDS, WEIGHTS, ETC

NOTES:

CORRECTION:

MACHINE QUALITY ASSURANCE INSPECTION

Service Accessories

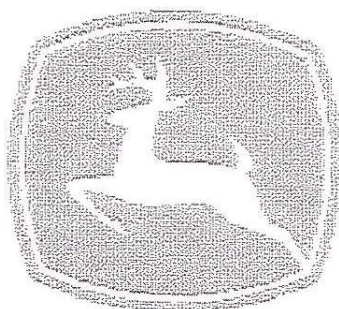

JOHN DEERE

Labor: \$0.00

Parts: \$0.00

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$0.00

9500/6927/LA/10 Retail

COMPLAINT:

AUGER LOADING AUGER - REMOVE & INSTALL

REMOVE & INSTALL LOADING AUGER

Remove lock pin, nuts, and shield

Remove spacer and bearing, remove auger from housing

Install new auger and assemble in reverse order

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Invoice Date: 10/10/2012
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 244387
		Payment Type: Finance
		Page: 2 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9500/6927/LA/10 Retail

CORRECTION:

REMOVED & INSTALLED LOADING AUGER

REPLACED LOWER AUGER AND UPPER AUGER


REPLACED MIDDLE SPROCKET AND BEARING.

REPLACED UPPER HOUSING BEARING.

THE MIDDLE SECTION THAT CONNECTS THE TWO HOUSINGS HAD TWO BOLTS BROKE.

HAD TO TAKE DOWN AND HAVE RANDY WELD NEW ONES IN.

ASSEMBLED EVERYTHING.

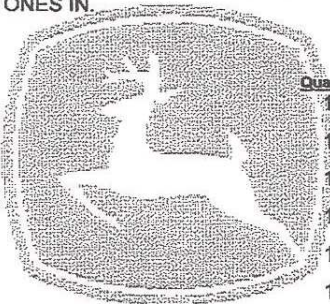

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M7818	SCREW	1.00	3.00	3.00	\$3.00	N
49M4821	SHAFT KEY	1.00	1.70	1.70	\$1.70	N
AH135444	HOUSING	1.00	180.25	180.25	\$180.25	N
AH146214	AUGER	1.00	580.00	580.00	\$580.00	N
AH146554	FLIGHT	1.00	365.00	365.00	\$365.00	N
AH206089	KIT	1.00	174.72	174.72	\$174.72	N
H136186	DRIVER	1.00	67.19	67.19	\$67.19	N
H137919	BUSHING	1.00	20.48	20.48	\$20.48	N
JD9219	BALL BEARING	1.00	14.84	14.84	\$14.84	N

Labor: \$555.75 Parts: \$1,407.18 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,962.93

ALL/9002/SHP/590 Retail

COMPLAINT:

COMBINE SHOP - JOHN DEERE INSPECTION

CORRECTION:

COMPLETED JOHN DEERE INSPECTION

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Page: 3 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

ALL/9002/SHP/590 Retail

Labor: \$200.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$200.00
-----------------	---------------	--------------	--------------	---------------------

9550/3351/LFHR/10 Retail

COMPLAINT:

BEARING LOWER FEEDER HOUSE RIGHT HAND - REMOVE & INSTALL
REMOVE & INSTALL LOWER FEEDER HOUSE RIGHT HAND BEARING. HAVE SHAFT REPAIRED AT MERTES.

Remove shiftable sprocket
Remove toner wheel
Remove bearing and housing
Replace parts as needed
Set feeder house speed sensor to specification

CORRECTION:

REMOVE & INSTALL LOWER FEEDER HOUSE RIGHT HAND BEARING. HAVE SHAFT REPAIRED AT MERTES.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7274	NUT	2.00	0.48	0.48	\$0.96	N
H138435	SET SCREW	2.00	3.14	3.14	\$6.28	N
H64376	SHAFT KEY	3.00	0.57	0.57	\$1.71	N
H93927	HOUSING	1.00	108.36	108.36	\$108.36	N
JD9201	ECCENTRIC	1.00	6.64	6.64	\$6.64	N
JD9202	BALL BEAR	1.00	20.96	20.96	\$20.96	N

Labor: \$288.16	Parts: \$144.91	OL&M: \$0.00	Misc: \$168.00	Sub-Total: \$601.07
-----------------	-----------------	--------------	----------------	---------------------

9550/6076/SHK/20 Retail

COMPLAINT:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Page: 4 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9550/6076/SHK/20 Retail
DRUM SIDE HILL - RECONDITION AS NEEDED.

RECONDITION SIDE HILL DRUM

???

CORRECTION:
RECONDITIONED SIDE HILL DRUM
PULL DRUM
REPLACE SHAFT, BEARING & HOUSING, ARMS, BUSHINGS AND PINS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7059	COTTER PIN	4.00	0.22	0.22	\$0.88	N
14M7291	FLANGE NUT	2.00	2.24	2.24	\$4.48	N
14M7589	LOCK NUT	2.00	2.41	2.41	\$4.82	N
19M7399	CAP SCREW	2.00	2.63	2.63	\$5.26	N
24H1368	WASHER	2.00	0.68	0.68	\$1.36	N
45M7040	PIN FASTEN	2.00	4.78	4.78	\$9.56	N
AH126091	ARM	2.00	74.00	74.00	\$148.00	N
H123734	SHAFT	1.00	140.00	140.00	\$140.00	N
H131087	BUSHING	2.00	11.57	11.57	\$23.14	N
H138753	HOUSING	2.00	95.00	95.00	\$190.00	N
JD10007	BALL BEAR	1.00	34.51	34.51	\$34.51	N
JD8551	ECCENTRIC	1.00	7.99	7.99	\$7.99	N
JD8552	BALL BEAR	2.00	14.25	14.25	\$28.50	N
JD9407	BALL BEAR	1.00	22.51	22.51	\$22.51	N

Labor: \$660.73 Parts: \$621.01 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,281.74

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Page: 5 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9550/4179/SHF/A/10 Retail

COMPLAINT:

PADDLES SIDE HILL FEEDER HOUSE BOTH.- REMOVE & INSTALL

REMOVE & INSTALL SIDE HILL FEEDER HOUSE PADDLES ALL

LOCATE SUPPORT STAND TO PUT UNDER FEEDERHOUSE
REMOVE ALL SHEILDS AND COVERS
RELEASE TENSION ON SPRING AND CABLE
REMOVE BACKSHAFT SPEED SENSOR
REMOVE HYDRAULIC LINES
REMOVE PRIMARY GEARCASE BELT AND UPPER FEEDER HOUSE BELT
REMOVE BOLTS HOLDING FEEDERHOUSE ON
ROLL FEEDERHOUSE AWAY FROM COMBINE
INSTALL IN REVERSE ORDER

CORRECTION:

REMOVE & INSTALL SIDE HILL FEEDER HOUSE PADDLES ALL

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7194	BOLT	1.00	0.94	0.94	\$0.94	N
14M7400	LOCK NUT	1.00	1.22	1.22	\$1.22	N
26H94	SHAFT KEY	1.00	1.52	1.52	\$1.52	N
AE46699	PRESSED FL	1.00	10.64	10.64	\$10.64	N
AH135613	DRIVE SPRO	1.00	158.34	158.34	\$158.34	N
E76584	PRESSED FL	1.00	6.54	6.54	\$6.54	N
H146237	PADDLE	2.00	136.51	136.51	\$273.02	N
JD7788	LUBRICATIO	1.00	0.89	0.89	\$0.89	N
Labor: \$264.29		Parts: \$453.11	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$717.40	

9550/4164/LFHR/10 Retail

COMPLAINT:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Page: 6 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	


9550/4164/LFHR/10 Retail

SPROCKETS FEEDER HOUSE RIGHT HAND - REMOVE & REPLACE ALL SPROCKETS AND CHAINS ON R.H. SIDE OF FEEDERHOUSE.

CORRECTION:

REPLACE ALL SPROCKETS ON RIGHT SIDE OF FEEDERHOUSE
HARD TO GET DOUBLE SPROCKET IDLER OFF FROM SHAFT
HAD TO CUT PULLEY TO GET OFF.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AFH205780	IDLER SPRO	2.00	26.01	26.01	\$52.02	N
AH109788	TAPERED RO	1.00	57.00	57.00	\$57.00	N
AH135611	Drive Sprocket	1.00	267.54	267.54	\$267.54	N
AH135614	DRIVE SPRO	1.00	158.34	158.34	\$158.34	N
AH135693	LINK CHAIN	1.00	125.43	125.43	\$125.43	N
AH135694	LINK CHAIN	1.00	29.18	29.18	\$29.18	N
AH153261	Drive Sprocket	1.00	316.69	316.69	\$316.69	N
SW60COUS	CHAIN LINK	1.00	2.00	2.00	\$2.00	N

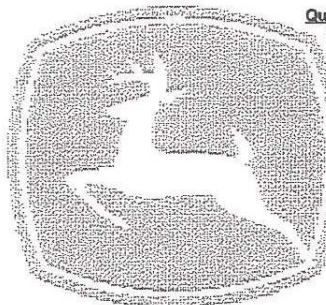

Labor: \$638.07 Parts: \$1,008.20 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,646.27

JOHN DEERE

9550/6404/CV/10 Retail

COMPLAINT:

CHAIN CONVEYOR - REMOVE & INSTALL
REMOVE & INSTALL CONVEYOR CHAIN

Remove and Install Feeder House Conveyor Chain

Loosen conveyor chain adjusting eye bolts. Rotate conveyor chain to locate master links. Remove master links. Connect new conveyor chain to old conveyor chain with old master links. Rotate lower feeder house shaft, feeding in new chain while feeding out old chain until new chain come to end. Disconnect old chain from new chain. Install new master links. Adjust conveyor chain to spec. Tighten eye bolts

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384 Prv Phone: 712-621-6055	Bus Phone: 712-621-6055 Prv Phone: 712-621-6055	Page: 7 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9550/6404/CV/10 Retail

CORRECTION:

CHAIN CONVEYOR - REMOVE & INSTALL
REMOVE & INSTALL CONVEYOR CHAIN

Remove and Install Feeder House Conveyor Chain

Loosen conveyor chain adjusting eye bolts. Rotate conveyor chain to locate master links. Remove master links. Connect new conveyor chain to old conveyor chain with old master links. Rotate lower feeder house shaft, feeding in new chain while feeding out old chain until new chain come to end. Disconnect old chain from new chain. Install new master links. Adjust conveyor chain to spec. Tighten eye bolts

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH137604	CONVEYOR	1.00	832.76	832.76	\$832.76	N
AH137630	CHAIN LINK	3.00	4.09	4.09	\$12.27	N
Labor: \$264.29		Parts: \$845.03	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,109.32	

9550/4164/CCR/10 Retail

COMPLAINT:

SPROCKET CONVEYOR CHAIN REAR - REMOVE & INSTALL FEEDERHOUSE AT THIS TIME.
REMOVE & INSTALL REAR CONVEYOR CHAIN SPROCKETS AND BEARINGS.

Remove necessary components in order to remove feeder house from machine
Separate chain, remove slip clutch and remove wear plates
Loosen sprockets and remove shaft from machine
Install new sprockets and hardware
Reinstall shaft and reassemble feeder house
Reinstall on machine

CORRECTION:

REMOVE AND INSTALLED FEEDERHOUSE AT THIS TIME.—REMOVED OLD SPROCKETS,BEARINGS, HOUSINGS
CHECKED SHAFT OVER LOOKED GOOD
REPLACED BEARING,HOUSING AND SPROCKETS AND PUT BACK TOGETHER.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507


Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Page: 8 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9550/4164/CCR/10 Retail

14H732	NUT	6.00	0.33	0.33	\$1.98	N
19M7783	SCREW	3.00	0.79	0.79	\$2.37	N
24M7101	WASHER	3.00	0.94	0.94	\$2.82	N
26H103	SHAFT KEY	1.00	1.19	1.19	\$1.19	N
H118583	CHAIN SPRO	3.00	62.00	62.00	\$186.00	N
H118776	SET SCREW	2.00	2.90	2.90	\$5.80	N
H147593	HOUSING	2.00	149.00	149.00	\$298.00	N
H171960	STRIP	3.00	24.08	24.08	\$72.24	N
JD10020	BALL BEARL	1.00	50.00	50.00	\$50.00	N
JD9373	BALL BEARL	1.00	76.22	76.22	\$76.22	N
T77613	O-RING	2.00	1.25	1.25	\$2.50	N
T77814	O-RING	1.00	1.17	1.17	\$1.17	N
T77857	O-RING	1.00	1.35	1.35	\$1.35	N
T77932	O-RING	1.00	1.48	1.48	\$1.48	N

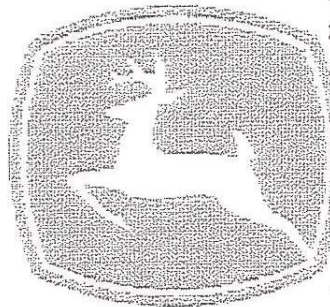

Labor: \$541.50 Parts: \$703.12 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,244.62

9550/6906/LFC/10 Retail

COMPLAINT:

SHEET LOWER FEEDERHOUSE FLOOR WITHOUT CONTOUR MASTER - REMOVE & INSTALL

REMOVE & INSTALL LOWER FLOOR WITHOUT CONTOUR MASTER SHEET

???

CORRECTION:

REMOVE FLOOR AND REPLACED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Page: 9 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9550/6906/LFC/10 Retail									
AH159703	FLOOR		1.00	934.19	934.19	\$934.19		N	

Labor: \$362.59 Parts: \$934.19 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,296.78


9550/1357/UFH/10 Retail

COMPLAINT:

BELT UPPER FEEDER HOUSE - REMOVE & INSTALL-PUT OLD F.H. DRIVE BELT AND BEATER BELTS IN CAB FOR CUSTOMER TO TAKE.

REMOVE & INSTALL UPPER FEEDER HOUSE BELT

Loosen tensioner for upper belt
Remove strap on electric clutch module
Remove bolt on reel pump brace arm and twist arm up to get belt out
Loosen reverser bracket
Remove belt for reverser
Install new belt
Reinstall all parts in reverse order (make sure to set reverser gap at 1/8 in and make sure belt is running straight)

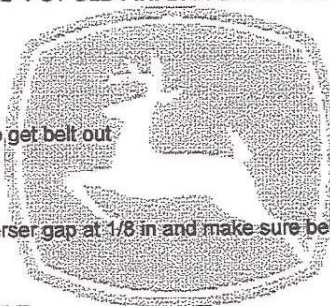

CORRECTION:

REMOVED & INSTALLED UPPER FEEDER HOUSE BELT

Loosen tensioner for upper belt
Remove strap on electric clutch module
Remove bolt on reel pump brace arm and twist arm up to get belt out
Loosen reverser bracket
Remove belt for reverser
Install new belt
Reinstall all parts in reverse order (make sure to set reverser gap at 1/8 in and make sure belt is running straight)

JOHN DEERE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H151952	V-BELT	1.00	128.12	128.12	\$128.12	N
Labor: \$264.29	Parts: \$128.12	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$392.41		

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Page: 10 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9550/1357/BTR/10 Retail

COMPLAINT:


Remove and Install Beater Drive Belt.

Loosen upper Feeder House Drive belt and remove from tensioner sheave
Loosen beater drive belt tensioner
Remove Beater drive belt as a pair.
Install in reverse order.

CORRECTION:

Remove and Install Beater Drive Belt.

Loosen upper Feeder House Drive belt and remove from tensioner sheave
Loosen beater drive belt tensioner
Remove Beater drive belt as a pair.
Install in reverse order.

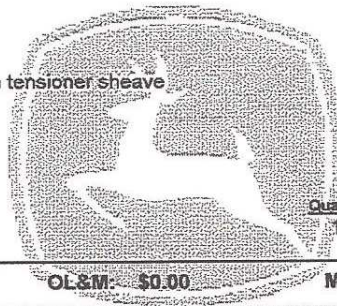

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH139436	BELT SET	1.00	73.81	73.81	\$73.81	N
Labor: \$132.15		Parts: \$73.81	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$205.96	

9550/3352/SA/10 Retail

COMPLAINT:

FRONT BEARING SHOE AUGER - REMOVE & INSTALL
REMOVE & INSTALL SHOE AUGER FRONT BEARING-ALL

Remove right hand wheel(s).
Loosen nuts to relieve belt tension and remove belt.
Remove nut, sheave and woodruff key.
Loosen set screw and remove locking collar.
Remove nuts and outside flangette and bearing.
Do the same for left side.
Install new bearing and put together in reverse

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:


JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384 Prv Phone: 712-621-6055	Bus Phone: 712-621-6055 Prv Phone: 712-621-6055	Page: 11 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9550/3352/SA/10 Retail

REMOVED & INSTALLED SHOE AUGER FRONT BEARING

Remove right hand wheel(s).
Loosen nuts to relieve belt tension and remove belt.
Remove nut, sheave and woodruff key.
Loosen set screw and remove locking collar.
Remove nuts and outside flange and bearing.
Do the same for left side.
Install new bearing and put together in reverse

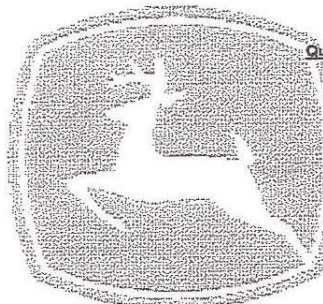

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
26M4226	SHAFT KEY	1.00	2.22	2.22	\$2.22	N
34H333	SPRING PIN	6.00	0.73	0.73	\$4.38	N
AH129451	BALL BEAR	1.00	59.00	59.00	\$59.00	N
AH129452	ECCENTRIC	1.00	8.30	8.30	\$8.30	N
AH214862	BALL BEAR	6.00	14.69	14.69	\$88.14	N
E10018	PRESSED FL	1.00	3.76	3.76	\$3.76	N
H102533	SHIM	1.00	5.43	5.43	\$5.43	N
H103264	PRESSED FL	14.00	1.64	1.64	\$22.96	N
H135422	DRIVE SHAF	1.00	300.00	300.00	\$300.00	N
H167587	KEY	6.00	1.97	1.97	\$11.82	N
H36155	SHIM	1.00	5.21	5.21	\$5.21	N
JD8551	ECCENTRIC	-1.00	7.99	7.99	(\$7.99)	N
JD8554	ECCENTRIC	6.00	2.12	2.12	\$12.72	N
JD8665	BALL BEAR	1.00	9.28	9.28	\$9.28	N

Labor: \$636.50 Parts: \$525.23 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,161.73

9550/3351/RSSA/A/10 Retail

COMPLAINT:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Page: 12 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9550/3351/RSSA/A/10 Retail

BEARING REAR SHOE SUPPLY AUGER ALL - REMOVE & INSTALL

REMOVE & INSTALL REAR SHOE SUPPLY AUGER BEARING ALL

???

CORRECTION:

REMOVED & INSTALLED REAR SHOE SUPPLY AUGER BEARING
INSTALLED NEW WOOD BLOCKS ON SHOE AUGER

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7267	BOLT	12.00	1.56	1.56	\$18.72	N
14M7298	FLANGE NUT	4.00	0.71	0.71	\$2.84	N
14M7396	LOCK NUT	12.00	0.86	0.86	\$10.32	N
19M7867	SCREW	4.00	0.68	0.68	\$2.72	N
H103264	PRESSED FL	3.00	1.64	1.64	\$4.92	N
H142188	BEARING	12.00	11.03	11.03	\$132.36	N
H142189	Stripper	6.00	6.51	6.51	\$39.06	N
JD8554	ECCENTRIC	1.00	2.12	2.12	\$2.12	N
Labor: \$279.54		Parts: \$213.06	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$492.60	

9550/6927/SSY/A/10 Retail

COMPLAINT:

AUGER SHOE SUPPLY ALL SIX - REMOVE & INSTALL

REMOVE & INSTALL SHOE SUPPLY AUGER ALL

???

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Page: 13 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9550/6927/SSY/A/10 Retail
REMOVED & INSTALLED SHOE SUPPLY AUGER
REPLACED ALL SIX AUGERS

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7184	BOLT	6.00	0.48	0.48	\$2.88	N
03M7185	BOLT	1.00	0.51	0.51	\$0.51	N
14M7298	FLANGE NUT	7.00	0.71	0.71	\$4.97	N
AH169020	AUGER	3.00	255.00	255.00	\$765.00	N
AH169021	AUGER	3.00	255.00	255.00	\$765.00	N
Labor: \$481.36		Parts: \$1,538.36	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$2,019.72	

9550/4483/LCV/10 Retail
COMPLAINT:
ASSEMBLY LOWER CYLINDER VARIABLE SPEED - REMOVE & INSTALL AND RECONDITION.

REMOVE & INSTALL LOWER CYLINDER VARIABLE SPEED ASSEMBLY

Note: Includes Adjustment
???

CORRECTION:
STARTED TO TAKE APART CHECKED CLOSER AFTER BELT WAS LOOSE FOUND TO BE OK. READJUSTED BELT TO PROPER TENSION.
THE CUSTOMER DECIDED NOT TO REPLACE LOWER BUSHINGS AT THIS TIME.
PUT BACK TOGETHER.

Labor: \$286.59	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$286.59
-----------------	---------------	--------------	--------------	---------------------

9550/6342/SSA/10 Retail
COMPLAINT:

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Invoice Date: 10/10/2012
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 244387
		Payment Type: Finance
		Page: 14 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9550/6342/SSA/10 Retail

PAN SHOE SUPPLY AUGER - REMOVE & INSTALL

REMOVE & INSTALL SHOE SUPPLY AUGER PAN

???

CORRECTION:

REMOVED & INSTALLED SHOE SUPPLY AUGER PAN

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M7866	SCREW	8.00	0.68	0.68	\$5.44	N
AH146655	TROUGH	1.00	617.60	617.60	\$617.60	N
Labor: \$1,082.98		Parts: \$623.04	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,706.02	

9550/9002/CMS/41 Retail

COMPLAINT:

COMBINE COMPLETE MACHINE SERVICE - PERFORM
CHECK ALL FLUID LEVELS AND TOP OFF.

CHANGE ENGINE OIL AND FILTER

CLEAN ENGINE AIR FILTERS

CHANGE ENGINE GEARCASE FILTER

CHANGE HYDRAULIC FILTER

CHANGE HYDRO FILTER

CLEAN CAB FILTERS

CHANGE REVERSER OIL

CHANGE DUAL RANGE GEARCASE OIL

CHANGE PRIMARY COUNTERSHAFT GEARCASE OIL

CHANGE TRANSMISSION OIL

CHANGE FINAL DRIVE OIL

CHANGE WATER SEPARATOR

CHANGE FUEL FILTER

CLEAN OUT RADIATOR AND COOLERS.

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:


SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Invoice Date: 10/10/2012
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 244387
		Payment Type: Finance
		Page: 15 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9550/9002/CMS/41 Retail

COMBINE COMPLETE MACHINE SERVICE -
CHECK ALL FLUID LEVELS AND TOP OFF.
CHANGE ENGINE OIL AND FILTER
CLEAN ENGINE AIR FILTERS
CHANGE ENGINE GEARCASE FILTER
CHANGE HYDRAULIC FILTER
CHANGE HYDRO FILTER
CLEAN CAB FILTERS
CHANGE REVERSER OIL
CHANGE DUAL RANGE GEARCASE OIL
CHANGE PRIMARY COUNTERSHAFT GEARCASE OIL
CHANGE TRANSMISSION OIL
CHANGE FINAL DRIVE OIL
CHANGE WATER SEPARATOR
CHANGE FUEL FILTER.
CLEAN OUT RADIATOR AND COOLERS.

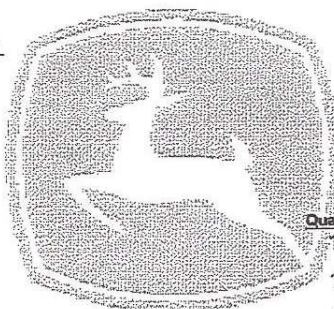

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7188	BOLT	1.00	0.76	0.76	\$0.76	N
14M7298	FLANGE NUT	1.00	0.71	0.71	\$0.71	N
AH115833	AIR FILTER	1.00	60.91	60.91	\$60.91	N
AH115836	AIR FILTER	1.00	67.05	67.05	\$67.05	N
AH128449	HYDRAULIC FILTER	3.00	54.96	54.96	\$164.88	N
AR86745	FILTER ELE	1.00	20.81	20.81	\$20.81	N
AR95758	FILTER ELE	1.00	79.27	79.27	\$79.27	N
AR95759	FILTER ELE	1.00	58.92	58.92	\$58.92	N
AT81478	FILTER ELE	1.00	27.04	27.04	\$27.04	N
RE57394	OIL FILTER	1.00	16.20	16.20	\$16.20	N
TY26372	SYNTHETIC	4.00	20.83	20.83	\$83.32	N
TY26408	GREASE	1.00	22.44	22.44	\$22.44	N
TY26673	PLUS-50 II OIL 15W40 CJ4/SN	7.00	18.81	18.81	\$131.67	N

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 58507

Deliver To:

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Invoice Date: 10/10/2012
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 244387
		Payment Type: Finance
		Page: 16 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9550/9002/CMS/41 Retail							
TY26815	GL-5 80/90 1 GAL	2.00	20.17	20.17	\$40.34	N	
TY26816	GL-5 80/90 5 GAL	1.00	98.38	98.38	\$98.38	N	
PN6X21/2	3/8X21/2	1.00	1.96	1.96	\$1.96	N	
Labor: \$609.90	Parts: \$874.66	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,484.56			

9550/1357/SCJD/10 Retail

COMPLAINT:


BELT STRAW CHOPPER JACKSHAFT FRONT DRIVE - REMOVE & INSTALL

REMOVE & INSTALL STRAW CHOPPER JACKSHAFT FRONT DRIVE BELT

???

CORRECTION:

REMOVED & INSTALLED STRAW CHOPPER JACKSHAFT
REPLACED FRONT DRIVE BELT
REPLACED REAR BELT

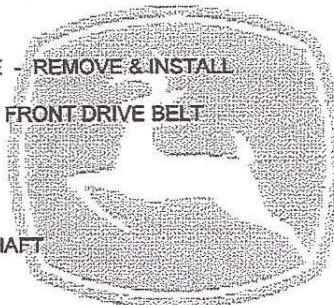

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H125380	V-BELT	1.00	71.75	71.75	\$71.75	N
H125381	V-BELT	1.00	69.70	69.70	\$69.70	N
Labor: \$110.84	Parts: \$141.45	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$252.29		

9500/6914/FR/10 Retail

COMPLAINT:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
		Invoice Date: 10/10/2012
		Location: 24
		Work Order Number: 244387
		Payment Type: Finance
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Page: 17 of 22
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9500/6914/FR/10 Retail

CONCAVE WITH FEEDER HOUSE REMOVED - REMOVE & INSTALL


REMOVE & INSTALL WITH FEEDER HOUSE REMOVED CONCAVE

REMOVE CONCAVE TM1401 120-05-20
REPLACE PARTS AS NEEDED
INSTALL CONCAVE

CORRECTION:

REMOVED & INSTALLED WITH FEEDER HOUSE REMOVED CONCAVE

REMOVE CONCAVE
REPLACE PARTS AS NEEDED
INSTALL CONCAVE
ADJUSTED CONCAVE

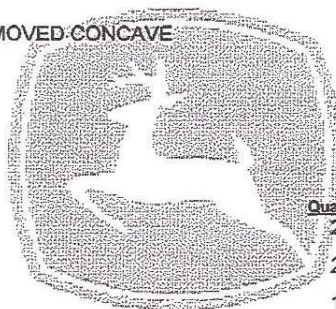

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7400	LOCK NUT	2.00	1.22	1.22	\$2.44	N
19M7597	CAP SCREW	2.00	2.84	2.84	\$5.68	N
AH150497	CONCAVE	1.00	1,153.60	1,153.60	\$1,153.60	N
B32630	SPRING LOC	2.00	0.90	0.90	\$1.80	N
H144742	EYEBOLT	2.00	5.79	5.79	\$11.58	N
Labor: \$1,829.70		Parts: \$1,175.10	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$3,004.80	

9500/6955/BTR/10 Retail

COMPLAINT:

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Invoice Date: 10/10/2012
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 244387
		Payment Type: Finance
		Page: 18 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9500/6955/BTR/10 Retail
GRATE BEATER - REMOVE & INSTALL

Remove and Install Upper Beater Grate

Remove rear shoe auger access door
Loosen eye bolts holding beater grate to concave
Enter straw walker access door
Remove beater curtain from beater grate
Remove bolts, bushings and nuts on LH and RH side of beater grate through side sheet.
lift and support beater grate away from concave
NOTE: This May REQUIRE TWO PEOPLE
Maneuver beater grate back and over straw walkers to rear access door.
Remove beater grate
Install in reverse order

CORRECTION:
REMOVED & INSTALLED BEATER GRATE

HAD TO PULL BEATER GRATE AND WELDED THEN REPLACED
HAD TO REPLACE THE ROD THAT HOOKS TO CONCAVE



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7028	COTTER PIN	4.00	0.33	0.33	\$1.32	N
14M7276	NUT	4.00	1.29	1.29	\$5.16	N
14M7400	LOCK NUT	2.00	1.22	1.22	\$2.44	N
19M7813	SCREW	2.00	1.79	1.79	\$3.58	N
H140803	PIN	1.00	85.44	85.44	\$85.44	N
H140804	BEAM	2.00	3.91	3.91	\$7.82	N
Labor: \$478.16		Parts: \$105.76	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$583.92	

9500/6056/BTR/10 Retail
CORRECTION:
DID NOT DO THIS SEG.

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Invoice Date: 10/10/2012
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 244387
		Payment Type: Finance
		Page: 19 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9500/6056/BTR/10 Retail

Labor: \$0.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$0.00
---------------	---------------	--------------	--------------	-------------------

ALL/9027/62 Retail

COMPLAINT:

WELD PATCH ON TOP OF CLEAN GRAIN ELEVATOR AND LOADING AUGER TUBE.

CORRECTION:

WELD A PATCH ON TOP OF THE CLEAN GRAIN ELEVATOR--ORDERED PATCH KIT
WELD A PATCH ON THE BOTTOM OF THE LOADING AUGER TUBE--THE MATERIAL WAS VERY THIN AND HARD TO WELD.
WELDED THE CRACKES ON THE FEEDER HOUSE FRONT PLATE HAD TO REMOVE PLATE ON THIS JOB.
REPLACED 2 STUDS ON LOADING AUGER HINGE.
PATCHED THE BACK SIDE OF THE CLEN GRAIN ELEVATOR.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H217963	SEALANT	2.00	7.91	7.91	\$15.82	N
Labor: \$1,109.95	Parts: \$15.82	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,125.77		

9500/1357/TLD/10 Retail

COMPLAINT:

BELT TAILING DRIVE - REMOVE & INSTALL

REMOVE & INSTALL TAILING DRIVE BELT

LOOSEN CLEAN GRAIN DRIVE BELT
REMOVE CLEAN GRAIN DRIVE BELT FROM LOWER END.
LOOSEN TAILINGS DRIVE BELT
REMOVE TAILINGS DRIVE BELT
REASSEMBLE IN REVERSE ORDER
ADJUST TAILINGS DRIVE BELT.

CORRECTION:

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Invoice Date: 10/10/2012
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 244387
		Payment Type: Finance
		Page: 20 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9500/1357/TLD/10 Retail
REMOVED & INSTALLED TAILING DRIVE BELT

LOOSEN CLEAN GRAIN DRIVE BELT
REMOVE CLEAN GRAIN DRIVE BELT FROM LOWER END.
LOOSEN TAILINGS DRIVE BELT
REMOVE TAILINGS DRIVE BELT
REASSEMBLE IN REVERSE ORDER
ADJUST TAILINGS DRIVE BELT.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
N110085	V-BELT	1.00	66.58	66.58	\$66.58	N
Labor: \$120.34		Parts: \$66.58	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$186.92	

9500/1357/LCF/10 Retail
COMPLAINT:
REPLACE CLEAN GRAIN ELEVATOR BELT

CORRECTION:
REPLACE CLEAN GRAIN ELEVATOR BELT.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
40M7231	Snap Ring	1.00	16.52	16.52	\$16.52	N
AT226281	PULLEY	1.00	40.76	40.76	\$40.76	N
H141167	V-BELT	1.00	143.49	143.49	\$143.49	N
Labor: \$117.16		Parts: \$200.77	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$317.93	

9500/1357/SDC/10 Retail
COMPLAINT:

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE


JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645	Invoice Number: 1667162
Bus Phone: 7126214384	Bus Phone: 712-621-6055	Invoice Date: 10/10/2012
Prv Phone: 712-621-6055	Prv Phone: 712-621-6055	Location: 24
		Work Order Number: 244387
		Payment Type: Finance
		Page: 21 of 22
		Work Performed By: GLEN SLOSS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

9500/1357/SDC/10 Retail
BELT SECONDARY COUNTERSHAFT - REMOVE & INSTALL

REMOVE & INSTALL SECONDARY COUNTERSHAFT BELT

START AND RUN SEPARATOR.
SLOW CYLINDER SPEED TO THE SLOWEST SPEED.
SHUT OFF MACHINE.
LOOSEN CYLINDER DRIVE BELT AND REMOVE FROM CYLINDER PULLEY.
PRY CYLINDER DRIVE LOWER VARIABLE SHEAVES APART AND WEDGE OPEN.
REMOVE SECONDARY COUNTESHAFT BELT SHIELD.
LOOSEN BELT ADJUSTER.
REMOVE BELT FROM LOWER PULLEY
REMOVE BELT FROM UPPER PULLEY
WEAVE BELT THROUGH PRIMARY COUNTER SHAFT SHEAVES AND VARIABLE SPEED BELT.
REASSEMBLE IN REVERSE ORDER.
ADJUST BELT.
ADJUST VARIABLE SHEAVE GAP

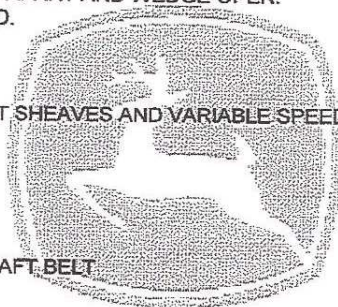

CORRECTION:
REMOVED & INSTALLED SECONDARY COUNTERSHAFT BELT

START AND RUN SEPARATOR.
SLOW CYLINDER SPEED TO THE SLOWEST SPEED.
SHUT OFF MACHINE.
LOOSEN CYLINDER DRIVE BELT AND REMOVE FROM CYLINDER PULLEY.
PRY CYLINDER DRIVE LOWER VARIABLE SHEAVES APART AND WEDGE OPEN.
REMOVE SECONDARY COUNTESHAFT BELT SHIELD.
LOOSEN BELT ADJUSTER.
REMOVE BELT FROM LOWER PULLEY
REMOVE BELT FROM UPPER PULLEY
WEAVE BELT THROUGH PRIMARY COUNTER SHAFT SHEAVES AND VARIABLE SPEED BELT.
REASSEMBLE IN REVERSE ORDER.
ADJUST BELT.
ADJUST VARIABLE SHEAVE GAP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H128010	V-BELT	1.00	71.75	71.75	\$71.75	N

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

40459 Pioneer Trail
Macedonia, IA 51549
Phone: (712) 486-2441
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE


Invoice To Account No: 58507

Deliver To:

SERVICE INVOICE

JDC CONSTRUCTION JEREMY CLARK 44848 HIGHWAY E HARRIS MO 64645 Bus Phone: 7126214384 Prv Phone: 712-621-6055	JDC CONSTRUCTION 44848 HIGHWAY E HARRIS MO 64645 Bus Phone: 712-621-6055 Prv Phone: 712-621-6055	Invoice Number: 1667162 Invoice Date: 10/10/2012 Location: 24 Work Order Number: 244387 Payment Type: Finance Page: 22 of 22 Work Performed By: GLEN SLOSS
--	--	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500SH 4WD COMBINE	5776	H09500S670625	HS670625M	

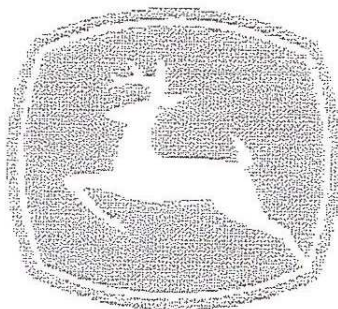

JOHN DEERE

AGRIVISION

EQUIPMENT GROUP

3106 274th Avenue
Hamburg, IA 51640
Phone: (712) 382-1862
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 48598

Deliver To:

SERVICE INVOICE

WARRANTY CUSTOMER	[REDACTED]	Invoice Number:	1532909
	FALLS CITY NE 68355	Invoice Date:	8/26/2008
		Location:	23
		Work Order Number:	179236
		Payment Type:	Account
Bus Phone:	Bus Phone: [REDACTED]	Page:	1 of 4
Prv Phone:	Prv Phone: [REDACTED]	Work Performed By:	STEVE LLOYD


Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	710	H09500S670625	HS670625M	

Gen-Engine Warranty

COMPLAINT:

Engine Repairs/REPLACE ENGINE THAT HAS A CRACKED BLOCK

CORRECTION:

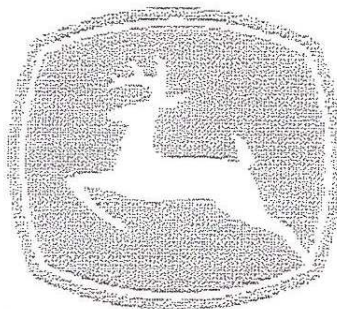

JOHN DEERE

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

3106 274th Avenue
Hamburg, IA 51640
Phone: (712) 382-1862
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 48598

Deliver To:

SERVICE INVOICE

WARRANTY CUSTOMER	[REDACTED]	Invoice Number:	1532909
	FALLS CITY NE 68355	Invoice Date:	8/26/2008
Bus Phone:	Bus Phone: [REDACTED]	Location:	23
Prv Phone:	Prv Phone: [REDACTED]	Work Order Number:	179236
		Payment Type:	Account
		Page:	2 of 4
		Work Performed By:	STEVE LLOYD

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	710	H09500S670625	HS670625M	

Gen-Engine Warranty

Engine Repairs/REPLACE ENGINE THAT HAS A CRACKED BLOCK Engine Repairs

ENGINE, R&R

Swing unloading auger out, then drain oil and coolant, and disconnect battery cables.

Remove:

Ladder, tube, brackets and channels.

Access door, channel and sheets.

Air intake parts, channels and upper door

Muffler and mounting panel.

Wiring harness from channel.

Disconnect:

Upper wiring harness.

Lower wiring harness.

Alternator belts, and tightener.

oil and vent lines.

Fuel lines.

Remove grain bin access door.

Disconnect L.H side hoses and electrical leads.

Install lifting device to engine and take up slack on chain.

Remove:

Fan

Motor mounts

Six bolts securing engine to gear case

Separate engine from gear case mesh.

Raise engine above gear case level and move to left rear side of combine

Lower engine to the ground.

Removed parts from the old engine and reinstalled back on the new engine.

One additional person required to move rise and lower engine, 0.1 hours.

Install engine and repair stand.

Install lifting device and rise engine into position in combine engine compartment.

One additional person required to install lifting device and raise engine into position, 0.1 hours.

Install flywheel turning tool and connect gear case shaft to coupling hub.

Secure with six bolts.

One additional person required to install flywheel turning tool, 0.1 hours.

Install engine to motor mounts and remove lifting device.


Connect L.H. side parts:

Cold start lines.

Starter leads.

Heater hose and lower radiator hose.

Turbocharger tube.

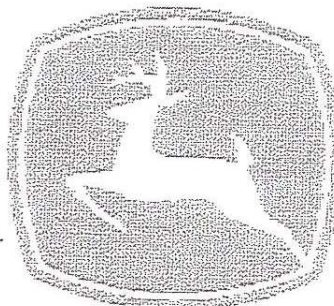

JOHN DEERE

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

3106 274th Avenue
Hamburg, IA 51640
Phone: (712) 382-1862
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 48598

Deliver To:

SERVICE INVOICE

WARRANTY CUSTOMER	[REDACTED] 1020 [REDACTED] FALLS CITY NE 68355	Invoice Number: 1532909
		Invoice Date: 8/26/2008
Bus Phone:	Bus Phone: [REDACTED]	Location: 23
Prv Phone:	Prv Phone: [REDACTED]	Work Order Number: 179236
		Payment Type: Account
		Page: 3 of 4
		Work Performed By: STEVE LLOYD

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	710	H09500S670625	HS670625M	

Block heater lead.
Install engine access cover in grain tank.
Install turbocharger, muffler and mounting panel.
Install:
Oil and breather lines
Fan
Alternator
Drive belt
Channels
Air tube
Connect:
Upper wiring harness
Lower wiring harness
Install:
Air cleaner and associated parts
Dust shields
Channels
Doors
Ladder
Adjust belts.
Fill:
Radiator (approx. 38 qts)
Engine oil (14-1/2 qt.)
Connect batteries.



JOHN DEERE

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7296	FLANGE NUT	1.00	0.70	0.49	\$0.49	N
14M7298	FLANGE NUT	6.00	0.46	0.34	\$2.04	N
19M7166	CAP SCREW	1.00	0.48	0.35	\$0.35	N
19M7866	SCREW	6.00	0.65	0.38	\$2.28	N
AT13740	DRAIN VALV	1.00	2.40	1.40	\$1.40	N
H101813	V-BELT	1.00	18.25	12.78	\$12.78	N
H134214	GUIDE	1.00	3.90	2.47	\$2.47	N
H80896	V-BELT	1.00	9.75	6.83	\$6.83	N

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

3106 274th Avenue
Hamburg, IA 51640
Phone: (712) 382-1862
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 48598

Deliver To:

SERVICE INVOICE

WARRANTY CUSTOMER	[REDACTED] FALLS CITY NE 68355	Invoice Number:	1532909
		Invoice Date:	8/26/2008
		Location:	23
		Work Order Number:	179236
Bus Phone:	Bus Phone: [REDACTED]	Payment Type:	Account
Prv Phone:	Prv Phone: [REDACTED]	Page:	4 of 4
		Work Performed By:	STEVE LLOYD

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	710	H09500S670625	HS670625M	

Gen-Engine Warranty						
SE500372	BASIC DIESEL ENGINE	1.00	11,060.00	9,299.00	\$9,299.00	N
SE500372-CR	CORE for:Basic Diesel Engine Reman	-1.00	2,750.00	2,750.00	(\$2,750.00)	N
TY16036	ANTIFREEZE/2 1/2	1.00	28.28	25.45	\$25.45	N
TY22041	OIL/BRK-IN/1	6.00	11.77	11.77	\$70.62	N
UT250	CLAMP	1.00	7.48	4.49	\$4.49	N

Labor: \$2,272.20 Parts: \$6,678.20 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$8,950.40

ATTENTION: Part(s) values for this invoice have changed. Original Invoice Parts Sale Value = \$6779.66
INVOICE CONTAINS \$1,780.32 DISCOUNT

Customer PO No:
Tax Exempt No: 1
Advisor: RUSTY RAYMOND

Labor: \$2,272.20
Parts: \$6,779.66
OL&M: \$0.00
Misc: \$0.00
Sales Tax: \$0.00
Grand Total: \$9,051.86

*** DOCUMENT COPY ***

Ask about our exclusive 1 year warranty on parts & service.

JOHN DEERE

Received by: Date:

AGRIVISION

EQUIPMENT GROUP

3106 274th Avenue
Hamburg, IA 51640
Phone: (712) 382-1862
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 54717

Deliver To:

SERVICE INVOICE

Invoice Number: 1529002 Invoice Date: 8/9/2008 Location: 23 Work Order Number: 178411 Payment Type: Finance Page: 1 of 6 Work Performed By: DENNIS DAVIS	Bus Phone: [REDACTED] Prv Phone: [REDACTED]	Bus Phone: [REDACTED] Prv Phone: [REDACTED]
---	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	4740	H09500S670625	HS670625M	

Gen-1 Retail
COMPLAINT:
General Repairs/INSPECTION

CORRECTION:
FREE COMBINE INSPECTION

Labor: \$274.40	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$274.40
-----------------	---------------	--------------	--------------	---------------------

Gen-2 Retail
COMPLAINT:
General Repairs/MISC REPAIR/SIDEHILL CYLINDERS SETTLE DOWN—CHECK ACCUMULATOR—ADJUST HYDROSTAT CABLE—FIX LEAKS ON HYDROSTAT LEAKS IN 4 PLACES—WELD UNLOADING AUGER ELBOW

CORRECTION:
General Repairs/INSPECTION General Repairs/MISC REPAIR General Repairs/General Repairs/MISC REPAIR/SIDEHILL CYLINDERS SETTLE DOWN—CHECK ACCUMULATOR—ADJUST HYDROSTAT CABLE—FIX LEAKS ON HYDROSTAT LEAKS IN 4 PLACES—WELD UNLOADING AUGER ELBOW

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH143729	AUGER	1.00	845.00	845.00	\$845.00	N
AH207779	KIT	1.00	54.00	54.00	\$54.00	N
JD8554	ECCENTRIC	1.00	1.65	1.65	\$1.65	N
JD8665	BALL BEAR	1.00	7.25	7.25	\$7.25	N
R26906	O-RING	1.00	1.10	1.10	\$1.10	N
T77932	O-RING	1.00	0.95	0.95	\$0.95	N
TY22067	10W 1 GAL	3.00	13.64	11.66	\$34.98	Y

Labor: \$787.50	Parts: \$944.93	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,732.43
-----------------	-----------------	--------------	--------------	-----------------------

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

3106 274th Avenue

Hamburg, IA 51640

Phone: (712) 382-1862

WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 54717

Deliver To:

SERVICE INVOICE

[REDACTED] [REDACTED]		[REDACTED] [REDACTED]		Invoice Number: 1529002
Bus Phone: [REDACTED] Prv Phone: [REDACTED]		Bus Phone: [REDACTED] Prv Phone: [REDACTED]		Invoice Date: 8/9/2008 Location: 23 Work Order Number: 178411 Payment Type: Finance
				Page: 2 of 6 Work Performed By: DENNIS DAVIS

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9500 SH

4740

H09500S670625

HS670625M

Gen-3 Retail

COMPLAINT:

SEG-3-General Repairs/REPLACE STRAW CHOPPER BLADES

CORRECTION:

SEG-3-General Repairs/REPLACE STRAW CHOPPER BLADES General Repairs

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH124635	BLADE	5.00	24.99	24.99	\$124.95	N
H150269	SHAFT KEY	2.00	0.60	0.60	\$1.20	N
Labor: \$109.90		Parts: \$126.15	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$236.05	

/CLENAUGER-F-0000405 Retail

COMPLAINT:

SEG-4-REPLACE LOWER CLEAN GRAING AUGER

CORRECTION:

REMOVE MASTER LINK FROM CLEAN GRAIN ELEVATOR CHAIN
 REMOVE BEARINGS FROM BOTH SIDES OF AUGER
 SCREW AUGER OUT LEFT SIDE OF COMBINE
 INSTALLE NEW AUGER WITH BEARINGS
 INSTALL SPEED SENSOR BACK ONTO AUGER
 RECONNECT CONVEYOR CHAIN AND ADJUST

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH141577	AUGER	1.00	465.00	465.00	\$465.00	N
AZ10044	ECCENTRIC	1.00	5.25	5.25	\$5.25	N
AZ10045	ECCENTRIC	1.00	6.25	6.25	\$6.25	N
JD39102	BALL BEARI	1.00	15.99	15.99	\$15.99	N

CONTINUED ON NEXT PAGE->

AGRIVISION

EQUIPMENT GROUP

3106 274th Avenue
Hamburg, IA 51640
Phone: (712) 382-1862
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 54717

Deliver To:

SERVICE INVOICE

Invoice Number: 1529002 Invoice Date: 8/9/2008 Location: 23 Work Order Number: 178411 Payment Type: Finance Page: 3 of 6 Work Performed By: DENNIS DAVIS	Bus Phone: [REDACTED] Prv Phone: [REDACTED]	Bus Phone: [REDACTED] Prv Phone: [REDACTED]
---	--	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	4740	H09500S670625	HS670625M	

/CLENAUGER-F-0000405 Retail					
JD39103	BALL BEAR	1.00	12.50	12.50	\$12.50 N
Labor: \$200.90		Parts: \$504.99	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$705.89

Gen-5 Retail

COMPLAINT:

SEG-5-General Repairs/CLEAN GRAIN TROUGH UNDER COMBINE LEAKS WELD PATCH ON RIGHTHAND SIDE

CORRECTION:

SEG-5-General Repairs/CLEAN GRAIN TROUGH UNDER COMBINE LEAKS WELD PATCH ON RIGHTHAND SIDE General Repairs

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7396	LOCK NUT	5.00	0.33	0.33	\$1.65	N
19M7799	SCREW	5.00	1.00	1.00	\$5.00	N
H88769	ISOLATOR	78.00	0.15	0.15	\$11.70	N
R26375	O-RING	2.00	1.00	1.00	\$2.00	N
R29936	O-RING	1.00	1.55	1.55	\$1.55	N
T77857	O-RING	1.00	0.85	0.85	\$0.85	N
T77858	O-RING	1.00	1.00	1.00	\$1.00	N
T77932	O-RING	1.00	0.95	0.95	\$0.95	N
Labor: \$113.40		Parts: \$24.70	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$138.10	

Gen-6 Retail

COMPLAINT:

SEG-6-General Repairs/CHECK AND REPAIR UNLOADING AUGER COUNTER SHAFT

CORRECTION:

SEG-6-General Repairs/CHECK AND REPAIR UNLOADING AUGER COUNTER SHAFT General Repairs

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

3106 274th Avenue
Hamburg, IA 51640
Phone: (712) 382-1862
WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 54717

Deliver To:

SERVICE INVOICE

Invoice Number: 1529002
Invoice Date: 8/9/2008
Location: 23
Work Order Number: 178411
Payment Type: Finance
Page: 4 of 6
Work Performed By: DENNIS DAVIS

Bus Phone: [REDACTED]	Bus Phone: [REDACTED]
Prv Phone: [REDACTED]	Prv Phone: [REDACTED]

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	4740	H09500S670625	HS670625M	

Gen-6 Retail

Labor: \$0.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$0.00
---------------	---------------	--------------	--------------	-------------------

Gen-7 Retail

COMPLAINT:

SEG-7-General Repairs/CHECK WARNING SYSTEM OUT CUSTOMER RAN OUT OF HYDRAULIC OIL BUT NO ALARM WENT OFF TO TELL HIM

CORRECTION:

SEG-7-General Repairs/CHECK WARNING SYSTEM OUT CUSTOMER RAN OUT OF HYDRAULIC OIL BUT NO ALARM WENT OFF TO TELL HIM General Repairs

Labor: \$78.40	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$78.40
----------------	---------------	--------------	--------------	--------------------

Gen-8 Retail

COMPLAINT:

SEG-8-General Repairs/CHECK HYDRO PRESSURES

CORRECTION:

SEG-8-General Repairs/CHECK HYDRO PRESSURES General Repairs
Service Accessories

Labor: \$98.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$98.00
----------------	---------------	--------------	--------------	--------------------


9500F871997 Retail

COMPLAINT:

WATER PUMP, RECONDITION

CORRECTION:

CONTINUED ON NEXT PAGE->

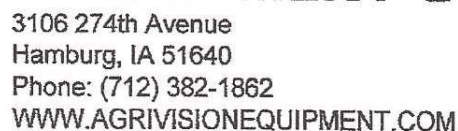

Invoice To Account No: 54717

Deliver To:

SERVICE INVOICE

Invoice Number: 1529002

Invoice Date: 8/9/2008

Location: 23

Work Order Number: 178411

Payment Type:	Finance
---------------	---------

Page: 5 of 6

Work Performed By: DENNIS DAVIS

Bus Phone: 402-245-5487

Bus Phone: 402-245-5487

Prv Phone: 402-245-5487

Prv Phone: 402-245-5487

Make/Model:

Meter:

Serial Number:

Eg ID:

Fleet No:

JOHN DEERE 9500 SH

4740

H09500S670625

HS670625M

9500F871997 Retail

DRAIN THE COOLANT, AND REMOVED THE OLD WATER PUMP. CLEANED THE GASKET SURFACES AND FOUND THAT THE BLOCK IS CRACKED WHERE THE WATER PUMP MOUNTS TO THE ENGINE.

Remove and install dust shield, upper hose, access door.

heater hose, elbow, lower hose, water manifold and tube.

Disassemble and inspect water pump.

Replace parts as needed.

Assemble pump and install replacement gasket.

Install in reverse order.

Run engine and check for leaks.



Part Number
R96616

Description:
GASKET

Quantity	List Price
1.00	1.50

Net Price
1.50

Extended Price
\$1.50

Taxed Ind
N

CONTINUED ON NEXT PAGE->

AGRIVISION EQUIPMENT GROUP

3106 274th Avenue

Hamburg, IA 51640

Phone: (712) 382-1862

WWW.AGRIVISIONEQUIPMENT.COM



JOHN DEERE

Invoice To Account No: 54717

Deliver To:

SERVICE INVOICE

1523 EARP AVE HILLS CITY NE 68901	1523 EARP AVE HILLS CITY NE 68901	Invoice Number: 1529002
		Invoice Date: 8/9/2008
		Location: 23
		Work Order Number: 178411
		Payment Type: Finance
Bus Phone: [REDACTED]	Bus Phone: [REDACTED]	Page: 6 of 6
Prv Phone: [REDACTED]	Prv Phone: [REDACTED]	Work Performed By: DENNIS DAVIS

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9500 SH	4740	H09500S670625	HS670625M	

9500F871997 Retail							
RE68230	WATER PUMP	1.00	340.00	340.00	\$340.00	N	

Labor: \$179.90	Parts: \$341.50	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$521.40
-----------------	-----------------	--------------	--------------	---------------------

INVOICE CONTAINS \$5.94 DISCOUNT

Miscellaneous Charges:
Service Accessories

\$50.00

Finance Information

Customer PO No:	Type: Multi-use Acct US	Auth. No: 107904	Labor: \$1,842.40
Tax Exempt No: 1	Merchant No: 36000321		Parts: \$1,942.27
Advisor: RUSTY RAYMOND	Card No: xxxxxxxxxxxx7588		OL&M: \$0.00
	Bill Code: 705 - JD COMBINE PARTS/SERVICE		Misc: \$50.00
	Credit Plan: 249 - PURCHASE		Sales Tax: \$131.42
			Grand Total: \$3,966.09

*** DOCUMENT COPY ***

Ask about our exclusive 1 year warranty on parts & service.

JOHN DEERE

TERMS AND CONDITIONS

Repayment Terms:

This purchase is subject to the terms of the issuer's credit agreement. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date: