

Invoice To Account No: 109535

Deliver To:

SERVICE INVOICE

TERRY GROEN 3709 FRISCHE LN DALHART TX 79022	TERRY GROEN 3709 FRISCHE LN DALHART TX 79022	Invoice Number: 474419
		Invoice Date: 2/23/2017
		Location: 1
		Work Order Number: 77389
		Payment Type: Account
Bus Phone: 806-249-4645	Bus Phone: 806-249-4645	Page: 4 of 4
Prv Phone:	Prv Phone:	

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530	6423	RW9530P002230	13793W	

9530F937451 Retail								
S5341	WINTER SPECIAL-DISC	1.00	0.00	-2,160.32	(\$2,160.32)	N		

OL&M Charges:


Description	Value
SENT AIR TO AIR OFF FOR REPAIR	\$442.42
VAT AND CLEAN HEAD AND VALVE JOB	\$397.50

Labor: \$8,835.00	Parts: \$11,593.85	OL&M: \$839.92	Misc: (\$1,825.86)	Sub-Total: \$19,342.91
-------------------	--------------------	----------------	--------------------	------------------------

Miscellaneous Charges:

Service Accessories	\$100.00
---------------------	----------

	Labor: \$8,835.00
	Parts: \$11,593.85
	OL&M: \$839.92
	Misc: (\$1,825.86)
	Sales Tax: \$0.00
	Grand Total: \$19,442.91

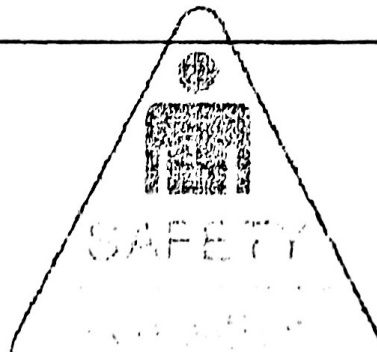

*** DOCUMENT COPY ***

Received by: _____ Date: _____

Invoice To Account No: 109535

Deliver To:

SERVICE INVOICETERRY GROEN
3709 FRISCHE LN
DALHART TX 79022TERRY GROEN
3709 FRISCHE LN
DALHART TX 79022Bus Phone: 806-249-4645
Prv Phone:Bus Phone: 806-249-4645
Prv Phone:

Invoice Number:	474418
Invoice Date:	2/23/2017
Location:	1
Work Order Number:	77389
Payment Type:	Account
Page:	2 of 4

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9530


6423

RW9530P002230

13793W

9530F937451 Retail

DZ103630	Hose	2.00	8.49	8.49	\$16.98	N
R114083	SCREW	6.00	12.21	12.21	\$73.26	N
R117080	RADIATOR HOS	1.00	18.25	18.25	\$18.25	N
R136507	SCREW	19.00	3.59	3.59	\$68.21	N
R217801	HOSE	2.00	30.16	30.16	\$60.32	N
R246193	WEAR RING	1.00	12.30	12.30	\$12.30	N
R246194	WEAR RING	1.00	10.37	10.37	\$10.37	N
R517011	SLEEVE	24.00	17.12	17.12	\$410.88	N
R518327	Valve Seat Insert	24.00	21.54	21.54	\$516.96	N
R518328	Valve	24.00	42.13	42.13	\$1,011.12	N
R522023	Gasket	2.00	3.13	3.13	\$6.26	N
R523533	RING	1.00	3.63	3.63	\$3.63	N
R524618	GASKET	1.00	10.07	10.07	\$10.07	N
R526284	SCREW	6.00	2.08	2.08	\$12.48	N
R532008	BUSHING	4.00	27.34	27.34	\$109.36	N
R535377	SCREW	3.00	2.14	2.14	\$6.42	N
R63185	O-RING	2.00	1.82	1.82	\$3.64	N
R72328	O-RING	1.00	1.10	1.10	\$1.10	N
RE174130	OIL FILTER	1.00	83.73	83.73	\$83.73	N
RE230985	AIR FILTER	1.00	81.87	81.87	\$81.87	N
RE232483	PULLEY	1.00	28.44	28.44	\$28.44	N
RE243154	Belt Tensioner	1.00	156.53	156.53	\$156.53	N
RE243155	Idler	1.00	101.62	101.62	\$101.62	N
RE261960	AIR FILTER	1.00	198.87	198.87	\$198.87	N
RE264238	SEAL	1.00	20.34	20.34	\$20.34	N
RE264239	SEAL	1.00	13.37	13.37	\$13.37	N

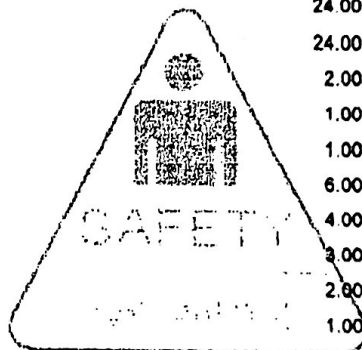

CONTINUED ON NEXT PAGE->

Invoice To Account No: 109535

Deliver To:

SERVICE INVOICE

TERRY GROEN 3709 FRISCHE LN DALHART TX 79022 Bus Phone: 806-249-4645 Prv Phone:		TERRY GROEN 3709 FRISCHE LN DALHART TX 79022 Bus Phone: 806-249-4645 Prv Phone:		Invoice Number: 474419 Invoice Date: 2/23/2017 Location: 1 Work Order Number: 77389 Payment Type: Account Page: 1 of 4	
Make/Model:		Meter:		Serial Number:	
JOHN DEERE 9530		6423		RW9530P002230	
		Eq ID:		Fleet No:	
		13793W			

9530F937451 Retail
 COMPLAINT:
 ENGINE OVERHAUL

CAUSE:
 dusted engine
 fan drive leaking
 recommend water pump and customer approved
 after cooler was very dirty inside - sent off to have cleaned and checked

CORRECTION:
 Disconnect battery ground cable.
 Drain coolant.
 Remove hood and side shields.
 Disconnect or remove air intake pipe, wiring harness connections, lines, hoses, drive shaft, fan, radiator, and mounting cap screws
 Attach appropriate lifting device.
 Lift and remove engine (except for in frame).
 Recondition engine.
 Reassemble in reverse order.
 removed after cooler and sent to be clean
 removed and replaced water pump
 drilled and taped bolts holes for rocker arm clamps
 replaced engine mounts
 reconditioned fan drive
 replaced worn drive belt tensioner and idler pulleys
 cleaned air system
 replaced filter: air, engine oil, hydraulic, fuel
 replaced coolant reservoir
 drained and refilled coolant after repairing leak
 ran an injector test to verify they are working good
 ran egr system test to verify it is working good
 washed and cleaned
 test ran and checked over



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Tax and Inl
12M1646	WASHER	2.00	1.40	1.40	\$2.80	N
A4730R	O-RING	6.00	1.70	1.70	\$10.20	N
AR69444	HY-GARD TM	1.00	79.88	79.88	\$79.88	N
AT326151	TANK	1.00	233.60	233.60	\$233.60	N

CONTINUED ON NEXT PAGE->

Invoice To Account No: 109535

Deliver To:

SERVICE INVOICETERRY GROEN
3709 FRISCHE LN
DALHART TX 79022TERRY GROEN
3709 FRISCHE LN
DALHART TX 79022

Invoice Number: 474419

Invoice Date: 2/23/2017

Location: 1

Work Order Number: 77389

Payment Type: Account

Page: 3 of 4

Bus Phone: 806-249-4645

Prv Phone:

Bus Phone: 806-249-4645

Prv Phone:

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9530

6423

RW9530P002230

13793W

9530F937451 Retail

RE313900	SEAL	1.00	17.75	17.75	\$17.75	N
RE313901	SEAL	1.00	12.40	12.40	\$12.40	N
RE523985	SEAL	24.00	15.13	15.13	\$363.12	N
RE529871	ELBOW FITTING	1.00	5.18	5.18	\$5.18	N
RE530493	KIT	1.00	24.91	24.91	\$24.91	N
RE530813	Engine Overhaul Kit	1.00	5,984.06	5,984.06	\$5,984.06	N
RE533910	FUEL FILTER	1.00	113.48	113.48	\$113.48	N
RE549117	WATER PUMP	1.00	730.82	730.82	\$730.82	N
RE572785	Oil Filter	1.00	52.49	52.49	\$52.49	N
RE66534	CLAMP	1.00	14.08	14.08	\$14.08	N
RE71285	ISOLATOR	3.00	49.81	49.81	\$149.43	N
T129538	ISOLATOR	4.00	87.70	87.70	\$350.80	N
TY22467	CLAMP	2.00	0.96	0.96	\$1.92	N
TY26101	BRAKE/CLUTCH	12.00	4.92	4.92	\$59.04	N
TY26576	COOL-GARD TM	2.00	32.53	32.53	\$65.06	N
TY26661	ENGINE BREAK-IN OIL	14.00	19.90	19.90	\$278.60	N
105	LUBRIPLATE	1.00	7.85	7.85	\$7.85	N

Miscellaneous
P3750Description
SHIPPING CHARGESQuantity
1.00List Price
234.46Net Price
234.46Extended Price
\$234.46Taxes
N

CONTINUED ON NEXT PAGE->