

Engine Serial Number :35120336
 Customer Unit Number :
 Work Order Name

Trip Information

INSITE - Datapack 8.4.10128

ECM Image Name :
 Customer Name :

Trip Information

Name	ECM Value	Units
ISM - CM875		
CM875		
All Trips (Cumulative)		
Distance		
Total ECM Distance	515591.0	mi
Total Engine Distance	515499.0	mi
Total Service Brake Distance	19547.0	mi
Fuel Used		
Total Cruise Control Fuel Used	10131.8	gal
Total Fuel Used	90522.5	gal
Total Gear Down Fuel Used	12086.8	gal
Total Idle Fuel Used	3119.9	gal
Total Loaded PTO Drive Fuel Used	0.0	gal
Total Maximum Accelerator Vehicle Speed Fuel Used	5946.5	gal
Total PTO Drive Fuel Used	0.0	gal
Total PTO Fuel Used	313.4	gal
Total Top Gear Fuel Used	62963.8	gal
Multiple PTO		
PTO Device 1	SPEED 1	
PTO Device 2	SPEED 2	
PTO Device 3	SPEED 3	
PTO Device 4	SPEED 4	
PTO Device 5	SPEED 5	
PTO Device 6	SPEED 6	
PTO Device 7	SPEED 7	
PTO Device 8	SPEED 8	

INVOICE NO

BILL TO

OWNER

DATE	CUSTOMER ORDER NO.	DATE IN SERVICE	ENGINE MODEL	PUMP NO.	EQUIPMENT MAKE
13-SEP-2017		08-SEP-2017	ISM CM875		INTERNATIONAL
CUSTOMER NO.	SHIP VIA	FAIL DATE	ENGINE SERIAL NO.	CPL NO.	EQUIPMENT MODEL
		08-SEP-2017	35120336		8600
REF. NO.	SALESPERSON	PARTS DISP.	MILEAGE/HOURS	PUMP CODE	UNIT NO.
			480708		0659

QUANTITY ORDERED	BACK ORDERED	QUANTITY SHIPPED	PART NUMBER	DESCRIPTION	PRODUCT CODE	UNIT PRICE	AMOUNT
------------------	--------------	------------------	-------------	-------------	--------------	------------	--------

OSN/MSN/VIN 1HSHXAHR35J200659

COMPLAINT CUSTOMER STATES ENGINE HAS A MISS AND USING COOLANT.
CHECK AND ADVISE.
UNIT# 0659

CAUSE CSS-00099935
#5 INJECTOR FAILED
#3 AND #4 INJECTOR SLEEVES LEAKING COOLANT.
#4 AND #5 INJECTOR LOBES AND ROLLERS BREAKING DOWN.

CORRECTION HOOKED UP INSITE AND GOT PRINTOUT OF ENGINE INFORMATION. ENGINE
HAS MISS ON #5 CYLINDER, INJECTOR FAILED.
TROUBLESHOOT FOR COOLANT LOSS. CHECKED EGR COOLER, NO SIGNS OF
COOLANT, HOLDS PRESSURE. REMOVED INJECTORS, FOUND #3 AND #4
INJECTOR SLEEVES LEAKING COOLANT. REMOVED CYLINDER HEAD, CLEANED
AND CHECKED PARTS FOR REUSE. FOUND OEM EXHAUST PIPE CRACKED AT
FLANGE. #4 AND #5 INJECTOR LOBES STARTING TO BREAK DOWN.
ADVISED CUSTOMER OF FINDINGS.
INSTALLED RX CYLINDER AND PX INJECTOR IN #5 POSITION AND ASSEMBLED
ENGINE USING NECESSARY GASKETS AND SEALS. INSTALLED CUSTOMER
SUPPLIED EXHAUST PIPE.
STEAMED, RAN AND CHECKED.

COVERAGE
REMARK BILLABLE

1. 1 2864028RX HEAD,CYLINDER DRC
1 1 3084650D HEAD,CYL 94M11 CLEAN

INVOICE NO

BILL TOOWNER

DATE	CUSTOMER ORDER NO.	DATE IN SERVICE	ENGINE MODEL	PUMP NO.	EQUIPMENT MAKE
13-SEP-2017		08-SEP-2017	ISM CM875		INTERNATIONAL
CUSTOMER NO.	SHIP VIA	FAIL DATE	ENGINE SERIAL NO.	CPL NO.	EQUIPMENT MODEL
		08-SEP-2017	35120336		8600
REF. NO.	SALESPERSON	PARTS DISP.	MILEAGE/HOURS	PUMP CODE	UNIT NO.
			480708		0659

QUANTITY ORDERED	BACK ORDERED	QUANTITY SHIPPED	PART NUMBER	DESCRIPTION	PRODUCT CODE	UNIT PRICE	AMOUNT
OSN/MSN/VIN		1HSHXAHR35J200659					
-1		-1	3084650D	HEAD,CYL 94M11	DIRTY		
1		1	4902921PX	INJ, CELECT ISM02	DRC		
1		1	3084589D	INJ, 94M11 CELECT	CLEAN		
-1		-1	3084589D	INJ, 94M11 CELECT	DIRTY		
1		1	4089478	SET,UPPER ENGINE GASKET	CECO		
1		1	4089666	SET,GASKET	CECO		
40		40	VV705290-Q	PREMIUM BLUE OIL (BLK QT)	VALVOLINE		
1		1	LF14000-NN	PAC,LF	FLG		
1		1	3103593	SHIELD,HEAT	CECO		
1		1	3103099	SCREW,CAPTIVE WASHER CAP	CECO		
1		1	PFC500	5" TORCTITE EXH CLP,304SS	OTHER		

PARTS:

PARTS COVERAGE CREDIT:

TOTAL PARTS:

SURCHARGE TOTAL:

LABOR:

LABOR COVERAGE CREDIT:

TOTAL LABOR:

MISC.:

MISC. COVERAGE CREDIT:

TOTAL MISC.:

SHOP SUPPLIES

HAZ WASTE DISPOSAL

THERE ARE ADDITIONAL CONTRACT TERMS ON THE REVERSE SIDE OF THIS DOCUMENT, INCLUDING LIMITATION ON WARRANTIES AND REMEDIES, WHICH ARE EXPRESSLY INCORPORATED HEREIN AND WHICH PURCHASER ACKNOWLEDGES HAVE BEEN READ AND FULLY UNDERSTOOD.

AUTHORIZED BY (print name) _____ SIGNATURE _____ DATE _____

INVOICE NO

BILL TO**OWNER**

DATE	CUSTOMER ORDER NO.	DATE IN SERVICE	ENGINE MODEL	PUMP NO.	EQUIPMENT MAKE
13-SEP-2017		08-SEP-2017	ISM CM875		INTERNATIONAL
CUSTOMER NO.	SHIP VIA	FAIL DATE	ENGINE SERIAL NO.	CPL NO.	EQUIPMENT MODEL
		08-SEP-2017	35120336		8600
REF. NO.	SALESPERSON	PARTS DISP.	MILEAGE/HOURS	PUMP CODE	UNIT NO.
109980			480708		0659

QUANTITY ORDERED	BACK ORDERED	QUANTITY SHIPPED	PART NUMBER	DESCRIPTION	PRODUCT CODE	UNIT PRICE	AMOUNT
------------------	--------------	------------------	-------------	-------------	--------------	------------	--------

OSN/MSN/VIN 1HSHXAHR35J200659

ELECTRONIC TOOLING FEE
FREE CUST SERV PARTS RTL

TAX EXEMPT NUMBERS:

LOCAL

THERE ARE ADDITIONAL CONTRACT TERMS ON THE REVERSE SIDE OF THIS DOCUMENT, INCLUDING LIMITATION ON WARRANTIES AND REMEDIES, WHICH ARE EXPRESSLY INCORPORATED HEREIN AND WHICH PURCHASER ACKNOWLEDGES HAVE BEEN READ AND FULLY UNDERSTOOD.

SUB TOTAL:

TOTAL TAX:

TOTAL AMOUNT: US \$

7,901.67

AUTHORIZED BY (print name) _____

SIGNATURE _____

DATE _____

PLEASE REMIT PAYMENT TO:

Page 1 of 3

SERVICE ADVIS

UNIT NO.	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
5J200659	05	INTERNATIONAL 8600	1HSHXAHR35J200659		505732 / 505732	T7792
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT
08DEC15			23:54 25MAY18	0659	0.00	CHG
R.O. OPENED	READY	OPTIONS: SOLD-STK:5J200659 ENG:CUMMINS TRN:FULLER 1)5J200659				
17:28 09MAY18	11:55 14MAY18					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A	ISM	385HP	EPA04	ESN 35120336	EH 17105		
CAUSE: ENGINE MODEL _____ OLD _____ ENGINE _____							
G/N _____ NEW _____ ENGINE _____							
HOURS _____ OLD _____ CASE FILE _____							
NEW _____ CONTROL# _____							

INFO GENERAL INFORMATION

999999 ISP

B C/S A/C IS INOP, BLOWER MOTOR WORKS. C&A

Q19-2905A-20 A/C PRELIMINARY DIAG/LEAK TESTING

110122 C

110137 C

110113 C

1105024 C

1105040 C

A19-7005A-22 AIR CONDITIONING SYSTEM RECOVER,
EVACUATION AND RECHARGE

1105040 C

1105024 C

AC A/C MACHINE USE CHARGE

A99-T1 RESEAL CONDENSER

1105024 C

Q19-1029U-20 REPLACE A/C COMPRESSOR

1105024 C

Customer Information	Service Department Hours	DESCRIPTION	TOTALS
	Monday to Friday 7:00am - 12:00 MID Saturday - Sunday 7:00am - 7:00pm	LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
		LESS INSURANCE	
		SALES TAX	
		PLEASE PAY THIS AMOUNT	

Signature

Date

Customer Copy

X

INVOICE
DUPLICATE 1

UNIT NO.	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN / OUT		TAG
5J200659	05	INTERNATIONAL 8600		1HSHXAHR35J200659		505732 / 505732		T7792
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
08DEC15			23:54 25MAY18	0659	0.00	CHG	14MAY18	
R.O. OPENED		READY		O				
17:28 09MAY18		11:55 14MAY18						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
	Q19-6149A-21		FILTER-DRIER ,	REPLACE			
	1105040		C				
	A99-T1		REPLACE SCHRADER VALVE				
	1105040		C				
	2	3543881C1	SEAL C-PLATE 1/2 IN				
	2	3543727C1	RING O SEAL 10.78 X 2.62 (TAN)				
	2	3543881C1	SEAL C-PLATE 1/2 IN				
	2	3543727C1	RING O SEAL 10.78 X 2.62 (TAN)				
	1	3628699C4	COMPRESR,COMPRESSOR,AIR CONDIT				
	1	FLTPAG100LUB8OZ OIL,FLEETRITE PAG 100					
		LUBRICAN					
	2	3543882C1	SEAL C-PLATE 3/4"				
	2	3543728C1	RING				
	2	3543881C1	SEAL C-PLATE 1/2 IN				
	2	3543727C1	RING O SEAL 10.78 X 2.62 (TAN)				
	1	RDT70R5020	SERVICE O'RINGS				
	1	3542577C2	FILTER DRIER AIR COND				
	1	MT1319	ORING/SEAL KIT				
	1	2507537C1	CORE ASSY VLV A/C CHRNG M8				

PARTS: 605.73 LABOR: 882.00 OTHER: 75.94 TOTAL LINE B:

CHECK A/C FOR BEING INOP, MONITOR THERMISTORS BOTH READING OK,
SYSTEM HAS LOW CHARGE,
INSPECT FOR REFRIGERANT LEAK, FOUND AT HOSES CONNECTED TO THE
CONDENSER RECOVERED 1.3 LB OF FREON. REMOVED CONDENSER LINE. INSTALLED
NEW O-RING AND SEAL AND RECONNECTED LINES. PULLED VACUUM FOR 20 MIN IT
GOT DOWN TO 28.8 INHG. CHARGED A/C SYSTEM WITH 2.2 LB OF FREON. STARTED
TRUCK TO CHECK TEMP FROM VENT BUT A/C CLUTCH WOULD NOT ENGAGE. LOG INTO

Service Department Hours		DESCRIPTION	TOTALS
Monday to Friday 7:00am - 12:00 MID Saturday - Sunday 7:00am - 7:00pm		LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
		LESS INSURANCE	
		SALES TAX	
		PLEASE PAY THIS AMOUNT	

Signature

Date

Customer Copy

INVOICE
DUPLICATE 1

UNIT NO.	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN / OUT		TAG
5J200659	05	INTERNATIONAL 8600		1HSHXAGR35J200659		505732 / 505732		T7792
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
08DEC15			23:54 25MAY18	0659	0.00	CHG	14MAY18	
R.O. OPENED		READY						
17:28 09MAY18		11:55 14MAY18						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
DLB UNIT HAD ACTIVE CODE 613-14 A/C CONTROL HEAD AIR INLET FAULT AND 611-14 A/C CLUTCH (FET 9) OVER CURRENT. CHECKED AND FOUND HAD DATA VER. 42 IN ESC. UPDATED ESC TO VER. 286. CHECKED OPER. A/C INOP, CHECKED FREON LEVEL, OK. CHECKED THERMISTORS BOTH READING WITHIN SPEC. CHECKED OPER. THRU ESC OF A/C CLUTCH WOULD NOT COME ON WHEN COMMANDED ON. CHECKED POWER AND GROUND AT A/C CLUTCH WAS OK WITHIN SPEC. WILL NEED A/C COMP. AND RECEIVER DRYER. REPLACE A/C COMP. REPLACED ACCUMULATOR, VACUUM AND CHARGED SYSTEM WITH 1.9 LBS OF REFRIGERANT, FOUND LOW SIDE SCHRADER LEAKING, RECOVERED SYSTEM, REPLACED SHRADER, VAC AND CHARGE TO 1.9, TEST OK.							

C No charge inspection						
NCI No charge inspection						
110122	C				0.00	0.00


PERFORM INSPECTION, NO DOI STICKER.

Customer Information	Service Department Hours	DESCRIPTION	TOTALS
	Monday to Friday 7:00am - 12:00 MID Saturday - Sunday 7:00am - 7:00pm	LABOR AMOUNT	\$
		PARTS AMOUNT	\$
		GAS, OIL, LUBE	\$
		SUBLET AMOUNT	\$
		MISC. CHARGES	\$
		TOTAL CHARGES	\$
		LESS INSURANCE	\$
		SALES TAX	\$
		PLEASE PAY THIS AMOUNT	\$ 1701.26

Signature

Date

Customer Copy

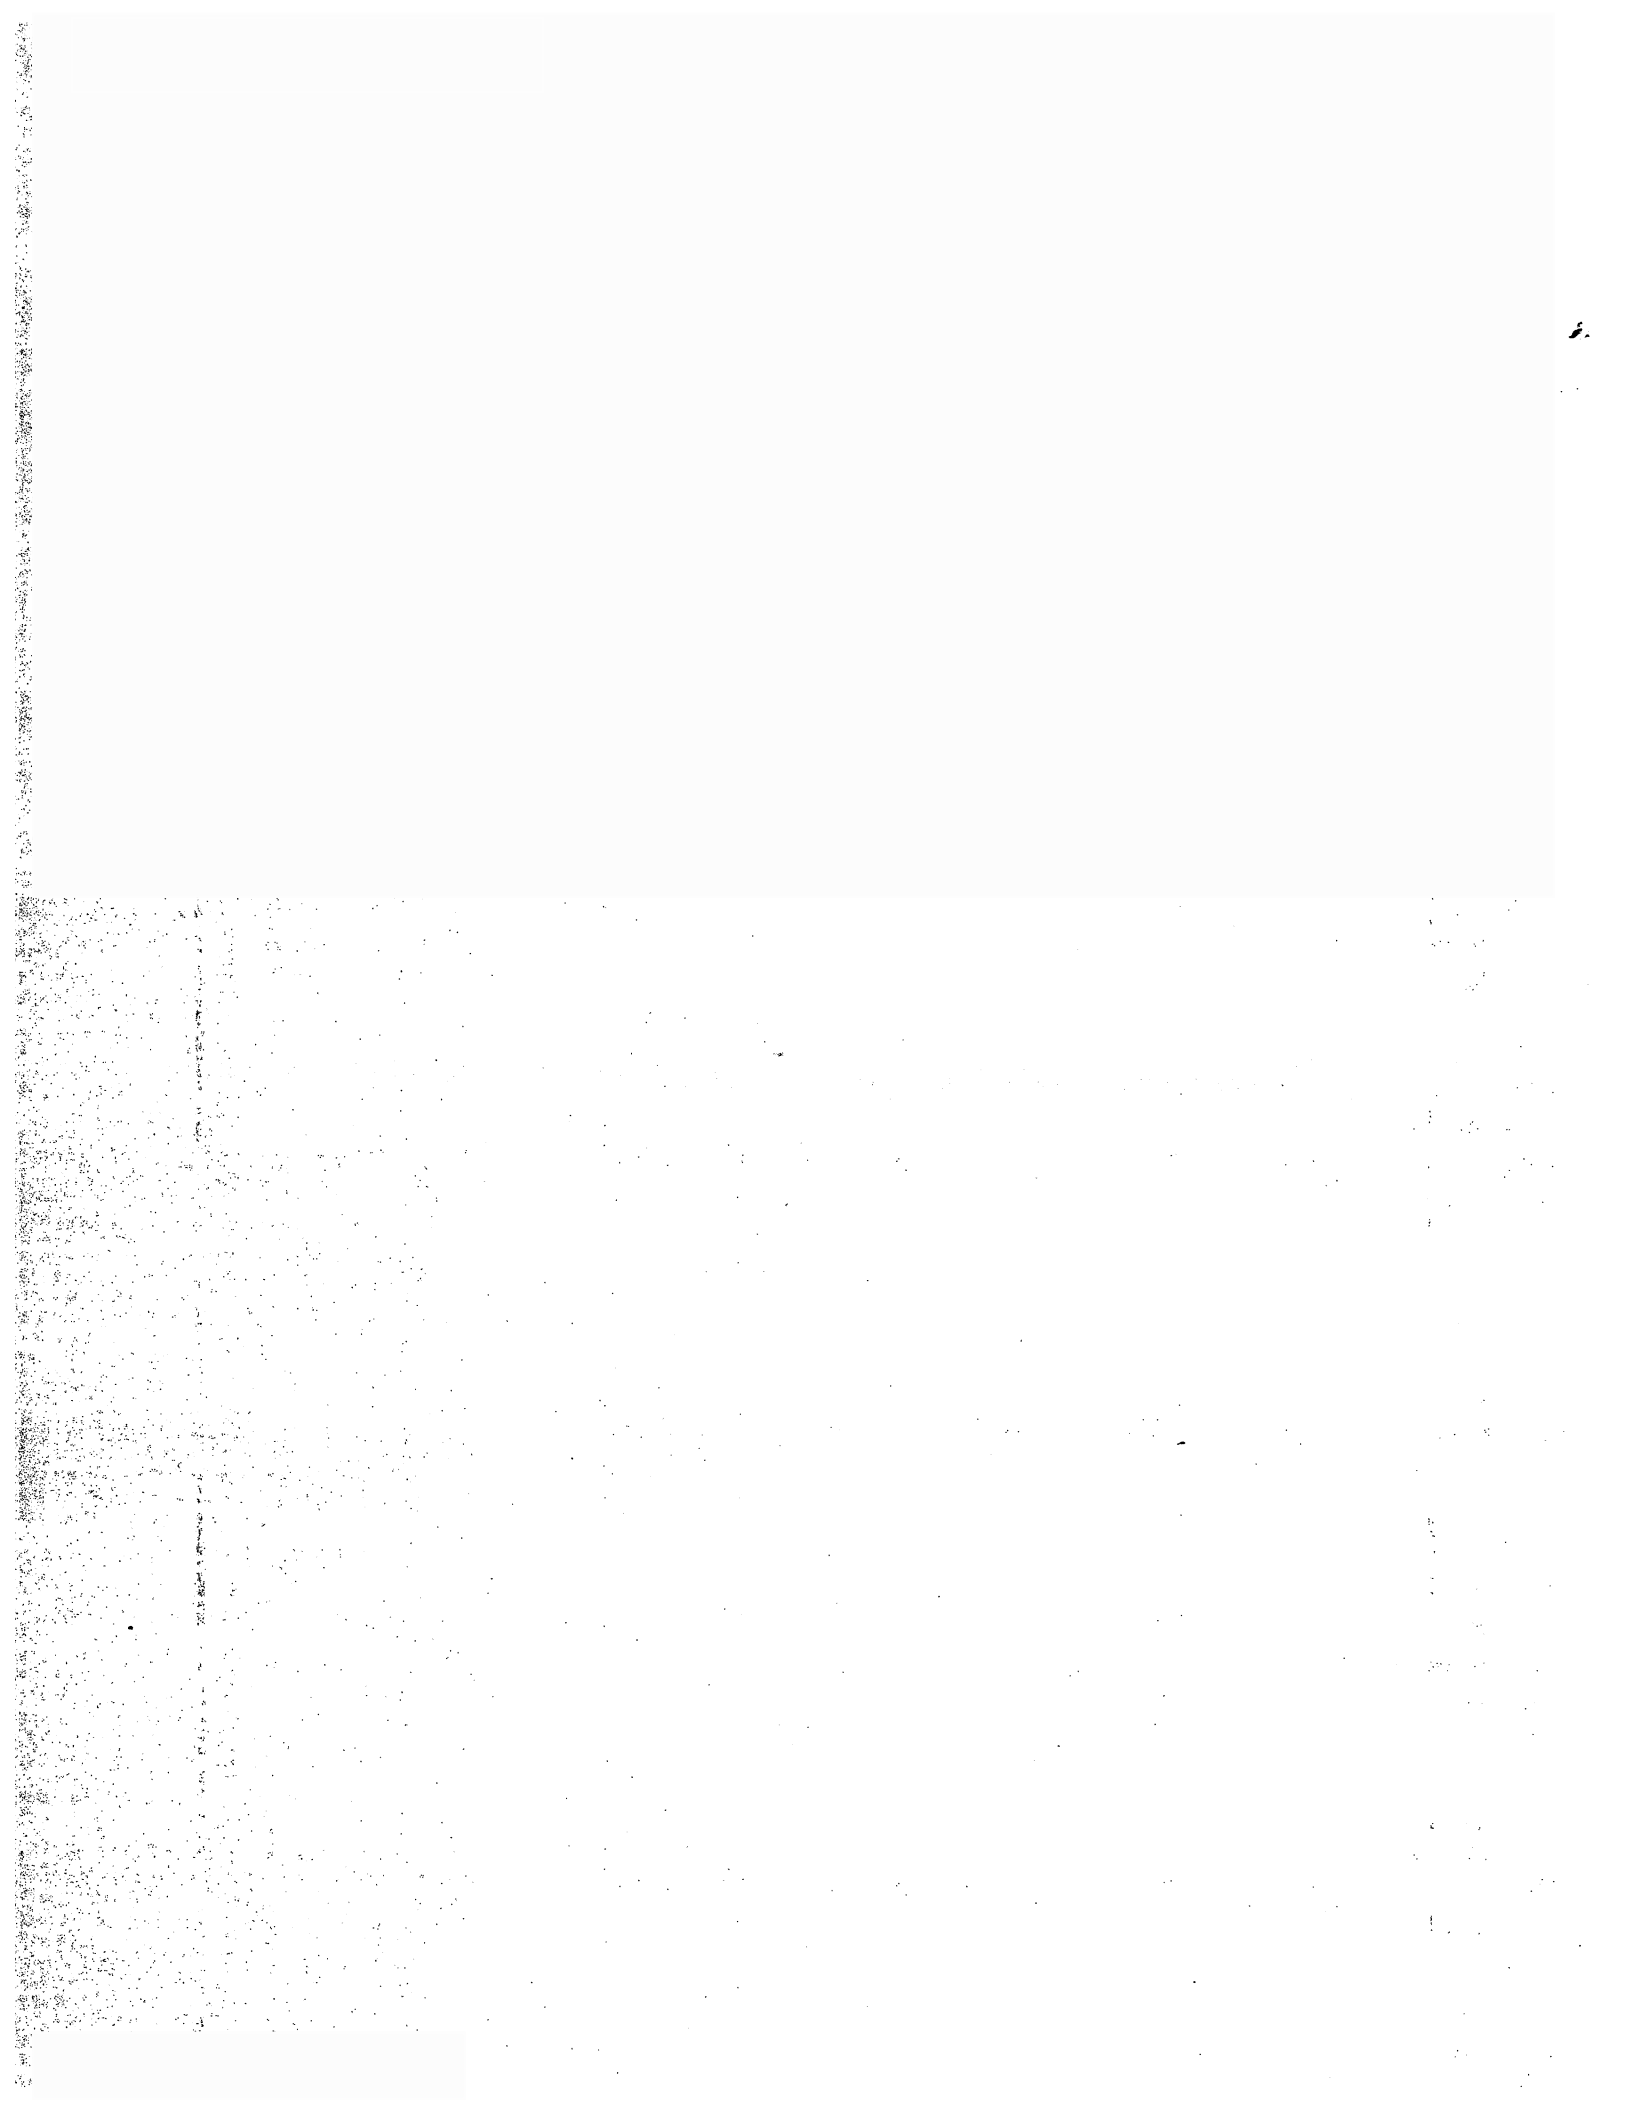

Payment terms are 30 days from invoice date unless otherwise agreed upon in writing.

INVOICE NO

BILL TO

OWNER

DATE	CUSTOMER ORDER NO.	DATE IN SERVICE	ENGINE MODEL	PUMP NO.	EQUIPMENT MAKE
07-MAR-2018	PD AMEX	06-MAR-2018	ISM CM875		INTERNATIONAL
CUSTOMER NO.	SHIP VIA	FAIL DATE	ENGINE SERIAL NO.	CPL NO.	EQUIPMENT MODEL
		06-MAR-2018	35120336		8600
REF. NO.	SALESPERSON	PARTS DISP.	MILEAGE/HOURS	PUMP CODE	UNIT NO.
115508	491		501742		0659

QUANTITY ORDERED	BACK ORDERED	QUANTITY SHIPPED	PART NUMBER	DESCRIPTION	PRODUCT CODE	UNIT PRICE	AMOUNT
------------------	--------------	------------------	-------------	-------------	--------------	------------	--------

OSN/MSN/VIN 1HSHXAHR35J200659

COMPLAINT CUSTOMER STATES ENGINE CRANKS, NO START.
CHECK AND ADVISE.
UNIT# 0659

CAUSE DSBQH2057
ECM POWER SUPPLY WIRE CONNECTOR FROM BATTERY.

CORRECTION TOWED UNIT INTO SHOP. HOOKED UP INSITE, UNABLE TO COMMUNICATE WITH
ECM. CHECKED AND FOUND NO POWER TO ECM. CHECKED POWER SUPPLY
TO ECM AND FOUND POWER SUPPLY WIRE FROM BATTERY TO ECM HAD AN
EXPANDED PIN IN CONNECTOR. REPAIRED CONNECTOR. STARTED AND RAN
ENGINE. ENGINE RUNS AND CAN COMMUNICATE WITH ECM.

COVERAGE BILLABLE
REMARK

PARTS:
PARTS COVERAGE CREDIT:
TOTAL PARTS:
SURCHARGE TOTAL:
LABOR:
LABOR COVERAGE CREDIT:
TOTAL LABOR:
MISC.:
MISC. COVERAGE CREDIT:
TOTAL MISC.:
SHOP SUPPLIES
HAZ WASTE DISPOSAL
ELECTRONIC TOOLING FEE

TAX EXEMPT NUMBERS:

Payment terms are 30 days from invoice date unless otherwise agreed upon in writing.

BILL TO

OWNER

DATE	CUSTOMER ORDER NO.	DATE IN SERVICE	ENGINE MODEL	PUMP NO.	EQUIPMENT MAKE
07-MAR-2018	PD AMEX	06-MAR-2018	ISM CM875		INTERNATIONAL
CUSTOMER NO.	SHIP VIA	FAIL DATE	ENGINE SERIAL NO.	CPL NO.	EQUIPMENT MODEL
		06-MAR-2018	35120336		8600
REF. NO.	SALESPERSON	PARTS DISP.	MILEAGE/HOURS	PUMP CODE	UNIT NO.
			501742		0659

QUANTITY ORDERED	BACK ORDERED	QUANTITY SHIPPED	PART NUMBER	DESCRIPTION	PRODUCT CODE	UNIT PRICE	AMOUNT
------------------	--------------	------------------	-------------	-------------	--------------	------------	--------

OSN/MSN/VIN 1HSHXAHR35J200659

LOCAL 0.00

SUB TOTAL:
TOTAL TAX:
TOTAL AMOUNT: US \$ 791.10

DATE