

Invoice To Account No: 142107

Deliver To:

SERVICE INVOICE

Invoice Number: 1000478502
Invoice Date: 12/15/2022
Location: 43
Work Order Number: 2209016
Payment Type: Account
Page: 1 of 6
Work Performed By: Derek Barnhart

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
2011 JOHN DEERE 568	4882	1E00568XCBB376243	234005PLP	

Service Reminders:

PWR/9006/590 Retail

CORRECTION:

01 Round Baler Inspection

Combo package w/ baler (Tractor \$400/ Baler \$99)

Parts / Misc Items:

PartNumber	Description	Quantity	Unit Net	Value	Taxed Ind
P5340142	SERVICE INSPECTION DISCOUNT ALLOWED				

Miscellaneous Charges:

568/7555/GCI/10P Retail

CORRECTION:

02 GEAR CASE INPUT SHAFT SEAL - Remove & Install

Removed power shaft
Removed seal from gear case
Installed new seal
Filled gear case with oil
Installed power shaft

Parts / Misc Items:

PartNumber	Description	Quantity	Unit Net	Value	Taxed Ind
AW25863	SEAL				
TY26372	80W140 Synthetic Gear Lube qt				

568/6404/UD/10P Retail

CORRECTION:

03 UPPER DRIVE CHAIN - Remove & Install



Make/Model:

2011 JOHN DEERE 568

Meter

4882

Serial Number:

1E00568XCBB376243

EQ Id:

234005PLP

Fleet No:

Service Reminders:

Removed coupler link and chain
Installed new chain and coupler link
Checked lower and upper sprockets for wear
Installed new chain and coupler link
Adjusted tension

Parts / Misc Items:

<u>PartNumber</u>	<u>Description</u>
AFH206114	Roller Chain

Miscellaneous:

568/6404/LBD/10P Retail

CORRECTION:

04 LOWER BELT DRIVE CHAIN - Remove & Install

Removed coupler link and chain
Inspected sprockets for wear
Installed lower belt drive chain and coupler link
Adjusted idler chain tension

Parts / Misc Items:

<u>PartNumber</u>	<u>Description</u>
AFH206115	Roller Chain

568/6404/STR/10P Retail

CORRECTION:

05 STARTER ROLL CHAIN- Remove & Install

Removed coupler link and chain
Inspected sprockets for wear
Adjusted tension

AND
IRELAND PARTNER
44 County Ro
Emporia KS
Phone: (620)
Fax: (620)

Make/Model: 2011 JOHN DEERE 568 Meter 4882 Serial Number: 1E00568XCBB376243 EQ Id: 234005PLP Fleet No:

Service Reminders:

Parts / Misc Items:

<u>PartNumber</u>	<u>Description</u>
DC33766	Idler

568/3351/OPK/B/10P Retail

CORRECTION:

06 PICK UP OUTER BEARING - Remove & Install

Supported pickup
Removed shield
Raised idler arm to relieve chain tension
Removed drive chain
Removed sprocket
Loosened adjusting screw until float spring loose
Removed links
Removed three nuts and bearing assembly
Installed in reverse order

Parts / Misc Items:

<u>PartNumber</u>	<u>Description</u>
AFH213106	Ball Bearing
E79725	Pressed Flanged Housing

568/6936/TW/10P Retail

CORRECTION:

07 CUTTER TWINE KNIFE - Remove & Install

Removed cap screws
Removed and installed knife
Installed cap screws
Adjusted cutter knife
Tightened cap screws

Make/Model:

2011 JOHN DEERE 568

Meter

4882

Serial Number:

1E00568XCBB376243

EQ Id:

234005PLP

Fleet No:

Service Reminders:

Parts / Misc Items:

PartNumber

Description

E87816

Knife

Miscellaneous Charges:

568/6937/BSL/E/10P Retail

CORRECTION:

08 Belt splice pin - Remove & Install

Removed and installed splice pins

Parts / Misc Items:

PartNumber

Description

E86147

PIN

568/7323/PUL/L/10P Retail

CORRECTION:

09 LEFT PUSH BAR SHOCK ABSORBER - Remove & Install

Removed nuts and cap screws

Removed and installed shock absorber

Installed cap screws and nuts

Tightened hardware

Parts / Misc Items:

PartNumber

Description

AE47836

SHOCK ABSO

2011 JOHN DEERE 568

4882

1E00568XCB376243

234005PLP

Service Reminders:

568/7323/PUL/R/10P Retail

CORRECTION:

10 ABSORBER SHOCK RIGHT PUSH BAR - Remove & Install

Removed nuts and cap screws
Removed and installed shock absorber
Installed cap screws and nuts
Tightened hardware

Parts / Misc Items:

<u>PartNumber</u>	<u>Description</u>
AE47836	SHOCK ABSO

568/9006/GLC/86P Retail

CORRECTION:

11 BALER - Grease & Lubricate

Greased all lubricated points
Oiled all chains

Parts / Misc Items:


<u>PartNumber</u>	<u>Description</u>
A-JT6HTL	Grease, Mystik Multi Purpose Grease
TY6341	SD Polyurea Grease

568/3354/HU/R/10P Retail

CORRECTION:

12 HUB BEARING & SEAL RIGHT SIDE - Remove & Install

Jacked up baler and supported on stands

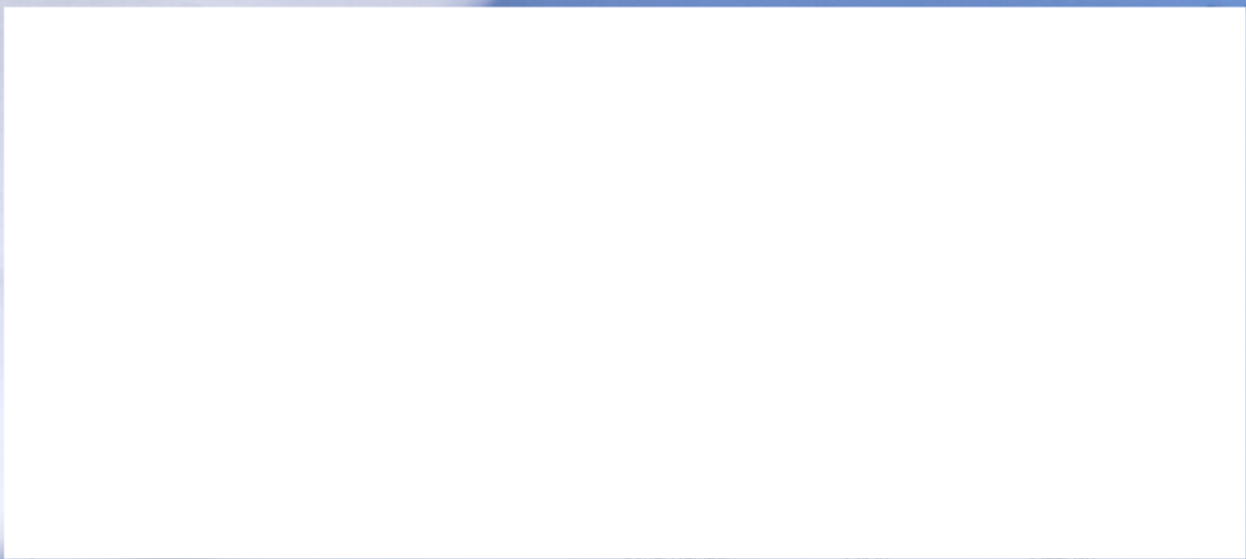

2011 JOHN DEERE 568

4882

1E00568XCBB376243

234005PLP

Service Reminders:


Removed wheel and hub
Cleaned and inspected bearings
Replaced if necessary
Packed bearings and replaced seal
Installed hub
Adjusted bearing load
Reassembled in reverse order

Parts / Misc Items:

<u>PartNumber</u>	<u>Description</u>
E50607	SEAL



Miscellaneous Charges:



Total: \$3,402.03

**PLEASE PAY FROM
THIS INVOICE**

TERMS AND CONDITIONS

Received by: Date: