

**SERVICE ORDER: R110014538**

DATE RECEIVED	DATE INVOICE	INVOICE TYPE	REVISION	TERMS	CUSTOMER REFERENCE			
8/23/2023 12:00:00AM		SAR	Revised	CASH				
YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	ENGINE HOURS	IN SERVICE	Equipment Serial #	DESCRIPTION
2008	PETERBILT	CONVENTIONAL	2APR00NVA8M755900		0		93300221100	

**Sold Operations**

**JOB #1 00-01 INITIAL ASSESSMENT**

**COMPLAINT** NOT GOING INTO ANY GEAR  
DO NOT SHIFT LIGHT CAME ON  
POSSIBLY OVERHEATED TRANSMISSION

**CAUSE** INTERNAL DAMAGE TO TRANSMISSION

**CORRECTION** TRANSMISSION WILL NOT BUILD TURBINE SPEED. TRANSMISSION WILL NEED TO BE REMOVED AND TORN DOWN FOR INSPECTION.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 00401	INITIAL ASSESSMENT		
1	DIAG	TECHNOLOGY FEE		

Prepay: \$0.00 Parts: \$0.00 Labor: 0 Misc: Sublet: \$0.00

**JOB #3 03-00 TRANSMISSION**

**COMPLAINT** REMOVE AND TEAR DOWN TRANSMISSION


**CAUSE** LOCKUP CLUTCH FAILED CAUSING PROGRESSIVE DAMAGE

**CORRECTION** REMOVED DRIVELINE, PTO PUMP, SENSORS, AND PANEL FOR TC BOLTS FOR ACCESS. PULLED TC BOLTS, DRAINED FLUID, REMOVED DIP STICK AND COOLER LINES. REMOVED AND DROPPED TRANSMISSION ONTO JACK. TOOK TO BUILD AREA. TORE TRANS APART AND TORE SUBASSEMBLIES DOWN. EVERY CLUTCH IS BURNED, THE LOCKUP CLUTCH BEING THE WORST AND C1 BEING WITH SIMILAR WEAR. THERE IS METAL AND CLUTCH DEBRIS ALL THROUGHOUT TRANS. WILL NEED COMPLETE REBUILD. SPOKE TO FOREMAN

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR ATD157-6001A	[90095211] PARTIAL TRANSMISSION OVERHAUL		

Prepay: \$0.00 Parts: \$0.00 Labor: Misc: \$0.00 Sublet: \$0.00

Assess your... the operational and cost of...  
<https://bit.ly/WorldKinectFuelTankSolutions> then...  
 the monitoring to us. Installing a World Kinect provided tank monitoring...  
 via the myWorld portal, and we can include top-ups and...  
 KinectTankMonitorSolutions

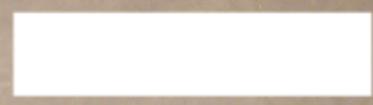

Sold Operations (Cont.)

JOB #5 03-00 TRANSMISSION

COMPLAINT REFRANS AND ASSOCIATED PARTS  
 CAUSE REFRANS INSTALLATION  
 CORRECTION ASSEMBLED CORE SWAPPED EVERYTHING TO REFRANS, LOCATED ALL BOLTS, GOT TRANS READY TO GO IN. MATED TRANS TO ENGINE, INSTALLED BOLTS AND BRACKETS. INSTALLED CONVERTER BOLTS, INSTALLED PTO PUMP AND WIRING, INSTALLED DIPSTICK AND BRACKETS. BRACKETED WIRING, ROUTED HARNESS, INSTALLED DRIVELINE, ADDED FLUID, RESET SHIFTS AND TOOK TO STEAM BAY STEAMED OFF TRANS AND ENGINE. LET TRUCK GET TO TEMPERATURE AND TOPPED OFF FLUID. TOOK ON ROAD TEST, NO ISSUES. PARKED UNIT. PUT CORE IN CRATE AND PLACED IN CORE AREA

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTENSION
6	110A 11515283	"BOLT-HEXLOCK TYPE B, M10 X 1		
1	110A 29513736	"GASKET- MOUNTING, PTO"		
1	110A 28544861	MD3000PRM RETRAN ASSEMBLY		
0	110A 29544861-CORE	MD3000PRM RETRAN ASSEMBLY-CORE		
12	110A P11805232	BOLT-HEXLOCK TYPE B M8 X 1.25		
1	110D SP 6-5 70 18X	STRAP BOLT KIT		
4	110X 1000011418	55 GAL DRUM ATF SOLD PER GAL.		
8	110X 15E2E1	TRANSYND TES 668 GALLON		
	LABOR ATD234-6030B	[00094000] TRANSMISSION R&R (REMOVE & REPLACE)		
	LABOR ATD320-6027A	[00096401] FINAL TEST DRIVE/W-FAST ADAPT		
	LABOR ATD327-6005A	[00094003] R&R PTO, HYDRAULIC PUMP		
	LABOR ATD342-6020K	[00094006] STEAM CLEAN TRANSMISSION& INSTALLE		
	LABOR ATD3RD-6904E	[00094010] BACK FLUSH CLEAN TRANS OIL COOLER		
	C	DISCOUNT CODE 3K10		
	C	SERIAL: 9330025100		
1	FRG	PRE-APPROVED FREIGHT NDA - P20493		

Prepay: \$0.00 Parts: Labor: Misc: Sublet:

Sold Operations Totals Prepay: \$0.00 Parts: Labor: Misc: Sublet: \$0.00

	ESTIMATED	BILLED
LABOR		
PARTS		
MISC		
SUBLET		\$0.00
PREPAY		\$0.00
SUBTOTAL		

SHOP SUPPLIES  
 TAX  
 TOTAL

AUTHORIZED BY

*John W. [Signature]*

DATE

8-25-23