


Description	Technician	Qty
OVERHAUL TRANSMISSION P0741		
TCC OFF		
Work Requested - ENGINE AND TRANS TUNE		1.00
EXHAUST CLAMP		1.00
OE TORQUE CONVERTER ASSEMBLY		1.00
CONTROL VALVE BODY		1.00
SEAL KIT		1.00
SEAL KIT		1.00
SEAL KIT		1.00
SEAL KIT		1.00
FILTER		1.00
SYNTHETIC DEXRON III FLUID		14.00
VALVE BODY RECONDITIONING KIT		1.00
Work Requested - OVERHAUL TRANSMISSION		
TRANSMISSION. DISASSEMBLE TRANSMISSION. ASSEMBLE WITH NEW PARTS		
Work Requested - FLUSH TRANSMISSION COOLER		
Work Requested - DIAGNOSE TRANSMISSION PROBLEM		

5.89  
8.00  
\$0.00  
\$0.00  
\$39.02  
\$5.00  
\$5.00

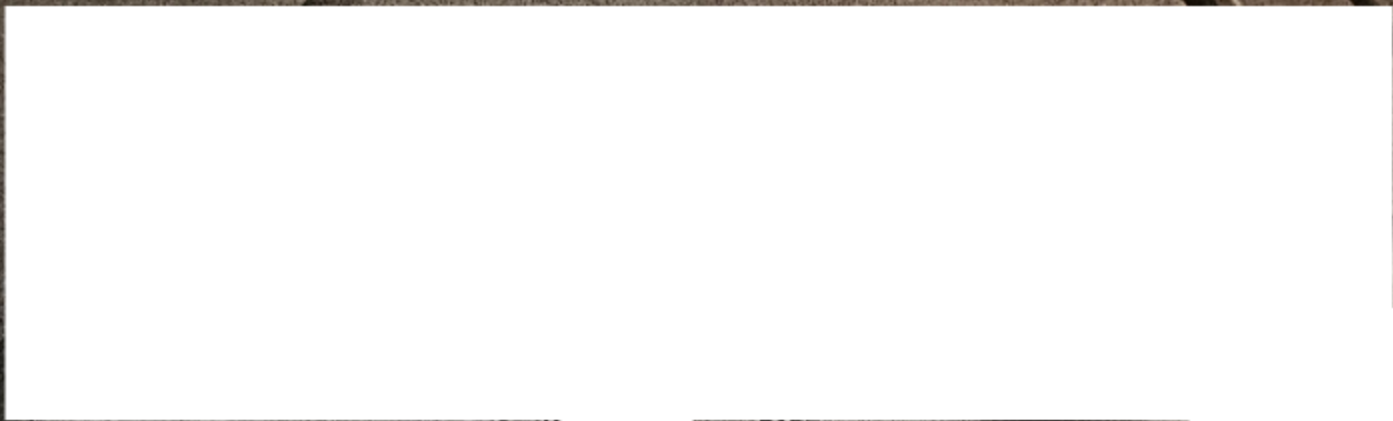

VEHICLE STILL HAS ENGINE  
OIL LEAK FROM VALVE COVER THAT NEEDS  
REPAIRED.  
\*DECLINED\* REPLACE THE LEFT VALVE  
COVER ASSEMBLY  
REPLACE REAR BRAKE PADS AND ROTORS  
NOTE: VEHICLE HAS A HARD SHIFT FROM  
10TH GEAR TO 9TH GEAR ABOUT 50 MPH.  
TRANSMISSION FLUID SMELLS BAD AND IS  
VERY DARK  
NOTE: DID NOT REPLACE LEFT VALVE COVER  
AT THIS TIME - VALVE COVER HAS BEEN  
SPECIAL ORDERED FROM DEALER AND WILL  
CALL CUSTOMER  
WHEN IT COMES IN - PART IS ON BACK  
ORDER AT THIS TIME NOTE: TIRE LIGHT  
STILL ON - ASSUME NO SENSORS IN  
AFTERMARKET WHEELS

PARTS & LUBRICANTS		QTY
SPARK PLUGS		6.00
COIL BOOTS		6.00
*DECLINED* VALVE COVER ASSEMBLY - LEFT SIDE		1.00
BRAKE PADS AND ROTORS KIT - REAR		1.00



TOTAL 1077.37



Ad.  
189  
Y Hay  
burg

DESCRIPTION	QTY
VALVE COVER ASSEMBLY - LEFT SIDE	1.00
PLENUM GASKET	5.00
OIL FILTER 121/57502	1.00
ENGINE OIL 5W30	6.00

TOTAL 607.83  
BALANCE DUE 607.83

Description	Technician	Qty
SERVICE WITH COMPLETE REAR AXLE ASSEMBLY		
Work Requested - SERVICE WITH COMPLETE REAR AXLE ASSEMBLY		
USED REAR AXLE ASSEMBLY		1.00
LUBE		1.00

Amount

\$4,893.10