

DATE RECEIVED 6/1/19	DATE PROMISED 6/1/19
PHONE 544-7776	DATE COMPLETED 6/1/19
STATE KS	ZIP 66206


QTY.	PART NO. and DESCRIPTION	AMOUNT
1	5911 STARTER MACHINES.	265.00
1	INT VALVE BODY ASSY	244.60
	INT OIL	10.50
	SEALANT.	4.50
1	USED PORT INT CYLINDER	160.00

PRODUCT MAKE/MODEL SEARAY PLATINUM		ENGINE MAKE/MODEL SEARAY 350 MERCURY	SERIAL NO. ENGINE #1	SERIAL NO. DRIVE #1
TANKS	BATTERY	KEY NO.	REGISTRATION NO.	SERIAL NO. ENGINE #2
NATURE OF SERVICE REQUEST NEW VALVE BODY		STORAGE FROM TO		

DESCRIPTION OF WORK	AMOUNT
STARTER CLICKING SOMETIMES & WON'T START.	
TRUBLESHOOT STARTER	
FOUND STARTER HAS DEAD SPOT IN ARMATURE. REPLACE STARTER & TEST. TROUBLESHOOT TRIM	
& INSTALLED NEW VALVE BODY & PORT TRIM CYLINDER FILE & PURGE & TEST.	
ON 6/21/19 BV. 1298	

TOTAL LABOR	
TOTAL PARTS	684.60
OUTSIDE REPAIRS	
☐ LAUNCH ☐ DELIVER	
☐ HAUL-OUT ☐ PICK-UP	

I hereby authorize the above repair work to be done along with

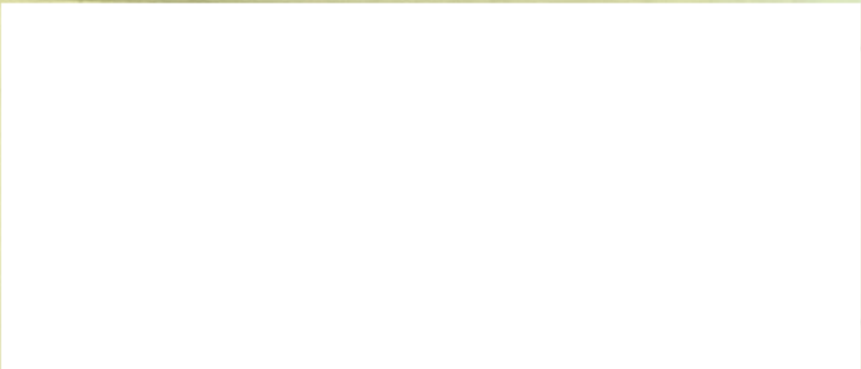

☐ RETAIL ☐ INTERNAL		ORDER WRITTEN BY
☐ WARRANTY ☐ ESTIMATE		S.C.U.
005833		Dropping off
NAME	DATE RECEIVED	DATE PROMISED
ADD		1384
CITY		DATE COMPLETED
STATE		5/11/84
ZIP		

QTY.	PART NO. and DESCRIPTION	AMOUNT
1	6763 TRIM, TILT MOTOR & RESERVOIR	274.45
1	8220 100AMP FUSE	39.50
	TNT OIL	15.00
	FREIGHT	30.00

~~STAY IN~~ ~~WHEN TRYING TO START.~~
NO TRIM & TILT.



DESCRIPTION OF WORK	AMOUNT
TROUBLESHOOT FOUND MAIN POWER FUSE FOR TRIM & TILT BLOWN BLOWN & MOTOR BURNED UP. REMOVE TRIM & TILT UNIT & REMOVE & CLEAN VALVE BODY. INSTALL VALVE BODY ON NEW MOTOR & RESERVOIR UNIT. INSTALL UNIT IN BOAT. FILL TEST & PURGE.	
RAVE TESTED STARTER NEVER CLUTCHED.	

TOTAL LABOR	
TOTAL PARTS	359.45
OUTSIDE REPAIRS	

006352

☐ RETAIL ☐ INTERNAL
☐ WARRANTY ☐ ESTIMATE

ORDER WRITTEN BY

DATE RECEIVED

DATE PROMISED

ONE

DATE COMPLETED

ZIP

NA

AD

CI

PRODUCT MAKE/MODEL

ENGINE MAKE/MODEL

SERIAL NO. ENGINE #1

SERIAL NO. DRIVE #1

TANKS

BATTERY

KEY NO.

REGISTRATION NO.

SERIAL NO. ENGINE #2

SERIAL NO. DRIVE #2

NATURE OF
SERVICE
REQUEST

BROKEN STROKE RING

☐ STORAGEFROM
TO

DESCRIPTION OF WORK

AMOUNT

REMOVE OUTDRIVE REMOVE
ENGINE REMOVE GIMBAL
HOUSING FROM BACK OF BOAT
FOUND SOFT PLUG OUT ON FRONT
STIMBOLD SIDE OF ENGINE & MOUNTING
IN THE OIL. PULL ENGINE MOUNT REPLACE
SOFT PLUG REINSTALL MOUNT SERVICE OIL &
PATCH CHANGE OUT FUEL FILTER CHECK
STARTER. REMOVE STEERING ARM & GIMBAL
RING FROM FRONT GIMBAL HOUSING REPLACE
PARTS & REASSEMBLE GIMBAL ASG & REINSTALL
IN BOAT REINSTALL ENGINE. REPLACE W.P.

IMPECTION IN OUTDRIVE & SERVICE
OIL. VTDING'S ENGINE CO. CAN & GIMBAL
BEING REACH ENGINE MOUNT IN
OUTDRIVE TO OFF TIVIOIL RUN TOS

TOTAL LABOR

TOTAL PARTS

OUTSIDE REPAIRS

☐ LAUNCH ☐ DELIVER
☐ HAUL OUT ☐ PICK-UP

I hereby authorize the above repair work to be done along with
the necessary materials. You and your employees may operate
the unit herein described.

QTY. PART NO. and DESCRIPTION AMOUNT

1 USED STEERING ARM
1 USED GIMBAL RING
1 TRANSMISSION OIL
1 GREASE
2 GIMBALING BOLTS 1/2" x 1/4"
1 MARINE SILICONE
5 QTS MARINE 30WT OIL
1 MARINE OIL FILTER
1 FULL WATER SEPARATOR
1 SOFT PLUG
1 EXHAUST RISE BOLT
1 WATER INTAKE HOSE
1 W.B. TAPPED ON
445 BPF W.V. LUBE
STATION
1 LOOPER BIN 3/4 T
1 TNT OIL

PAID
\$