


SERIAL#	UNIT #	VIN	MILEAGE	YR/MAKE	ICC
	17	3J053216	234560	03/TH	
Description				Rate	Amount
<p>FULL SERVICE. PERFORMED FULL SERVICE PER SHEET.</p> <p>FILTER            FILTER            FUEL FILTER            15W40 OIL            GREASE            FILTER, AIR            75W90 GEAR LUBE SYN</p> <p>SERVICE TRANSMISSION. DRAINED TRANSMISSION, REMOVED OLD FILTERS. CLEANED ALL SURFACES. INSTALLED NEW FILTERS, FILLED TRANSMISSION WITH FLUID. RAN AND CHECKED FOR LEAKS. FOUND TRANSMISSION LEAKING WHERE PTO MOUNTS. FOUND BROKEN BOLT, EXTRACTED BROKEN BOLT AND REPLACED WITH NEW. MADE SURE ALL OTHERS TIGHT. TEST DROVE TRUCK. ALL OK.</p> <p>FILTER, TRANSMISSION            TRANS FLUID, SYN</p> <p>REPLACE STEER BRAKES AND DRUMS. WHILE PERFORMING FULL SERVICE FOUND RIGHT BRAKE SHOE PADS HAD CAME OFF AND TORE DRUM UP. ADVISED CUSTOMER OF PROBLEM. AUTHORIZED TO REPLACE BOTH SIDES. JACKED AXLE UP, REMOVED WHEELS, DRUM AND BRAKES. INSTALLED NEW BRAKES AND DRUMS. INSTALLED WHEELS AND TORQUED TO SPECS AND ADJUSTED BRAKES TO SPECS.</p> <p>BRAKE SHOE            BRK.DRM.BAL</p>					

Balance Due

\$1,467.06



HIP

	Due Date	Authorizer
0	11/7/2018	STEVE CHANEY

L, IL

SMOKE

D PICKED UP TRUCK FOUND ICP NOT REACHING  
ICP. DEAD HEADED PUMP, FOUND PUMP WAS  
VALVE COVER. FOUND NUMBER 2 INJECTOR  
AND RAN. KICKED AND BUCKED THROUGH CO  
JK - 10/5/2018

R

ELLENVILLE, IL

DT23J053216

4 Miles

Service Order	Terms	Due Date	Authorizer	Customer PO	Unit #
132987	Net 30	1/1/2020	STEVE CHANEY		17

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

**Complaint:** TRANS WON'T SHIFT ABOVE 3RD GEAR - DROPS BACK TO FIRST  
**Cause:** CUSTOMER REQUEST

**Labor Correction:**

Transmission / Automatic Transmission / HOOKED UP PC FOUND CODE FOR NO OUT PUT SPEED REMOVED  
SENSOR AND TONE RING SPUN REMOVED DRIVE LINE AND REAR SECTION OF TRANS DISASSEMBLED AND  
REMOVED BAD TONE RING AND PIN INSTALLED NEW PIN AND TONE RING REASSEMBLED AND TOPPED  
OFF FLUID DROVE CLEARED CODES ALL OK. - 11/29/2019

Parts PIN-SPRING

Parts GEAR

Parts SEAL

Parts REAR COVER GSK

Parts SENSOR ASSEMBLE

Parts KIT

Parts AUTOMATIC TRANS FLUID QT


Parts COMPUTER DIAGNOSTIC

Unit: 17 VIN: 1HTWHADT23J053216

2003 International 7400

Cab & Chassis: 239,902 Miles





WNSHIP

951

Terms	Due Date	Av
Net 30	1/9/2020	STEVE

START

ging / HOOKED UP TO PC HAD NO ICP WHILE CR  
ED IN SHOP DRAINED COOLANT AND REMOVED  
JECTOR O-RING BROKE REMOVED AND REPLAC  
R

DIOSTIC

1723J053216

2 Miles

formation

ed	Date Applied	Payme
	1/6/2020	76206

er do hereby authorize this repair work (labor  
in order to test, inspect or deliver at custom  
due to fire, theft, accident or any other caus  
status, and agrees to pay 2% finance charge  
osts and collection costs under this agreem  
d by invoice. All returns are subject to 20%  
rs or electrical parts.

TS MUST BE RETORQUED AFTER 100 MIL

Service Order	Terms	Due Date	Authorizer	Customer PO	Unit #
128565	Net 30	11/7/2018			17

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Drive to unit  
L  
M

Complaint: ENGINE MISS/ BLACK SMOKE  
Cause: CUSTOMER REQUEST

Labor **Correction:**  
Engine / Fuel / WENT AND PICKED UP TRUCK FOUND ICP NOT REACHING DESIRED PRESSURE.  
BROUGHT BACK TO SHOP. DEAD HEADED PUMP. FOUND PUMP WAS GOOD. DRAINED COOLAN  
REMOVED PIPES AND VALVE COVER. FOUND NUMBER 2 INJECTOR O-RING BLOWN OUT. REPL  
RING. REASSEMBLED AND RAN. KICKED AND BUCKED THROUGH CODE FOR WRONG CAM SIG  
REPLACED RAN ALL OK. - 10/5/2018

- Parts O-RING KIT INJECTOR
- Parts O-RING
- Parts O RING
- Parts ANTIFREEZE
- Parts SENSOR

Unit: 17 VIN: 1HTWHADT23J053216  
2003 International 7400  
Cab & Chassis: 237,444 Miles

Total \$874.08

133161 Net 30 1/9/2020 [Redacted] 17

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

Complaint: UNIT CRANKS NO START  
Cause: CUSTOMER REQUEST

Labor Correction:  
Engine / Starting & Charging / HOOKED UP TO PC HAD NO ICP WHILE CRANKING DEAD HEADED PUMP AND  
HAD PRESSURE PULLED IN SHOP DRAINED COOLANT AND REMOVED PIPES AND VALVE COVER CRANKED  
FOUND NUMBER 3 INJECTOR O-RING BROKE REMOVED AND REPLACED DROVE ALL OK. - 12/9/2019

Parts O-RING KIT INJECTOR

Parts O-RING

Parts O RING

Parts COMPUTER DIAGNOSTIC

Unit: 17 VIN: 1HTWHADT23J053216  
2003 International 7400  
Cab & Chassis: 240,032 Miles



Service Order	Terms	Due Date	Customer PO	Authorizer	Unit #
123052	Net 30	6/18/2017			17

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

**Complaint:** OIL IN FUEL  
**Cause:** CUSTOMER REQUEST (Service Request)

**Labor Correction:**  
 Engine / Cooling / REMOVED AIR TO AIR PIPE, DOG HOUSE, VALVE COVER, INJECTOR HARNESS, AND INJECTORS. FOUND O-RING ON INJECTOR #3, #5, AND #6 BAD, REMOVED AND REPLACED ALL INJECTOR O-RINGS. SUCKED FUEL OUT OF CYLINDERS AND REASSEMBLED. TEST DROVE ALL OK.

**Parts** CLAMP

**Parts** O-RING KIT INJECTOR

**Complaint:** FULL SERVICE  
**Cause:** CUSTOMER REQUEST (Service Request)

**Labor Correction:**  
 Engine / Lubrication / PERFORMED FULL SERVICE

**Parts** 15W40 OIL

**Parts** FILTER

**Parts** FILTER

**Parts** FILTER, AIR

**Parts** FUEL FILTER

**Parts** GREASE TRUCK

**Complaint:** INPUT SEAL FRONT DIFF LEAKING  
**Cause:** CUSTOMER REQUEST (Inspection)

**Labor Correction:**  
 Cab & Chassis / Drivetrain / REMOVED DRIVELINE AT FRONT DIFF, REMOVED YOKE AND REMOVED BAD PINION SEAL. INSTALLED NEW SEAL PUT YOKE BACK ON WITH NEW NUT. CHECKED DIFF AND ADDED FLUID. TEST DROVE NO LEAKS AT THIS TIME.

**Parts** 75W90 GEAR LUBE SYN

**Parts** KIT

**Parts** LOCKNUT

**Parts** SEAL PINION

VIN: 1HTWHADT23J053216  
International 7400  
Current Usage: 236,099 Miles

Amount

\$1,305.30



[REDACTED]

Service Order	Terms	Due Date	Customer PO	Authorizer	Unit #
123501	Net 30	7/30/2017			NEED

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

**Drive to unit**

Labor Drive to unit - EAST NELSON TOWNSHIP BUILDING ALLENVILLE, IL.  
Mileage

**Complaint:** UNIT WILL NOT START  
**Cause:** CUSTOMER REQUEST

Labor **Correction:**  
Engine / Electrical / DROVE UP TO ALLENVILLE. TRIED TO START, DIDN'T FIRE. HOOKED UP FUEL  
PRIMER AND BLEED AIR OUT OF FUEL SYSTEM. START AND RUN. - 6/28/2017


**Return from unit**

Labor Return from unit  
Mileage

**Unit:** NEED VIN: 1HTSDAAN8TH257302  
1995 IH 4900  
**Cab & Chassis:** 188,451 Miles

**Amount**

\$320.00

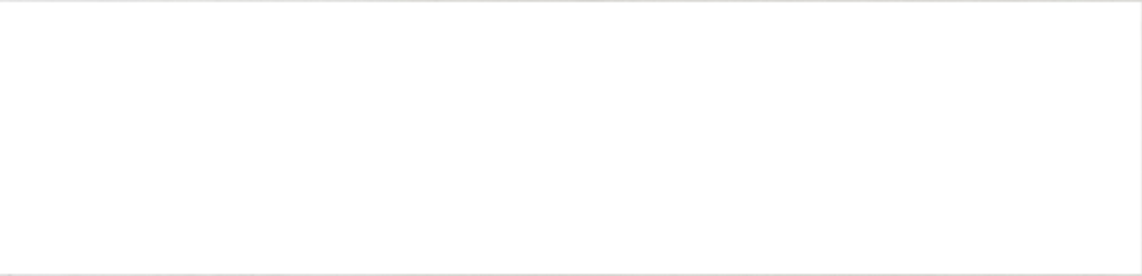

Service Order	Terms	Due Date	Authorizer	Customer PO	Unit #
125330	Net 30	1/18/2018			17

Item	Description	Quantity	Rate	Amount
------	-------------	----------	------	--------

**Complaint:** WHEEL SEAL LEAKING RIGHT STEER AXLE  
**Cause:** CUSTOMER REQUEST

**Labor Correction:**  
Cab & Chassis / Suspension / RAISED TRUCK. REMOVED WHEEL, DRUM, SHOE, HUB AND SEAL. CLEANED ALL SURFACES AND CHECKED BEARINGS, INSTALLED NEW SEAL. REASSEMBLED, TORQUING TO SPEC. FILLED WITH HUB OIL AND INSTALLED AXLE. CHECKED OVER. ALL OKAY - 12/18/2017

Parts SEAL, VOYAGER

Parts GASKET

Parts BRAKE CLEANER

Parts LUBE HUB OIL

**Complaint:** CHECK & ADJUST BRAKE TRAVEL  
**Cause:** CUSTOMER REQUEST (Inspection)

**Labor Correction:**  
Cab & Chassis / Braking / CHECK BRAKES AND CHECKED BRAKE TRAVEL. ALL OKAY - 12/18/2017

**Complaint:** WHEEL SEAL LEAKING RF DRIVE AXLE  
**Cause:** CUSTOMER REQUEST (Inspection)

**Labor Correction:**  
Cab & Chassis / Suspension / RAISED TRUCK. REMOVED WHEEL, DRUM, SHOE, HUB AND SEAL. CLEANED ALL SURFACES AND CHECKED BEARINGS, INSTALLED NEW SEAL. REASSEMBLED, TORQUING TO SPEC. FILLED WITH HUB OIL AND INSTALLED AXLE. CHECKED OVER. ALL OKAY - 12/18/2017

Parts SEAL WHEEL

Parts PRO-TORQ NUT

Parts LUBE HUB OIL

Parts BRAKE CLEANER

Parts GASKET





1HTWHADT23J053216  
International 7400  
& Chassis: 237,107 Miles

Amount

\$474.37

SERIAL#	UNIT #	VIN	MILEAGE	YR/MAKE	ICC
	17	3J053216	234560	03/1H	
Description				Rate	Amount

FULL SERVICE. PERFORMED FULL SERVICE PER SHEET.

FILTER

FILTER

FUEL FILTER

15W40 OIL

GREASE

FILTER, AIR

75W90 GEAR LUBE SYN

SERVICE TRANSMISSION. DRAINED TRANSMISSION, REMOVED OLD FILTERS. CLEANED ALL SURFACES. INSTALLED NEW FILTERS, FILLED TRANSMISSION WITH FLUID. RAN AND CHECKED FOR LEAKS. FOUND TRANSMISSION LEAKING WHERE PTO MOUNTS. FOUND BROKEN BOLT, EXTRACTED BROKEN BOLT AND REPLACED WITH NEW. MADE SURE ALL OTHERS TIGHT. TEST DROVE TRUCK. ALL OK.

FILTER, TRANSMISSION

TRANS FLUID, SYN

REPLACE STEER BRAKES AND DRUMS. WHILE PERFORMING FULL SERVICE FOUND RIGHT BRAKE SHOE PADS HAD CAME OFF AND TORE DRUM UP. ADVISED CUSTOMER OF PROBLEM. AUTHORIZED TO REPLACE BOTH SIDES. JACKED AXLE UP, REMOVED WHEELS, DRUM AND BRAKES. INSTALLED NEW BRAKES AND DRUMS. INSTALLED WHEELS AND TORQUED TO SPECS AND ADJUSTED BRAKES TO SPECS.

BRAKE SHOE

BRK.DRM.BAL

Payments/Credits \$0.00

Balance Due \$1,467.06