

JCB 3TS-8T SN: 2958412 HR 2419.0 W:00
Sold By: STOT PO #: BLUE SMOKE Date 3/20/25 REPAIR INVOICE RF21919
Ship By: Tax #: IA EXEMPT 2/24 13:41:22

Tax	D	Qty	Description	Price	Amount
-----	---	-----	-------------	-------	--------

Group: 01
PUBLIC NOTE
Brandon (712) 254-1301

Blueish smoke

PARTS SHP OTHER

#I	3	MIS	0734	BRAKE CLEAN	NW1	N/C
#I	1	JCB	320/06165	T4 56KW+ EG		N/C
#I	1	JCB	320/06219	LAMINAR SEA		N/C
#I	2	JCB	320/06198	GASKET - EG	V4H-5-3	N/C
#I	2	JCB	320/06245	BANJO BOLT		N/C
#I	4	JCB	320/06246	COPPER WASH		N/C
#I	1	JCB	320/06205	56KW EGR OU		N/C
#I	4	JCB	823/00372	WASHER	V4D-6-6	N/C
#I	2	JCB	320/06039	BOLT - BANJ		N/C
#I	1	JCB	320/07853	ELEMENT CCV	G006	N/C
#I	1	JCB	320/A7123	FILTER FUEL	G001	N/C
#I	1	JCB	320/B4420	FILTER - EN	G002	N/C
#I	1	JCB	320/A4111	HOSE CCV VE		N/C

SHOP LABOR

** TOTAL SHOP LABOR

freight from elkhart - \$10.25

JCB NDA FREIGHT - \$10.39

Complaint:

Blueish smoke

Cause:

EGR plugged

Correction: Follow procedures for P400 code.

Found EGR leaking oil.

Pulled EGR and EGR actuator off.

Pulled EGR Cooler and EGR crossover pipe off.

Pulled the EGR mixing tube out and it was plugged full.


Cleaned all parts except the EGR Cooler.

Found hose damaged of Air filter tube and replaced it.

Put all back together and ran it with no issues.

Done - 3/20/2025

NOW OFFERING MYACCOUNT! VIEW, DOWNLOAD OR PRINT INVOICES, STATEMENTS AND CHARGES ONLINE.
SIGN UP AT WWW.RUETERCO.COM/SIGNUP

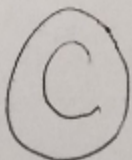

X

Charge Sale

Phone:

PAY THIS
AMOUNT

\$0.00