

Invoice Date: 43
 Location: 2382595
 Work Order Number: Finance
 Payment Type:
 Page: 3 of 6
 Work Performed By: Derek Barnhart

Make/Model: JOHN DEERE 567
 Meter:
 Serial Number: E00567X317080
 EQ Id: 264172PLP
 Fleet No:

Service Reminders:
 Loosened adjusting screw until float spring was loose
 Removed links
 Removed three nuts and bearing assembly
 Installed in reverse order

Parts / Misc Items:

PartNumber	Description	Quantity	Unit Price	Value	Taxed Ind
AFH213106	Ball Bearing	1.00		\$59.58	N
E79725	Pressed Flanged Housing	2.00		\$12.02	N

Miscellaneous Charges:

Labor: \$215.75 Parts: \$71.60 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$287.35

567/3351/OPK/R/10 Retail

CORRECTION:

06 RIGHT SIDE OUTER PICK UP BEARING - Remove & Install

Supported pickup
 Removed shield
 Raised idler arm to relieve chain tension
 Removed drive chain
 Removed sprocket
 Loosened adjusting screw until float spring was loose
 Removed links
 Removed three nuts and bearing assembly
 Installed in reverse order

Parts / Misc Items:

PartNumber	Description	Quantity	Unit Price	Value	Taxed Ind
AFH213106	Ball Bearing	1.00		\$59.58	N
E79725	Pressed Flanged Housing	2.00		\$12.02	N

Miscellaneous Charges:

Labor: \$215.75 Parts: \$71.60 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$287.35

567/7407/A/10 Retail

CORRECTION:

Invoice Number: 1001548873
Invoice Date: 02/07/2025
Location: 43
Work Order Number: 2382595
Payment Type: Finance

Page: 2 of 6
Work Performed By: Derek Barnhart

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 567		E00567X317080	264172PLP	

Service Reminders:
 Replaced one at a time to maintain proper position
 Reassembled

Parts / Misc Items:

PartNumber	Description	Quantity	Value	Taxed Ind
19H3877	CAP SCREW	4.00	\$14.60	N
AFH204000	Ball Bearing	4.00	\$134.00	N

Miscellaneous Charges:

Labor: [Redacted] **Sub-Total: \$616.05**

567/3351/CMP/R/10 Retail

CORRECTION:

04 RIGHT SIDE CAM FOLLOWER BEARING - Remove & Install

Removed gauge wheel and bracket on left-hand side
 Aligned cam bearing with hole in cam
 Replaced one at a time to maintain proper position
 Reassembled

Parts / Misc Items:

PartNumber	Description	Quantity	Value	Taxed Ind
19H3877	CAP SCREW	4.00	\$14.60	N
AFH204000	Ball Bearing	4.00	\$134.00	N

Miscellaneous Charges:


Labor: [Redacted] **Sub-Total: \$616.05**

567/3351/OPK/L/10 Retail

CORRECTION:

05 LEFT SIDE OUTER PICK UP BEARING - Remove & Install

Supported pickup
 Removed shield
 Raised idler arm to relieve chain tension
 Removed drive chain
 Removed sprocket

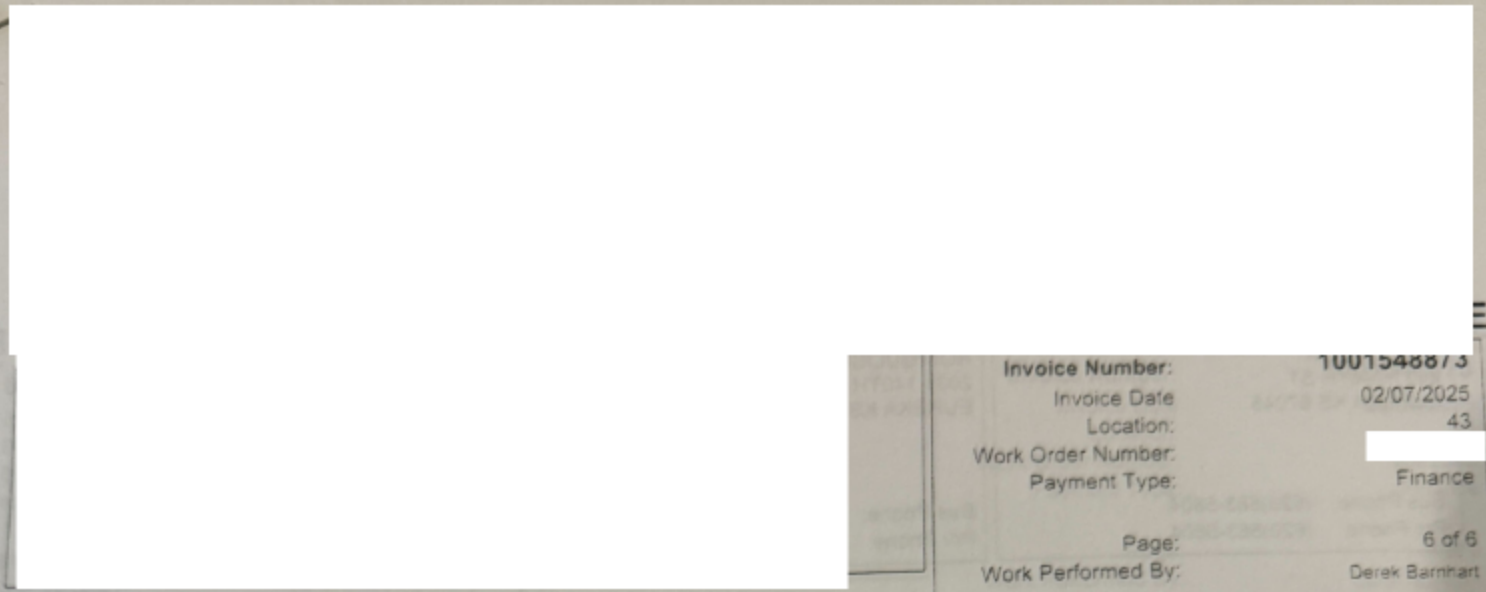

Invoice Number: 1001548873
Invoice Date: 02/07/2025
Location: 43
Work Order Number: [Redacted]
Payment Type: Finance
Page: 6 of 6
Work Performed By: Derek Barnhart

Make/Model: JOHN DEERE 567 **Meter:** **Serial Number:** E00567X317080 **EQ Id:** 264172PLP **Fleet No.:**

Service Reminders:					
X10543-8-6	Hose Fitting	1.00		\$13.18	N
X10543-8-8	Hose Fitting	1.00		\$15.65	N
X10643-6-6	Hose Fitting	2.00		\$19.54	N
X10643-8-8	Hose Fitting	1.00		\$12.50	N
X471TC-6-RL	BULK HOSE, 3/8"	149.00		\$117.71	N
X471TC-8-RL	1/2" Bulk Hyd Hose	107.00		\$132.68	N

Miscellaneous Charges:

Labor: \$539.37 **Parts:** \$411.38 **OL&M:** \$0.00 **Misc:** \$0.00 **Sub-Total:** \$950.75

Finance Information



Labor: [Redacted]
Parts: [Redacted]
OL&M: [Redacted]
Misc: [Redacted]
Sales Tax: [Redacted]
Total: \$5,649.66



Received by: Date:

Invoice No: 1001501927
 Date: 12/11/2024
 Page: 1 of 1
 Payment Type: Credit Card

Supplied Quantity	Back Order Quantity	Part Number	Part Description	Bin Loc	List Price	Net Price	Extended Price	Tax Ind
Eq ID: 129949PLP		Make: JOHN DEERE	Model: 567	PIN: E00567X317080		Hours: 9017		
5.00	0.00	COVER5	67" X 9000' COVER EDGE WRAP	CONTAINER	356.00	317.00	\$1,585.00	N

Invoice Notes:
 PRESEASON NET WRAP SALE.

INVOICE CONTAINS \$195.00 DISCOUNT

Customer PO No: NET WRAP SALE
 Tax Exempt No: 2021
 Salesperson: VANCE RALSTIN

Parts:
 Misc:
 Sales Tax:
 Deposit:
 Total: \$1,585.00

*** DOCUMENT COPY ***

Credit Card Information Merchant ID:

Terminal ID: 23 Client ID:

JOHN DEERE

Received by: Date:

Invoice Number: 10015488
Invoice Date: 02/07/20
Location:
Work Order Number: 23825
Payment Type: Finan

Page: 1 o
Work Performed By: Derek Barnh

Make/Model: JOHN DEERE 567
Meter:
Serial Number: E00567X317080
EQ Id: 264172PLP
Fleet No.:

Service Reminders:
PWR/9006/590 Retail

CORRECTION:
 01 Baler Inspection
 \$199 inspection with net wrap purchase

Parts / Misc Items:

PartNumber	Description	Quantity	Unit Net	Value	Taxed In
P5340132	PARTS PROMOTIONAL DISCOUNT	-1.00		-\$789.84	

Miscellaneous Charges:

Labor: [Redacted] **Sub-Total: \$199.00**

567/3105/OIL/53 Retail

CORRECTION:
 02 Gear Case Oil - Change
 Removed the slip clutch
 Removed drain plug and oil
 Installed drain plug
 Added oil
 Reassembled

Parts / Misc Items:

PartNumber	Description	Quantity	Unit Net	Value	Taxed In
TY6345	GL5 85W140 qt	2.00		\$22.94	

Miscellaneous Charges:

Labor: [Redacted] **Sub-Total: \$112.84**

567/3351/CMP/L/10 Retail

CORRECTION:
 03 LEFT SIDE CAM FOLLOWER BEARING - Remove & Install
 Removed gauge wheel and bracket on left-hand side
 Aligned cam bearing with hole in cam

SERVICE INVOICE

Invoice Number: 1001548873
Invoice Date: 02/07/2025
Location: 43
Work Order Number: 2382595
Payment Type: Finance
Page: 4 of 6
Work Performed By: Derek Barnhart

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 567		E00567X317080	264172PLP	

Service Reminders:
07 Spring Tooth - Remove & Install

Locked gate in open position.
Removed strippers as needed
Removed all spring teeth
Installed all spring teeth
Reinstalled strippers

Parts / Misc Items:

PartNumber	Description	Quantity	Unit Net	Value	Taxed Ind
A-AFH202304	Pickup Tooth Square Wire w/Hdw	14.00	18.76	\$262.64	N

Miscellaneous Charges:
Labor: [REDACTED] Sub-Total: \$1,891.54

567/7427/E/10 Retail
CORRECTION:
08 Rotor Stripper - Remove & Install
Locked valve
Removed top bolts
Loosened lower bolts
Removed stripper and cleaned as needed
Greased
Installed in reverse

Parts / Misc Items:

PartNumber	Description	Quantity	Unit Net	Value	Taxed Ind
A-HP106	Pin Fastener	1.00	7.56	\$7.56	N

Miscellaneous Charges:
Labor: [REDACTED] Sub-Total: \$142.40

567/7431/BTH/10 Retail
CORRECTION:
09 BALE DENSITY PRESSURE GAUGE - Remove & Install
Removed hose

Invoice Number: 1001548873
Invoice Date: 02/07/2025
Location: 43
Work Order Number: 2382595
Payment Type: Finance

Page: 5 of 6
Work Performed By: Derek Barnhart

Make/Model: JOHN DEERE 567
Meter: [REDACTED]
Serial Number: E00567X317080
EQ Id: 264172PLP
Fleet No: [REDACTED]

Service Reminders:
 Removed screws
 Removed and installed gauge
 Installed screws
 Attached hose

Parts / Misc Items:

PartNumber	Description	Quantity	Unit Net	Value	Taxed Ind
AE48077	Pressure Gauge	1.00	[REDACTED]	\$132.90	N
P37501	FREIGHT	1.00	[REDACTED]	\$20.80	N

Miscellaneous Charges:

Labor: [REDACTED] Sub-Total: \$243.60

567/6937/BSE/E/10 Retail

CORRECTION:

10 Belt Splice Pin - Remove & Install

Parts / Misc Items:

PartNumber	Description	Quantity	Unit Net	Value	Taxed Ind
E86147	PIN	8.00	[REDACTED]	\$3.04	N

Miscellaneous Charges:

Labor: [REDACTED] Sub-Total: \$302.73

ALL/TBD/01 Retail

CORRECTION:

11 Hydraulic Hoses - Remove & Install

Replaced several hydraulic hoses

Parts / Misc Items:

PartNumber	Description	Quantity	Unit Net	Value	Taxed Ind
E33415	COUPLING	1.00	[REDACTED]	\$10.53	N
T19898	Fitting	1.00	[REDACTED]	\$15.19	N
TY26453	Hose	240.00	[REDACTED]	\$74.40	N