## L4197

### 2002 Freightliner Repair Record

February 2012	Replaced ECM Replaced Crank Speed Sensor	Mileage: 822,800
August 2012	Replaced 4-core Radiator and Hoses	Mileage: 852,938
August 2012	Replaced Lower Coolant Tube from Radiator	
October 2012	Replaced Muffler	Mileage: 862,601
August 2013	Replaced Front Axle with Rebuilt and Alignment	Mileage: 898,700
September 2013	Replaced Fifth Wheel	Mileage: 904,387
November 2013	Replaced Alternator and Water Pump	
January 2014	Replaced Idler and Tensioner Assembly and Belts	Mileage: 923,275
July 2014	Replaced Brakes, Shoes and Drums	Mileage: 956,540
November 2014	Replaced Thermostats – Replaced Air Compressor and Air Governor – Replaced Lower U-joint on Steering Shaft – Replaced Air Dryer	Mileage: 983,357
May 2015	Replaced Both Front Glass	
December 2015	Replaced All 4 Batteries	Mileage: 1,045,508
January 2016	Replaced Fuel Priming Pump	
March 2016	Replaced Clutch Rod and Adjusted Clutch	
May 2016	Replaced Driver's Inside Door Panel Handle Replaced Heater Valve and Hose	
August 2016	Replaced Exhaust Elbow and Flex Tubing Below Muffler - Fixed Broken Exhaust Manifold bolt	Mileage: 1,070,388

Mileage on fuel usually 5.6 to 6.2 mpg. Has pulled grain trailer last 10 years. No cracked glass, no oil leaks on floor, parked inside every night. Changed oil every 10,000-12,000 miles. Will use  $\frac{1}{2}$  gallon on first 5,000 then  $\frac{1}{2}$  after that. No blow by on the breather tube.

Needs front-end alignment and overhead ran for valve adjustment. Has just been serviced with Mobil 15-40, new air filter, greased, clutch adjusted.

Owned and driven by a non-smoker. Cab is very nice.

### **BILL TO**

### SAC CREEK EXPRESS LLC

### **OWNER**

### SAC CREEK EXPRESS LLC

PAGE 1 OF 2

\*\*\* CASH \*\*\*

DATE	GUSTOMER ORDER NO.	DATE IN SERVICE	ENGINE MODEL	PUMP NO.	EQUIPM	ENT MAKE
22-FEB-2012	RANDY	15-MAY-2001	ISX1-450 ST2		FREIG	HTLINER
CUSTOMER NO.	SHIP VIA	FAIL DATE	ENGINE SERIAL NO.	CPL NO.	EQUIPM	ENT MODEL
386406		21-FEB-2012	14018336	CPL804600		FLD120
RÉF. NO.	<b>EALESPERSON</b>	PARTS DISP.	MILEAGE/HOURS	PUMP CODE		IIT NO.
23886	500145		822800		WI	HITE 2001
ORDERED ORDERED	SHIPPED NUMBER	рваскичной	PRODUCT CODE		UNIT PRICE	AMOUNT
OSN/MSN/VIN	2PJ64112					
COMPLAINT	SYMPTOMS: LOW POWER					
	<del>-</del>					
CAUSE	BATTERY CONNEC 4 CHARGE AIR CLA ELECTRONIC CRAI LOCATION N/A.	TROL MODULE FAILED, LEFT. TIONS DIRTY AND CORRODEI MPS LEAK AIR, FRONT. NKSHAFT SPEED SENSOR SHO	ORTED (ELECTRICAL ONL			
CORRECTION	INSITE - USE DURII	TIME - OPEN AND CLOSE REPA NG TROUBLESHOOTING ISX E LER - PRESSURE TEST TIGHTE	NGINES			
	CHECK, CLEAN, AN ELECTRONIC CON	ACTIVE FAULT CODES 121, 16 ID TIGHTEN THE BATTERY CO TROL MODULE (ECM) - REMON TROL MODULE (ECM) CALIBRA NSOR - REPLACE	INNECTIONS FOR FAULT 4 /E AND INSTALL:	141		
COVERAGE	CUSTOMER BILLAR	SLE.				
REMARK	RANDY OK'D RECO	ON ECM FOR \$2400, TH 2-21 @	12:30.			
1	SHOP CAL NO PASSWORD	HOOK-UP WITH ECA	I WITH CAL (NO PASSWO	RÖ)		275.0
1	1 3681405RX	ECM, CM570	DRC		1,597.00	1,597.00
1	1 3681405D	ECM, CELECT	CLEAN		781.25	781.25
-1	-1 3681405D	ECM, CELECT	DIRTY		781.25 -	781.25
-	1 3926704	CLAMP, SPRING HOSE	CECO		14.89	14.89

We are conforming with the Fair Labor Standards Act of 1938 as amended.

This invoice is subject to the terms and conditions of sale, including limitations on warranties, detailed on the reverse side of this form. Customer acknowledges the existence of the terms and conditions and confirms they have been read and fully understood.

AUTHORIZED BY (print name)	SIGNATURE	DATE

## BILL TO

## SAC CREEK EXPRESS LLC

## <u>OWNER</u>


## SAC CREEK EXPRESS LLC

PAGE 2 OF 2

\*\*\* CASH \*\*\*

MAKE	EQUIPME	PUMP NO.	ENGINE MODEL	DATE IN SERVICE	CUSTOMER ORDER NO.	DATE
INER	FREIGH		ISX1-450 ST2	15-MAY-2001	RANDY	22-FEB-2012
	EQUIPME	CPL NO.	ENGINE SERIAL NO.	FAIL DATE	SHIP VIA	CUSTOMER NO.
.D120		CPL804600	14018336	21-FEB-2012		386406
ō.	UNI	PUMP CODE	MILEAGE/HOURS	PARTS DISP.	SALESPERSON	REF. NO.
2001	WH		822800		500145	23886
10UNT	UNITABLE		ekanue i cont	DESCRIPTION	GUANTITY PART SHIPPED NUMBER	ODANTITY BACK ORDERED ORDERED
					2PJ64112	OSN/MSN/VIN
32.03	32.03		CECO	SENSOR, POSITION	1 4921599	1 .
343.92			Š:	PART		
0.00 CF			S COVERAGE CREDIT:	PART		
	1,643.92		L PARTS:	TOTA		
0.00	-		HARGE TOTAL:		•	
14.40			R:	LABO		
0.00 CF			R COVERAGE CREDIT:	- LABO		
	614.40		L LABOR:			
36.86			•	MISC		
0.00 CF			COVERAGE CREDIT:	MISC		
	36.86		L MISC.:			
36.86			SUPPLIES			
25.21		LOCAL	<b></b>	51101		
92.44		STATE				

We are conforming with the Fair Labor Standards Act of 1938 as amended.		
This invoice is subject to the terms and conditions of sale, including limitations on warranties, detailed on the reverse side of this form. Customer acknowledges the existence of the terms and conditions and confirms they have been read and fully understood.	SUB TOTAL: TOTAL TAX:	2,570.18 117.65
	TOTAL AMOUNT: US \$	2,687.83
AUTHORIZED BY (print name) SIGNATURE	DATE	- Marin

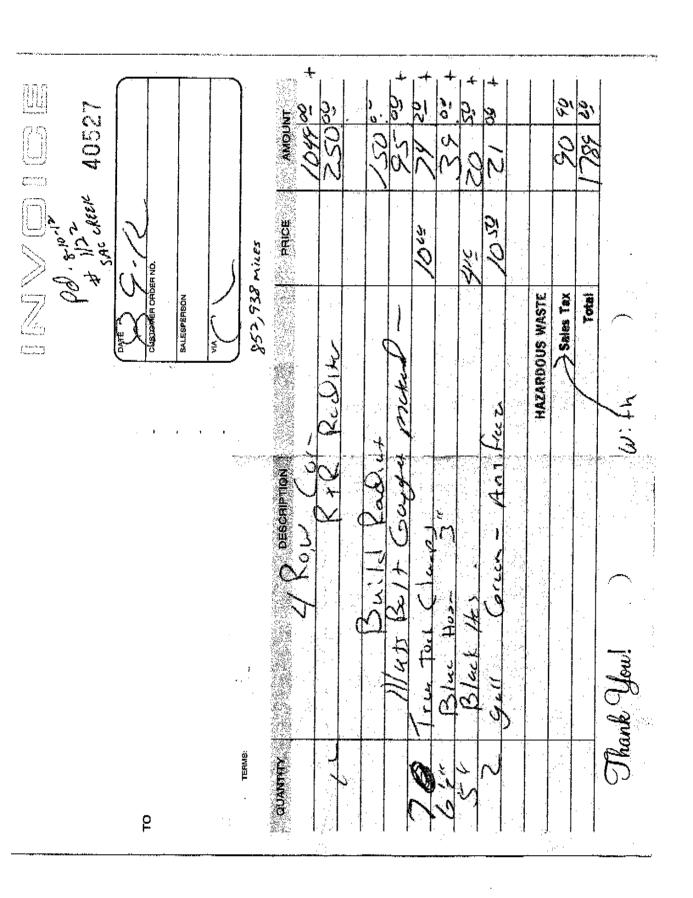

Date	Invoice #	
8/8/2012	19421	

		P.O. No.	Project	Vehicle & Mileage
				truck
Quantity	Description	, ,,	Rate	Amount
1	Tube Coolant A05-18825-001		31.	3.15
ank you for your busin	255			-
and you not your ousing			Subtotal	\$313.15
			Sales Tax (5.	<b>5%)</b> \$0.00
			Total	\$313.15
		Ī	Payments/Cre	dits \$0.00
			Balance Due	\$313.15

Date	Invoice #
10/16/2012	20340

4		P.O. No.	Project V	ehicle & Mileage
		White Freightliner		
	Descr	íntion	Rate	Amount
Queentity	1 Muffler EMM10682 2 5/16" Nut 4152-030B 2 5/16" Lock Washer 8076-030B 2 5/16"X1 3/4" Bolt 301-589-B 2 Exhaust Band EC50PLA 2 Exhaust Clamp EC50FBZ 1 Screw 3103-199B 1 Nut 4150-011B 1 1/4" Nut 4152-029B 1 1/4" Lock Washer 8076-029B 1 1/4"X3/4" Bolt 301-540-B 2 Washer BW-43 5/16" Fender Washers BW45 Shop Supplies Remove and Replace muffler, traswitch chaust pipe and replace class	unsfer sheild to new muffler ,	111.14 0.11 0.05 0.22 13.88 10.95 0.08 0.08 0.06 0.03 0.38 0.36 0.28 2.00 136.00	111.14 0.22 0.10 0.44 27.76 21.90 0.08 0.06 0.03 1.52 0.72 1.12 2.00
<u> </u>			Subtotal	\$303.1
<u></u>			Sales Tax (5.5%	<b>6)</b> \$0.0
<u>.                                    </u>			Total	\$303.1
			Payments/Cred	i <b>ts</b> \$-45.0
			Balance Due	\$258.

20

# Invoice

Date	Invoice #
7-6/26/2013	210059

REER

ſ	P.O. No.	Project	Vehicle & Mileage
904,387 10165			Semi Truck
Pagarinian		Rate	Amount
Quantity    Seal AS2729   Fifth Wheel Plate JSK37HJST     Bushing XB001-2   Hardware Kit		996	9.05 69.05T 6.88 996.88T 3.00 46.00T 0.58 20.58T
Thank you for your business.		Subtotal	\$1,132.
		Sales Tax	<b>(5.5%)</b> \$62.
		Total	\$1,194
_		Payments/	Credits \$0
		Balance Du	µe \$1,194

1FLJAHB6X2FJ		FREIGHTLINER		08/08/2013
CENES L'EVEE L'A	NICOLO CONTROL DE CONTROL DE LA CONTROL DE LA CONTROL DE CONTROL DE CONTROL DE CONTROL DE CONTROL DE CONTROL D	t Phone: NV/MNHS/NY/ACOS		poeta estensigno.
		A 1289		
		THIL		
	, fa			
	Parts charges			1772.63
	Labor charges. Supplies and cl			855.00 50.00
	Sublet repair c		*** ** ***	115.63 2773.46
	Plus applicable	sales tax		7 <b>68 . 45</b>
	AIMER OF WARRANTIES Pavelka, Inc. dba Pavelka Truck & Trai	PLEASE PAY THIS AMO	<del>&lt;</del> TAUC	. 19 <b>. 1885</b>

V ...

, J

UJAHI	3GX2PJ6411	2002 FREIGHTLIN		08/08/201
INE :	уре месн	REPAIR DESCRIPTION MADARIES AND	CONTROL CONTROL CONTROL	ET ETY ENERGY
	C PLH SLF PLH PLH	C REPLACE STEERING AXLE F TOOK NEW STEER AXLE APART OLD AXLE OUT, PUT IN NEW. HANGER PINS AND BUSHINGS. SHACKLES LOOSE & RE-TIGHT REPLACED TIE ROD ENDS. L LBR-TIE ROD ENDS *P TIE ROD END R230068*576 *P TIE ROD END R230069*576 Subtotal this section	TOOK	427.50 41.15 41.15 507.84
	SLP AAL AAL AAL AAL	C REPLACE KING FINS F PUT NEW KING FINS IN AND TOGETHER. S R & R BUSHINGS L LBR-KING PINS P SEAL 95044 P GASKET CP450755 P 1/8 X 1-1/2 COTTER PIN 45078 P HOSE H24508-250R P FITTING 080-608	#UT BACK 0.0 5.3 2.00 041.53 2.00 01.17 3.00 00.04 4.00 07.45 4.00	29.9
ARepair Pimplied fitness Repair	aller, Bernard Pav , expressly discl d. including any for a particular	IER OF WARRANTIES  PLEASE  PROBLEM  PROBLEM  PROBLEM  PROBLEM  PROBLEM  PLEASE  PLEASE	PAY THIS AMOUNT →	

SUJAHE	16X2PJ641	12	2002 FREI	MARONAL N. SEGUINERA EN ESECUENTRUSER EL EL EN L. LEN L. L. EN L.		08/08/20
ine 17	YPE MEGE		Contact Phy REPOINDESCRIPTONY (PA			Extraolen
	AAL	P	1/2 X 3/8 MALE CONNI	ECTOR	2.00	7.2
	AAL		440221-131280 SMALL HUB PLUG	26.86	2.00	<b>6.5</b>
			359-5915	<b>33.27</b>		
	PLH	*	USED AXLE		1.00	793.00
Talay ∏a	PLH	*5	FF-961*576 KNUCKLE PIN KIT	<b>a793.0</b> 0	1.00	217.4
			TDA-201315*576	<b>8217.</b> 69		
	PLH	*5	U-BOLT		2.00	58.7
	PLH	*	11-09684-090*576 WASHER	926.88	4.00	20.40
			23-00114-005*576	25.10		
	PLH	*5	HEX MUT		4.00	46.60
	PLH	*	E3-00461-007*576 U BOLT	<b>341.45</b>	2.00	53.76
			11-09624-090#576	<b>8</b> 26.88		
	PLH	₩₽	WASHER		4.00	20,40
	FLH	*p	23-09114-005*57& HEX NUT	25.10	4.00	46.60
			23-00461-007*576	211.65		
	PLH		75-90W BREASE BY THE		5.00	37.25
			Subtotal this mectic	<b>97.45</b>		1995.8
3	C FLH		ALIGN.			
	RAB	4 4 4 4	ALIGN TRUCK		0.0	0.00
	PLH	F	SETUP/INSPECT		1.00	35.00
			AA1	935,00		
- 14 <u>1</u> 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1						
			WARRANTIES c. dba Pavelka Truck & Trailer	PLEASE PAY THIS AMOUNT	<b>&gt;</b>	

LJAHEG	X2PJ6411	2 2002 FREIGHTLINER Contact Phone:		08/08/501
INEX SASE	MEC)	ETPARAPESCHI DER MEDARA AND ABOUT SECURE SEC	COMMUNICAL	A CHEST ENSUITS
	PLH	P ADJUST TOE	1.00	25.00
	PLH	AA2 025.00 P SECOND AXLE	1.00	35.00
	FLH	AB1 095.00 F THIRD AXLE	1.00	35.00
	FLH	AC1 095.00 F ADJUST THIRD AXLE	1.00	25.00
	PLH	ACE DES.OU P SHOP MATERIALS	1,00	9.30
	PLH	SHOP SUPP 39.30 P.5 DEGREE WEDGE	1.00	26.63
	PLH	264-4145 026.63 P 1/8 SPACER	2.00	8.86
	PLH	254-4272 94.41 F 176 SPACER	2.00	5.00
		264-4271 04.00 Subtotal this section	# . <b>#</b>	207.75
4 *C	PLH	C CHECK FOR DASH VALVE FOR LEAKING		
		F AIR UP TRUCK, CHECKED DASH VALVE, DID NOT LEAK AT THIS TIME.		
	SLP	L LBR-CK DASH VALVE Subtotal this section	0.4	30.00 30.00
		THANK YOU FOR YOUR BUSINESSILL		
	DISCLAULE			
he seller, l Repair, exp	Bernard Pavel	ER OF WARRANTIES PLEASE PAY THIS AMOUNT IKA, Inc. dba Pavelka Truck & Trailer		Medical State of the State of t

Date	Invoice #
11/21/2013	211954

		P.O. No.	Project	Vehicle & Mileage
				Freightliner Truck
Quantity	Description		Rate	Amount
	Alternator 110-555JHO 12" Battery Switch Cable 6Gauge 774-50 Water Pump 4025097RX Shop Supplies Remove and Replace alternator and fix per		268.12 5.71 409.84 3.00 91.00	268.12 5.71 409.84 3.00 91.00
Thank you for your bus	iness.		Subtotal	\$777.6
			Sales Tax (5.5%	so.oc
			Total	\$777.6
			Payments/Credit	<b>ts</b> \$0.00
			Balance Due	\$777.67

Date	Invoice #
1/16/2014	212411

		Vehi	cle & Mileage
	923,275 MILES	Freig	htliner F1D120
Quantity	Description	Rate	Amount
	Scrp Behr 25-060685 Oil Bath Seal 380003A Tube: CPR Water 4059312CUM Flexible Hose 3682978CUM Idler Pulley 4026886NXCUM Tensioner 89421DYC. Tensioner 89422DYC Polar Anti-freeze gallon 3M Brake Parts Cleaner Non-Clor 08880 Shop Supplies  Remove and Replace right rear wheel seal, adjust back brakes Adjust clutch and clutch brake Remove and Replace water pump, Replace idler and tension pulleys all dry Remove water line from air compressor and Install up dated lines	35.62 56.99 120.70 124.39 198.15 188.09 188.85 11.77 5.00 5.00 175.00 68.00 315.00	35.62 56.99 120.70 124.39 198.15 188.09 188.85 11.77 15.00 5.00 175.00 68.00 315.00
Thank you for your bu	siness.	Subtotal	\$1,578.56
		Sales Tax (5.5%)	\$0.00
		Total	\$1,578.56
		Payments/Credits	\$0.00
		Balance Due	\$1,578.5

Date	Invoice #
7/2/2014	214157

			Vehicle & Mileage
	9 54, 540 MILES		Randy's Truck
Quantity	Description	Rate	Amount
1	Brake Drum 3600AX Kit-Reman Brak RK4707QP20 Oil Bath Seal 380003A Brown Wheels 07480 3M Brake Parts Cleaner Non- Clor 08880 Shop Supplies After wheels are off for tires removed and replaced all brake sho and spring kits. Replaced one wheel seal and all 4 drums.	183.0 64.2 65.1 1.6 5.4 4.0 res 393.6	9 257.1 4 65.1 7 1.6 5 10.9 0 4.0
fhank you for your busin	ess.	Subtotal	\$1,464.6
		Sales Tax (5.5	%) \$0.00
		Total	\$1,464.6
		Payments/Cred	lits \$0.0
		Balance Due	\$1,464.6

SAC CREEK EXPRESS LLC

Page 1 C.O.D. 00006

Serial No. Description Stock No. Fleet No. License

1FUJAHBGX2PJ64112 2002 FREIGHTLINER

Job No.	Miles/Hours In	Character and Carlot All			
300110.	Miles/Hours In	Purchase Order No.	Labor Rates	Invoice Date	P Alumber
13313	983357			11/06/2014	65284
		· · · · · · · · · · · · · · · · · · ·		17/00/2014	03284

Line	Туре	Mech	Repair Description w/ Parts And Labor	Quantity	Unit	Extension
1	С	PLH	C CHECK FOR WATER LEAKING ON LEFT	T		
			C FRONT SIDE OF HEAD			1
			F CHECK OVER FOUND WATGER LEAK BY			i
		!	THERMOSTAT HOUSING, REMOVE COOLANT	1		
	-		AND THERMOSTAT HOUSING, FOUND GASKET	1		
		1	SEAL BROKEN, CLEAN UP SURFACES AND			ŀ
- 1			REINSTALLED HOUSING WITH NEW	1		
		}	THERMOSTATS.	1		
]		JJS	LBR-THERMOSTATS	2.7		216.00
. 1	- }	ļ	THERMOSTAT	1.00	48.93	216.00
	Ī	ĺ	2882757 @ 48.93	1.00	40.50	48.93
}	]	Į.	THERMOSTAT SEAL	2.00	17.95	05.00
ì	1	İ	3084879 @ 17.95	2.00	17.95	35.90
- 1		ļ	THERM HOUSING COVER GSK	1.00	23.68	00.00
Ì	i		3680602 @ 23.68	7.00	20.00	23.68
			THERMOSTAT HOUSING GSK	1.00	16.58	16.58
Ì	i		3680601 @ 16.58	1	10.56	10.56
- 1		[1	THERMOSTAT	1.00	48.93	48.93
i			4318947 @ 48.93	1	70.00	40.35
	i i	11	PELEMENT	1.00	15.12	15.12
1		1	1699956C1 @ 15.12	1	10.12	10.12
ì	- 1		Subtotal this section	1		405.14
:	*C	PLH (	REPLACE AIR COMPRESSOR	i i	J	700.17
1	1	11	REMOVED AND REPLACED AIR COMPRESSOR	]	1	
- 1	ì		AND GOVERNOR, TIMED COMPRESSOR	1 1	İ	
	'		DURING INSTALLATION.	<b>!</b>		
		JJS I		4.8		384.00
- 1		F		1.00	7.16	7.16
- 1	ļ		3903475 @ 7.16			7710
- 1	ĺ	F		1.00	5.79	5.79
1			3936876 @ 5.79		<u>-</u>	U+1 U
	n=n=-	F	GASKET	1.00	6.80	6.80
				TOTAL		st Page

Date Offered Back

Disclaimer of Warranties

The seller, Bernard Pavelka, Inc. dba Pavelka Truck & Trailer Repair, expressly disclaims all warranties, either express or implied including any implied warranty of merchantability or fitness for a particular purpose and Pavelka Truck & Trailer Repair neither assume for it any liability in connection with the sale of the parts and/or accessories. Not necessarily Navistar approved parts.

#### SAC CREEK EXPRESS LLC

Page 2 Payment Type C.O.D. Customer Account 00006

Serial No. Description Stock No. Fleet No. License

1FUJAHBGX2PJ64112 2002 FREIGHTLINER

2126.82

Job No. 3515	Miles/Hours In	Purchase Order No.	Labor Rates	Invoice Date 11/06/2014	R.O. Number 65284
-7-7-1-0	30000	W-1117 W			

Line	Туре	Mech	Repair Description w/ Parts And Labor	Quantity	Unit	Extension
Line 3	Type *C	Mech PPPPPCCFL	3557141C1	2.00 1.00 1.00 2.00 1.00	0.23 28.36 39.12 4.26 1122.00	0.46 28.36 39.12 8.52 1122.00 1602.21 56.00 24.11 80.11
			Parts charges			1431.46 656.00 39.36 2126.82 0.00

**Date Offered Back** 

TOTAL

Disclaimer of Warranties

The seller, Bernard Pavelka, Inc. dba Pavelka Truck & Trailer Repair, expressly disclaims all warranties, either express or implied including any implied warranty of merchantability or fitness for a particular purpose and Pavelka Truck & Trailer Repair neither assume for it any liability in connection with the sale of the parts and/or accessories. Not necessarily Navistar approved parts.

DATE RECEIVED BY

TERMS: 1FUJAHBGX2PJ64112 SAC CREEK Serial No. 2002 FREIGHTLINER Description Payment Type Stock No. C.O.D. Fleet No. Customer Account # License 00006 R.O. Number 65296 Invoice Date 11/07/2014 Job No. 3527 Miles/Hours In Purchase Order No. Labor Rates 983362 Unit Extension Repair Description w/ Parts And Labor Quantity Line Туре Mech CHECK DRIER FOR LEAKING PLH 1 С CHECK FOUND PURGE VALVE LEAKING. RELACE DRIER UNIT. 40.00 0.5 JJS LBR-DRIER 1.00 377.57 377.57 AIR DRIER R955205 @ 377.57 417.57 Subtotal this section .... THANK YOU FOR YOUR BUSINESS!!! 377.57 Parts charges..... 40.00 Labor charges..... 2.40 Supplies and cleaners......
TOTAL CHARGES..... 419.97 0.00 Plus applicable sales tax..... 419.97 TOTAL Date Offered Back Disclaimer of Warranties The seller, Bernard Pavelka, Inc. dba Pavelka Truck & Trailer Repair, expressly disclaims all warranties, either express or implied

including any implied warranty of merchantability or fitness for a particular purpose and Pavelka Truck & Trailer Repair neither assume

for it any liability in connection with the sale of the parts and/or accessories. Not necessarily Navistar approved parts.

DATE

RECEIVED BY

		<b>ទ្ធំ</b> □			1000	- Principals	- Millia soli	wow lie	midseb.	<b>Vienority</b>	а Адамок <u>т</u>	ow tant	Marian o	i ed bru	ijo og Ari	CHOMING	orti gran tro	rod bole	fictory o	eft of ga	récien m	न्यासम्बद्धाः स्टब्स्य	boliali er perioem		·	**************************************	
065335	#4. GB	CALLMENTED NO T YES SERVICE						-											8	8		7. T.		T. 18 16		8	× .
<b>=</b>	(GISHNOW)	\o	0			M	22			2.0								Ý	X	120					Vas la del	168	0
	æ	PSCRIPTE	LUBRICATE	TRANS	_=	17										di di di di di di di di di di di di di d			S N		PAINT HANT	BODY MAT.	TOWING	STORAGE	Suemora	TAX TOTAL	J. C.
:	HECEIVED:	\ <i>J</i> \	CHANGE	OIE PLUSH		8												ME WILL						ioss of	omey to		
	2146				4/17	LOZ.	9									demonstration of the second	a james a sept of the	D. A CHAB	D WORK					rsbeft. er salse	one de la dice. Orache est		X 421 341
					P.	PH NUMBER	Ly					The state of the s						MTHORIZE	COMPLETE						AND PROPERTY.		
		BAS	1		BGK.		3				,141 1							NA IS NOT	MATINITY			1		<b>8</b> in 1	1 2000 1		
				五	TAKBOX		7			777		er en en en en en en en en en en en en en		C.w.w.su	seconomica seconomica		inar <b>p</b> ont	OMPLETIC	MBLY OR	**************************************	ers by				ay B) Co		
		4	B	18 g	逐	Onside	イグレア		* Contraction									IF REPAIR COMMENCEMENT IS AUTHORIZED BUT COMPLETION IS NOT AUTHORIZED. A CHARBGE WILLS BE IMPOSED FOR DIS ACHIONICS.	LY, HEASS			44.0	The state of the s		i od esigne (ng.		
		1	27	()	INTER .	Han-	7				To the last	Party Care of Services			-		CHARGE	S AUTHOR	appage Ma			e fedelity					
		M		1	13		13		- Indiana			-					MENTAL	NCEMENT SEPECE				and a short	inder year	LE COUNTY	outher filter underegate often egency teg		
		É	3		13	23	<b>X</b> _				•	in the same		49			ENVIRONMENTAL CHARGE	IR COMME				authority			of account		No. of the
	5 8	A STATE OF THE STA	Ĭ	Z	3	37.		000		3781					i Example			## <u></u>				Tale	Miles dans vol. 10 miles dans da 11 miles dans dans dans dans dans dans dans dan		fee and	×	
3			-			-				-				-	- :						-   -						
UMT PRICE	95-24					1									-												
<b>3</b> 5	a and a	2000 W	eraki Katika 14		ien .				- 15E						- 1												·,
																							1			*	
PART NUMBER AND DESCRIPTION																		: '-4									のと変数と
	12				*																	AUDITIONAL MATERIAL PARTICION	4	White talking		TOTAL SUBLET REPAIRS	
TOTAL STATE OF THE PARTY OF THE					16 J	1450													e.				418	Hans			
						9				W												Olividoy	TOTAL PARTS			8	
16					1/61					300								1 (187)								Ē	
ZELLIWANIO)				7							\$40.0 \$40.0 \$40.0		1										문공		7		
V& L			NE 25E		1 1			4	h de la companya de l	1	ноо е	O TVÁNO	C 696,43										SENICE	-			4

na	П	Δ	•

#### 12/8/2015 11:36 AM

Invoice #1837

1,045,508 miles

SAC. CREEK EXPRESS

RANDY REISS

WILCOX NE 68982

Created: 12/8/2015 11:32:03 AM Complete: 12/8/2015 11:35:46 AM

Invoiced : 12/8/2015 11:35:46 AM

Srv Writer: BK

	4110C1 . D31	Reference	Description	Condition	Unit Price	Price
Qty	Code/Tech* JG*	Kelelelice	Battery - Automotive Commercial		\$119.78	\$4 <del>79.12</del>
4	36		Core Charge		\$27.00	\$108.00
4			Core Credit		(\$27.00)	(\$108.00)
•	JG*		MISC LABOR			\$34.00
	REPLACE BA	ATTERIES AND C	HECK CHARGING , RANDYS TRUCK			
			Labor			\$34.00
	•		Parts			\$479.12
			Sublet/Misc.	***************************************		\$0.00
			Shop Supplies			\$2.14
						\$0.00
		4	Charges	Tax @ \$481.26 * 5.5000%		\$26.47
			Sales Tax	Total Due	:	\$541.73

Tech Certification #

JG

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or Inspection. An express garagekeeper's lien is hereby acknowledged on above vehicle to secure the amount or repairs thereto. 24 Month or 24,000 Mile Warranty On Repairs.

Customer Signature	
Customer Signature	

3/31	11-21	116	4 - 4	

page 1

\$4.28

\$0.00

\$2.26

<del>\$186.23</del>

invoice #2548

SAC. CREEK EXPRESS

RANDY REISS WILCOX NE 68982

Vehicle : 2002 FREIGHTLINER FLD120

Created : 3/11/2016 4:12:20 PM Complete: 3/30/2016 4:15:33 PM

Invoiced : 3/30/2016 4:15:33 PM

Sry Writer: 8K

Odometer In : 0 Odometer Out: 0

Tax @ \$41.17 \* 5.5000%

Total Due

Otto	Code/Tech*	Deference	<u> </u>			
wity.		Reference	Description	Condition	Unit Price	Price
1	BJ*		SEALBEAM H4656	***************************************	\$15.57	\$15.57
3	BJ*		CONNECTOR 725114		\$1.74	\$5.22
1	BJ*		ROD END WITH STUD		\$16.10	\$16,10
	BJ*	DAGU. (AL) (E	MISC LABOR			\$142.80
	CHECK OUT	DASH VALVE , RI DEND ADJUST C	EPLACE LEFT HEAD LIGHT, REPL LUTCH AND FREE TRAVEL	ACE ANTI FREEZE FILTER FIXED REAF	R TAILLIGHT FIX	
	CHECK OUT	DASH VALVE , RI DEND ADJUST C	EPLACE LEFT HEAD LIGHT, REPL LUTCH AND FREE TRAVEL Labor	ACE ANTI FREEZE FILTER FIXED REAF		\$142.80 KED \$142.80
	CHECK OUT	DASH VALVE , RI DEND ADJUST C	EPLACE LEFT HEAD LIGHT, REPL LUTCH AND FREE TRAVEL	1 11 1111111111111111111111111111111111	***-	KED

Shop Supplies

Charges

Sales Tax

Tech Certification #

> I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control. I hereby grant you and/or your employees permission to operate the vehicle herein described on sieces, highways or elsewhere for the purpose of testing and/or trispection. An express gata attempts size is hereby acknowledged on above vehicle to secure the amount or repairs \*\*\*\*\* 24 Marks 24 000 Mile Warranty On Repairs.

#### **#12/2016** 10:17 AM

page 1

Invoice #3198

SAC. CREEK EXPRESS

RANDY REISS WILCOX NE 68982

: 2002 FREIGHTLINER FLD120

5/12/2016 10:08:51 AM

5/12/2016 10:17:08 AM 5/12/2016 10:17:08 AM Odometer In : 0 Odometer Out : 0

Controllectr	Reference	Description	Condition	Unit Price	Price
	Walter and Committee of the Committee of	SILL DOOR ASSEMBLY		\$230.01	\$230.01
		AR CVI ARSING IA	r gargaga garan karan da karan da karan da karan da karan da karan da karan da karan da karan da karan da kara	\$50.75	\$50.75
		CALIN CATICAL RIVERS		\$23.77	\$23.77
		MANUFACTURE AND ASSESSMENT OF THE PARTY OF T		\$145.32	\$145.32
		THE STATE OF THE SECOND		\$0.88	\$2.64
	i e de la companya de la companya de la companya de la companya de la companya de la companya de la companya d	AND RESIDENCE AND SET THE	HOOT	\$1.14	\$0.29
				\$0.09	\$0.09
			(a the global)	\$0.08	\$0.08
portion and the				\$0.30	\$0.90
		Market Commercial Comm	tara barang barang dalam dalam dalam dalam dalam dalam dalam dalam dalam dalam dalam dalam dalam dalam dalam d		\$84.00
SESONES EN MARCH	and ES Supplement of the acceptance	and the second second second second second second second second second second second second second second second	HED ARM REST. REPLACED CAB	CH TCD	
4 (A) (A) (A) (A) (A) (A) (A) (A) (A) (A)				FILTER.	
		Control of the second s			\$126.00
0 a 10 20 30 20 30 30 30 30 30 30 30 30 30 30 30 30 30		Control of the second s	MIOR. REPLACED HEATER VALV		\$126.00
		Control of the second s			\$126.00
			MITOR. REPLACED HEATER VALV		\$126.00 \$58.80
			MITOR. REPLACED HEATER VALV		\$58.80
			MITOR. REPLACED HEATER VALV		\$58.80 \$268.80
			MITOR. REPLACED HEATER VALV		\$58.80 \$268.80 \$453.85
			MITOR. REPLACED HEATER VALV		\$58.80 \$268.80 \$453.85 \$0.00
			MITOR. REPLACED HEATER VALV		\$58.80 \$268.80 \$453.85 \$0.00 \$8.06
			MITOR. REPLACED HEATER VALV		\$58.80 \$268.80 \$453.85

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express garagekeeper's lien is hereby actionwedged on above vehicle to secure the amount or repairs thereto. 24 Month or 24,000 Mile Warranty On Repairs.

- P

#### STANZONS TEST ALI

page 1

Invoice #4734

SAC. CREEK EXPRESS

RANDY REISS

WILCOX NE 68982

2002 FREIGHTLINER FLD120

2 8/23/2016 11:02:48 AM Complete: 8/24/2016 11:07:15 AM

1,070,388 MILES

Odometer In : 0 Odometer Out : 0

Sry Writer: TG

Qty Code/Tech\* Reference Description Condition. Unit Price Price BJ\* 5 " EXHAUST ELBOW \$187.21 \$187,21 18 BJ\* EXHAUST PIPE 72 INCHES BY THE INCH F50300G \$0.95 \$17.10 BJ\* **EXHAUST GASKETS** \$6.60 \$13.20 BJ™ **SPACER 3679445CUM** \$10.46 \$41.84 BJ\* HEX SCREW 4965698CUM \$6.94 \$27.76 BJ\* **UBOLTS 7335757** \$12.12 \$12.12 2 BJ\* **CLAMP 7333225** \$19.15 \$38.30 MISC LABOR \$109.20 REPLACED REAR EXHAUST ELBOW AND FLEX TUBING AND REPLACED CLAMPS. MISC LABOR \$252.00 REMOVED BACK THIRD OF EXHAUST MAINFOLD. DRILL OUT BOLTS AND HELICOIL ONE HOLE. INSTALLED NEW BOLTS

D GAGRETS.			
,	Labor		\$361.20
	Parts		\$337.53
	Sublet/Misc.		\$0.00
Angle Jan.	Shop Supplies	***************************************	\$10.84
	Charges	***************************************	\$0.00
	Sales Tax	Tax @ \$348.37 * 5.5000%	\$19.16
		Total Due	\$728.73

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or Inspection. An express garagekeeper's lien is hereby acknowledged on above vehicle to secure the amount or repairs thereto. 24 Month or 24,000 Mile Warranty On Repairs.

Customer Signature	
--------------------	--

#### 12/30/2016 5:41 PM

page 1

Invoice #5800

Odometer In : 0

Odometer Out: 85426

SAC. CREEK EXPRESS

11931 727 RD. WILCOX NE 68982

Vehicle: 2002 FREIGHTLINER FLD120

Created : 12/30/2016 1:45:05 PM Complete : 12/30/2016 5:41:19 PM

Invoiced : 12/30/2016 5:41:19 PM

Srv Writer: BK

	V. / (C) / (C) /					
Qty	Code/Tech*	Reference	Description	Condition	Unit Price	Price
3	BJ*		3/4" NAPA POLLYLOOM BY THE FOOT737302		\$1.06	\$3.18
2	₿J*		HEAT SHRINK BUTT CONNECTOR 725115		\$1.38	\$2.76
2	BJ"		RED ROUND SIGNAL BULB 5040202R3		\$6.92	\$13.84
11	BJ*		15W40 BUCKET BY THE GALLON		\$9.65	\$106.15
	BJ"		MISC LABOR			\$67.20
	CHECKED O	VER WIRING FOR	TAIL LIGHTS REPLACED BOTH TAIL LIGHT BULBS, FIXED	PLUG ON TUR	N SIGNAL SWIT	гсн.
	BJ™		MISC LABOR			\$48.72
	REMOVED D	ECALS ON BOTH	DOORS.			
	BJ*		MISC LABOR			\$100.80
	REMOVED FO		ANED UP AND GREASED PISTON PUT BACK TOGETHER.	CHECKED CLUT	TCH ADJUSTME	ENT
	BJ*		LUBE, OIL, AND FILTER CHANGE			\$78.00
		. INSPECT AIR AN	SE WITH PREMIUM MOTOR OIL, REPLACE OIL FILTER. LU ID CABIN FILTER , TOP OFF ALL FLUID LEVELS AND APPL			OMER

Labor		\$294.72
Parts	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	\$125.93
Sublet/Misc.		\$0.00
Shop Supplies	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	\$8.84
Charges		\$0.00
Sales Tax	Tax @ \$134.77 * 5.5000%	\$7.41
	Total Due	\$436.90

Tech Certification #

ΒJ

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or Inspection. An express garagekeeper's lien is hereby acknowledged on above vehicle to secure the amount or repairs thereto. 24 Month or 24,000 Mile Warranty On Repairs.

Customer	Signature					