

Work Order: Priority:

4391

Due Date: Status:

Status Date:

Normal Closed

11/19/2019

Scheduling

Mechanic Name	Schedule Date	Work Complete?
Todd Williams	10/3/2019	₹
Vince DeLuca	10/21/2019	▼

Description: Vacuum Truck (CDL)

VIN#

Serial # 2FZMAZCV45AN70852

Foreman: Meter Reading:

Location:

Equipment ID: T-049

Hours: 3123 Odometer:

by Dustin Robbins on 11/6/2019 by

Last Hour Service (Lifetime): 3095

(3095)on 10/11/2019

Last Odometer Service (Lifetime):

SOLD

COX, E

on

Will not build air, elbow on rear of bed blown out Problem Description:

Located air leak(brake chamber) pinched line and caged brake so it could still be useable. Went to Mac for parts. Made patches and welded to elbow for a temporary fix. Instructed operator to order new as pipe is nearly

Heater not working-opened water valves, tested-passed

Driver door doesn't open from outside- disassembled door and replaced latch assembly. Tested-passed

Replaced LR brake chamber and clevis, adjusted brake and leak tested

Driver stated heater quit working. Tested and found temp door actuator failed. Wired door to hot air only and

ordered part

Truck started and died. Found coolant visible in reservoir but below sensor. Topped off coolant and started.

Labor Items:

Parts List:

Vork Code	Item Code	ST	OT	DT		Part Num	Name	UOM	Qty Used
Repair	Air Conditioning/ Heating System	2.50	0.00	0.00					
Repair	Brake System	4.00	0.00	0.00	)				
Repair	Cab / Body / Paint	2.50	0.00	0.00					
Repair	Cooling System	0.00	1.00	0.00	)				
Repair	Fabrication / Welding	2.00	0.00	0.00					
Repair	Inspections / DOT Inspections	3.00	0.00	0.00					

#### Cost Ledger:

Type	Ref Num	Description
Parts	33	RED MUNICIPAL & INDUSTRIAL EQU Ref: 13015
Parts	32	MHC KENWORTH
Parts	31	MIDWAY FORD Ref: X100613041:01
Parts	32	CUSTOM EQUIPMENT RENTAL LLC

Tuesday, February 04, 2020

1/2

Equipment360 - Work Order

Work Order: Priority:

5446

Normal

Due Date:

Status:

Status Date:

Closed 2/3/2020

Scheduling:

Work Complete? Schedule Date Mechanic Name 2/1/2020 V Mark Cole ~ Todd Williams 12/27/2019

Equipment ID: T-049

SOLD Location:

COX, E Foreman:

Description:

Vacuum Truck (CDL)

VIN# Serial #

2FZMAZCV45AN70852

UOM

Qty Used

Meter Reading:

Hours: 3208

on 1/15/2020

by Dustin Robbins

Odometer:

on

by

Last Hour Service (Lifetime): 3208

(3208)

on 12/20/2019 on

Last Odometer Service (Lifetime):

Problem Description:

Rear gate leaking-removed shims from wedge for pattern. Made more shims and installed. Filled tank to verify

Name

leaking stopped

Remove stickers and numbers

Labor Items:

Parts List:

Part Num

Work Code Item Code ST OT DT Cab / Body / Repair

Paint

1.00 0.00 0.00

Fabrication / Repair

Welding

3.00 0.00 0.00

Cost Ledger:

Type	Ref Num	Description

Reconciled Purchases:

	Part Num	Description	Invoice #	Ref#	Qty Used
--	----------	-------------	-----------	------	----------

Notes:

1/31/2020

Mark Cole

Remove stickers

Work Order: Priority:

1182 Normal

Due Date:

Status

Status Date:

Closed 1/31/2019

Scheduling:

Location:

Foreman:

Schedule Date Work Complete? Mechanic Name 1/31/2019 V Wyatt Gardner

Description:

Vacuum Truck (CDL)

VIN#

Serial #

2FZMAZCV45AN70852

Meter Reading:

Equipment ID: T-049

Hours: Odometer:

on

by by

Last Hour Service (Lifetime):

on (2736)

on 1/15/2019

Last Odometer Service (Lifetime):

SOLD

COX, E

on

Problem Description:

Air dryer needs replaced

Upper air valve for tank sticking

Replaced air dryer

Thawed and blew out lines on air valve

Labor Items:

Parts List:

Work Code Item Code ST OT DT

Part Num

Name

Qty Used

UOM

Qty Used

Repair

Brake System

Description

3.00 0.00 0.00

Invoice #

#### Cost Ledger:

Part Num

Туре	Ref Num	Description
Parts	39	MIDWAY FORD
Parts	39	MIDWAY FORD
Parts	39	CENTRAL POWER SYSTEMS & SERV

Ref#

Notes:

Work Order: Priority:

2721 Normal

Status:

Due Date:

Status Date:

Closed 6/6/2019

Scheduling:

Location:

Foreman:

Work Complete? Schedule Date Mechanic Name V 6/5/2019 Wyatt Gardner

Description:

Name

Vacuum Truck (CDL)

VIN#

Serial #

2FZMAZCV45AN70852

UOM

Qty Used

Equipment ID: T-049

Hours: 2880

on 6/4/2019

by Dustin Robbins

Meter Reading:

Odometer:

by

Last Hour Service (Lifetime): 2880

(2880)

on 5/24/2019

Last Odometer Service (Lifetime):

SOLD

COX, E

on

Problem Description:

Replaced blower motor resistor & pig tail

Located & sealed Freon leak

Vac'd down system checking leaks(none found)

Charged AC system

Labor Items;

Parts List:

Part Num

OT DT Item Code ST Work Code

Air

Conditioning/ Repair

6.00 0.00 0.00

Heating System

Cost Ledger:

Type	Ref Num	Description
Parts	31	MIDWAY FORD Ref: X100593537:01
Parts	31	MIDWAY FORD Ref: X100594865:01
Parts	31	MIDWAY FORD Ref: X100595445:01

Part Num Description Invoice #	Ref#	Qty Used

Notes:

V

Work Order: Priority:

2837

Normal

Due Date:

Status:

Closed 9/3/2019

Schedoling:

Location:

Foreman:

Work Complete? Mechanic Name Schedule Date Wyatt Gardner 6/13/2019

Description:

Vacuum Truck (CDL)

Status Date:

VIN#

Serial #

2FZMAZCV45AN70852

Meter Reading:

Equipment ID: T-049

Hours: 2992

on 8/19/2019

**Dustin Robbins** 

SOLD

COX, E

Odometer:

by

Last Hour Service (Lifetime):

(2898)

6/27/2019

Last Odometer Service (Lifetime):

on

Problem Description:

Needs to side door seals

2 end cap stops

1 upper air cannon air valve

AC compressor Ac dryer Orifice tube

Replaced ac compressor, dryer & orifice tube

Replaced all seals Topped off compressor oil

Checked for leaks

Replaced upper air cannon valve

Cleaned out front electric over air air valve

Replaced electric over air valve

Labor Items:

Work Code

Parts List:

Part Num

Name

**UOM** 

Qty Used

Repair

Repair

Air Conditioning/

Item Code

0 6.00 0.00

ST OT DT

Heating System

Electrical System 5.00 1.00 0.00

Cost Ledger:

Туре	Ref Num	Description	
Parts	32	AA WHEEL & TRUCK SUPPLY INC. Ref: 910268	
Parts	31	O'REILLY AUTO PARTS Ref: JUNE 2019	
Parts	31	O'REILLY AUTO PARTS Ref: JUNE 2019	
Parts	33	KEY EQUIPMENT & SUPPLY COMPANY Ref: 257101	

Work Order: Priority:

2837

Due Date:

Normal

Cost Ledger:

Description Ref Num Type O'REILLY AUTO PARTS Ref: JUNE 31

2019 Parts

Reconciled Purchases:

Qty Used Ref# Invoice # Description Part Num

Notes:

Work Order: Priority:

3638 Normal

Due Date:

Status:

Status Date:

Closed 8/8/2019

Scheduling:

Location:

Foreman:

Work Complete? Mechanic Name Schedule Date V 8/7/2019

Wyatt Gardner Equipment ID: T-049

Description: Vacuum Truck (CDL)

VIN#

Serial #

2FZMAZCV45AN70852

Meter Reading:

Hours: 2950

on 7/30/2019

by Dustin Robbins

Odometer:

SOLD

COX, E

by

Last Hour Service (Lifetime):

on 6/27/2019 (2898)

Last Odometer Service (Lifetime):

Problem Description: Welded new bracket on for tank shut off inside tank

Labor Items:

Parts List:

Item Code Work Code

ST OT DT

Part Num Name

Qty Used UOM

Repair

Fabrication / Welding

4.00 0.00 0.00

#### Cost Ledger:

Type	Ref Num	Description	
Parts	36	HANNA RUBBER COMPANY Ref: 1277372	
Parts	36	HANNA RUBBER COMPANY Ref: 1277372	

Part Num Description Invoice # Ref # Qty Used

Work Order: Priority:

3939 Normal

Due Date:

Status:

Closed

Status Date:

Scheduling:

Location:

Foreman:

Mechanic Name Wyatt Gardner

Schedule Date 9/3/2019

Work Complete? ~

9/3/2019

Equipment ID: T-049

SOLD COX, E Description:

Vacuum Truck (CDL)

VIN#

Serial #

2FZMAZCV45AN70852

Meter Reading:

Hours: 2992

on 8/19/2019

by Dustin Robbins

Name

Odometer:

on

by

Last Hour Service (Lifetime):

(2898)

on 6/27/2019

Last Odometer Service (Lifetime):

Problem Description: Installed new blower motor and resistor

Labor Items:

Parts List:

Work Code

Item Code ST OT DT Part Num

UOM

Qty Used

Repair

Electrical System 0.00 2.00 0.00

Cost Ledger:

Ref Num Description Type

Reconciled Purchases:

Qty Used Ref# Invoice # Description Part Num

Work Order: Priority:

3960

Due Date:

Normal

Status:

Closed

Scheduling:

Location:

Foreman:

Mechanic Name Wyatt Gardner

Work Complete? Schedule Date V 9/4/2019

Status Date:

9/4/2019

Equipment ID: T-049

SOLD COX. E Description:

Vacuum Truck (CDL)

VIN#

Serial #

2FZMAZCV45AN70852

Meter Reading:

Hours: 2992

on 8/19/2019

by Dustin Robbins

Name

Odometer:

on

by

Last Hour Service (Lifetime):

(2898)

on 6/27/2019

Last Odometer Service (Lifetime):

on

Problem Description: Repaired upper suction hose a mounting surface seal

Labor Items:

Work Code

Parts List:

Ground

OT DT ST Item Code

Part Num

UOM

Qty Used

Repair

Engaging /

2.00 0.00 0.00 Bucket / Shank /

Teeth / Cutting

Cost Ledger:

Description Ref Num Type

Reconciled Purchases:

Ref# Qty Used Invoice # Description Part Num

Work Order: Priority:

4208

Due Date:

Status Date:

Normal

Status:

Closed 9/26/2019

Scheduling:

Work Complete? Mechanic Name Schedule Date Wyatt Gardner 9/23/2019

~

Equipment ID: T-049

SOLD COX, E Description: VIN#

Vacuum Truck (CDL)

Serial #

2FZMAZCV45AN70852

Meter Reading:

Location:

Foreman:

Hours: 3059

on 9/23/2019

by Dustin Robbins

Odometer:

on

by

Last Hour Service (Lifetime):

on 6/27/2019 (2898)

Last Odometer Service (Lifetime):

on

Problem Description:

Left rear axle hub was leaking Pulled apart, cleaned up & resealed

Topped off rear axle lube

Labor Items:

Parts List:

Work Code

Item Code

OT DT ST

Part Num

Name

UOM

Qty Used

Repair

Differential

2.00 0.00 0.00

Cost Ledger:

Ref Num Type

Description

Reconciled Purchases:

Part Num

Description

Invoice #

Ref#

Qty Used

Notes:

Work Order:

4247 Priority:

Normal

Due Date:

Status Date:

Status:

Closed 10/2/2019

Scheduling:

Schedule Date Mechanic Name Work Complete? ~ Todd Williams 9/24/2019

Equipment ID: T-049

SOLD

Location: COX, E Foreman:

Serial #

Description:

Vacuum Truck (CDL)

VIN#

2FZMAZCV45AN70852

Meter Reading:

Hours: 3072

on 10/1/2019

**Dustin Robbins** 

Odometer:

on (3072)

by 10/1/2019

Last Hour Service (Lifetime): 3072 Last Odometer Service (Lifetime):

on

Problem Description:

Coolant leak inside cab-removed heater core cover and found heater core leaking. Ordered part from midway

(on hand). Closed water valves and re-installed cover

Invoice #

Description

Removed and replaced heater core. Leak tested and cleaned coolant from cab floor

\*found LR motor mount bolts loose and some,gone during pm service. Tightened the 3 loose bolts and ordered

the missing bolts\*

Labor Items:

Parts List:


Labor Items:								1-
Work Code	Item Code	ST	от	DT	Part Num	Name	UOM	Qty Used
Repair	Air Conditioning / Heating System	3.00	0.00	0.00				
Repair	Engine	1.00	0.00	0.00				

#### Cost Ledger:

Part Num

Туре	Ref Num	Description			
Parts	53	Ref: 3233588	RE & SERVICE CE RE & SERVICE CE		
Parts	53	Ref: 3233588			
Reconciled Pur	rehases:				
	Description	Invoice #	Ref#	Qty Used	

Notes:



#### SERVICE INVOICE: R110000090:01

DATE ARRIVED	DATE INVOICE	SALES TYPE	ADVISOR		TERMS	CUSTOMER RE	FERENCE
8/9/2018 7:23:26AM	8/22/2018	SDR	Kurz		NET30	T-04	)
YEAR MAKE	MODEL	VN	CUSTOMER UNIT #	ENGINE HOURS			
2011 INTERNATIONAL	PROSTAR	IHSCUSJROBJ333717	216	0		124HM2Y400689	172134

#### Sold Operations

ON-SITE MOBILE SERVICE JOB#1 00-02

CHECK AND ADVISE FOR LOSS OF FUEL PRIME ISSUES COMPLAINT

FUEL LINE LEAKING CAUSE

DROVE FOUT TO KISSICK SHOP, FOUND TRUCK BY THE SHOP, TRYED STARTING ENGINE AND WILL CORRECTION

NOT START. FOUND THAT THE FUEL LINE FROM THE FILTER HOUSING TO THE BLOCK WAS

LEAKING.

		Library		UNIT PRICE	EXTO PRICE
	GTY	ITEM	DESCRIPTION		
╟		LABOR 045-1002A	DIAGNOSTIC TIME		
⊩		LABOR I	TRAVEL TIME		
⊩		MILE	MILEAGE		8777.00
11_			D.		\$737.00

ENGINE - REPAIR JOB #2 02-01

ENGINE - REPLACING LEAKING FUEL LINE ON ENGINE COMPLAINT

FUEL LINE LEAKING V CAUSE

REPLACED THE FUEL LINE GOING FROM THE FILTER HOUSING TO THE BLOCK. REPRIMED THE FUEL CORRECTION

SYSTEM STARTED THE ENGINE. LET THE ENGINE RUN AND CHECK FOR LEAKS, NO LEAKS FOUND

AT THIS TIME. IMFORMED CUSTOMER UNIT WAS DONE DROVE BACK TO THE SHOP.

LABOR 102-6501E   LOW PRESSURE FUEL LINE R/R	aty	ITEM	DESCRIPTION	UNIT PRICE	EXTO PRICE
1 110D/DDE A4600702932 FUEL LINE KT	-		LOW PRESSURE FUEL LINE R/R		
	1				
5 1100/DDE N00/003010102 PRE-10/001102	5	110D/DDE N007603016102	RING,GENERL		\$381.86
		perations Totals	Pa		\$1,118.



# INVOICE REPRINT

LABOR
PARTS
MISC
SUBLET
SUBTOTAL

SHOP SUPPLIES

TAX

TOTAL

51,226.66

# Invoice

Date	Invoice #
1/15/2016	36575

Bill To	Ship To
	Fig. 1
	and the second s

	P.O. No.	Terms	Rep	Ship Date	Ship Via	Job #
T-49	,	Net 30	RR	1/15/2016		10173
Item	Qty		Description		Unit Pric	
1002	1 (1 M (1	Pebvilo  /-/5-/	BR MODEL TOMER DECL  uri Sales Tax	INED) parts on	1.	
					Total	

Payments/Credits

**Balance Due** 

\$995.85

	PA	ARTS INVOICE	
	NUMBER DATE PO# SALES PERS		464:01 1/12/2016 T-49
10	SHIP TO	L	50045
TERMS AR REFERENCE	SHIP VIA WILL CALL BL#	UNIT	EXTD PRICE
QTY B/O ITEM  1 100D/A22-51037-010	PANEL-DASH, INSTRUMENT, TAUPE	CNII	TRICE

Replace Dash 1-13-2016

> 165,884 1,704 hows

SUB TOTAL TAX	
BALANCE DUE	3,071.67

#### PARTS INVOICE

NUMBER X100400644:01

DATE

01/13/2016

POS

T-46 / ISRAEL

SALES PERSON

CHRIS

то	SHIP TO		5
MS AR REFERENCE E100135920	SHIP VIA WILL CALL BL# DESCRIPTION	UNIT	I P
	PANEL-DASH, INSTRMNT CLSTR SURR		

RGE GNALL RETURNED PARTS. MCKAGING FULLY ASSEMBLED

SUB TOTAL TAX	4
BALANCE DUE	510.15

PARTS INVOICE

NUMBER

X100400391:01

DATE

PO#

SALES PERSON

LOHMAN

11.10	SHIP TO 50045	5004
	SHIP VIA WILL CALL BL#	
RMS AR REFERENCE	SHIP YIA MILE OUT	EXII PRICI
	PROPRIETION	6.111
OTY BO ITEM	DESCRIPTION	371 5
QTY B/O ITEM  1	PUMP-STEERING.TRW.EV.252418L30  VOLT METER. NGI. BRT. STD  TACH NGI BRT STERLIN  FREIGHT-D A22-54079-54083  FREIGHT-D 14-19496-003	971.0

Replace Power Steering Pump Volt Meter Tachometer

1-13-2016

165,884

SUB TOTAL TAX	669.74
BALANCE DUE	712.10

PICK-UP Page 1

0000000
10 088392
PO# T49

SA Code 00
T


GLD

1/11/2016

16:45:57

Please visit our website at: www.cpower.com Unit 0460787256 KISSICK CONTRUCTION EQUIPMENT MAKE STERLING ENGINE MAKE MERCEDES ENGINE MODEL NUMBER 4067-MT6E EQUIPMENT S/N (VIN) 2FZMAZCV45AN70852 29-NOV-2004 DELIVERY DATE L9500 EOUIPMENT MODEL Arrival Time: 12/29/15 13:55 Close Time: 0/00/00 TRUCK#:T49 VEH MILES: KEY#: PPM PPM FREEZE PROTECTION: INHIBITOR LEVEL(in) (f) INHIBITOR LEVEL(out) ENG SERIES NEW OR REPLACEMENT SERIAL # FINAL INSPECTION VERIFIED BY: COMPLAINT: METAL IN OIL. CAM BEARING FAILURE. ENGINE REPLACEMENT NEEDED. CAUSE: CORRECTION: PULLED TRUCK IN SHOP AND REMOVED COMPONENTS TO GAIN ACCESS TO THE ENGINE. REMOVED ENGINE AND TRANSMISSION ASSEMBLY. REMOVED TRANSMISSION AND INSPECTED THE CLUTCH. CLUTCH ROUGHLY 75%. CUSTOMER DECLINED REPLACEMENT AT THIS TIME. SWAPPED OVER COMPONENTS TO THE NEW ENGINE. REPLACED THE MOTOR MOUNTS. REINSTALLED THE TRANSMISSION AND REINSTALLED THE ENGINE ASSEMBLY REINSTALLED ALL COMPONENTS THAT WERE REMOVED TO GAIN ACCESS. FILLED WITH FLUIDS. RAN ON THE DYNO ENGINE PRODUCED GOOD POWER PER DDC SPEC. STEAM CLEANED THE ENGINE AND CHECKED FOR LEAKS. NONE Mile Warranti 165,884 1-11-2016 **PAY THIS** AMOUNT

FICK-UP Page 2	Job Number 10 000000 FOR T49 SA Cods 00 T GLD 1/11/2016	16:45:57 57ING CEL FOR THE TACH. BOTH INDERALING ALL OPERATION ORAY. THE BOUND WE EQUIND THE CHAIN OF EQUIND ALL OPERATION ORAY TO ALL OPERATION ORAY AT YOUR BUSINESS.		ALT THESE TANDONA	
		ECUND. TRUCK HAD A PREKISTING CELFOR THE TACH. TACH GAUGE AND VOLT GANGE BOTH INDERALINE. CHECKED CHRAGINS SYDEM. ALL OPERATION ORAY. HILE GOING TOCELER MITH THE BURDING RE FOUND RELACE FROM THE STAFFER. OUT THE ORAY TO RELACE FROM THE CUSTOMER. ALL OPERATION ORAY AT OPERATION OPERATION CUSTOMER COMPLAINT DIRECTOR BUSINESS. SES	Obsertion   Description   Part   Number   STEP UP 4 OPERATION   Part   Number   STEP UP 4 OPERATION   Part   Number   STEP UP 4 OPERATION   STEP UP 4 OP	TOTAL UNITS PART TOTAL COMB TOTAL PREGAT SANDU	

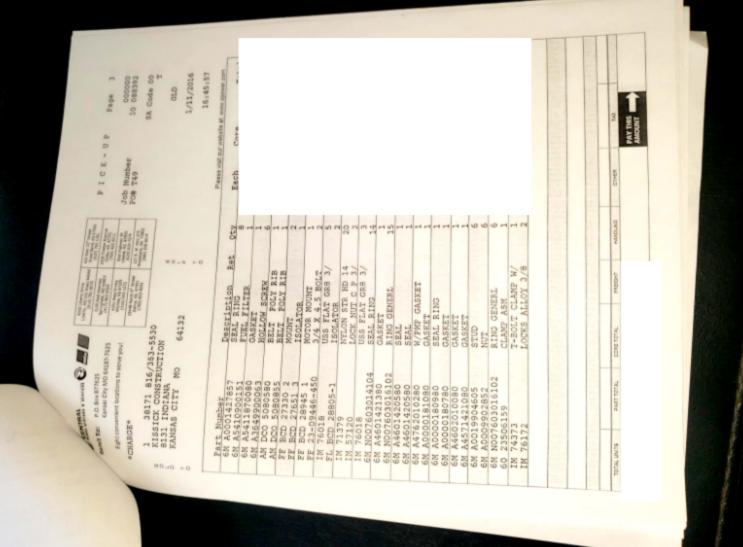

PICK-UP Page 4

Job Number 10 088392
PO# T49

SA Code 00
T

GLD

1/11/2016

16:45:57

				Please visi	t our website at, ww	w.cpower.com
		77557	Ohir	Each	Core	Tota
Part Number	Description	Ret	Oty			
IM 40150	FN HEX 8 PI	1/4	1			
IM 76511	SAE FLAT GE	8 1/	2			
AM DN X007785	SEALCLAMP		1			
AM DN J024838	FIX CNNCTR		1			
ZH 62X6	102-30000-0	01 00	ī			
ZH 1484X6	1) INSERT A	IR BR	1			
AM DR 820028	7 39MT IMS F	OK MD	1_			
AM RGT 032868	O RING SIE	ERING	1			
6M A457014022	2 0/2 000000		1			
AM DN P55106	FF/NO DIE		1			
AM DN P52768	A THE PRIMITED	pr 1	10			
IM 71353-7	DI.ASTIC MA	DE 1	10			
IM 71353-5	PLASTIC WI SEAL-A-CRI	MP BU	4			
IM 71892	SEAL-A-CRI	1/4	10			
IM 75100	ELECT TAPE	33-P				
TM 71639	DUDCI.PLS		12			
OD 23519396	**************************************	GINE C	1-			
CM D23534765	FGR COOLER	2	1-			
CM DA4601420	TURBOCHARO	ER C	1-			
6M EA0100960	AIR COMPRE	SSR C	1-			
6M RA4571306 6M RA4601420	/ 1	-			17	
	mintion					
Operation	CHASSIS DYNO TEST		132200			
132001	CHASSIS DYNO TEST 1900E7 INCLUDES:	1321007	2200	11-16		
	DD15 INCLUDES: 13	2100,015	2244			
1.1.00	Description	2				
Operation 011005	STEAM CLEAN ENGIN	5		Selection of		
Operation	Description					
V P E E E			THE STATE OF			
W. 17		17 12 15 1				
211				O EXPLOYER		
	and the state of the state of the	1-11-11		4 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	TAX	
		emmeter.	HANDLING	OTHER	THE REAL PROPERTY.	
	CORE TOTAL	PREIGHT			PAY THIS AMOUNT	

PICK-UP Page 5

Job Number 0000000
10 088392

SA Code 00
T

GLD

1/11/2016
16:45:57

Please visit our website at www coower.com Operation 132100 Description REPAIR VALIDATION Sea TOTAL UNITE PART TOTAL CORF TOTAL FREIGHT OTHER HANDLING 30493.72 PAY THIS AMOUNT

SERVICE INVOICE

NUMBER

R100168065:01

DATE

8/28/2015 T-49 BRENT

EXTD

PRICE

PO# ADVISOR

BILL TO DELIVER TO 50045 50045 W CUSUNIT# T-49 VIN 2FZMAZCV45AN70852 (05 STLLT9500) UNIT ID 367590 TERMS AR OPENED 08/10/2015 ODOMETER IN/OUT 164,688/164,688 JOB #1 61 - HEAVY DIESEL ENGINE CONDITION TOWED IN. CHECK AND ADVISE FOR ENGINE CRANKS BUT WONT START CAUSE

CORRECTION

went out to the truck, the truck started right up, let the truck run for about 30 mins, turn the truck off, start, the truck right back up, check to see if any codes are in the system and there wasnt any codes, ck to see if the eng hrs. displayed and they did display. check to see if someone have put a clutch in lately and the clutch looks pretty old, start the truck and cut the truck off a few times and everything seems to be working fine. START THE TRUCK RICHT UP. . Checked all the fuses in the cab and relays all good , fuses for the engine , no breakers , check out the relays and fuse out on fender , found relay R\_L control the engine and fuse MM., let run for awhile and relay R-L gets hot , replaced relay and let run and reassemble

install axlewith new gasket from tow in

install ax ewith new gr		TRICE
	DESCRIPTION	610.00
QTY ITEM	LASOR FOR REPAIRS	
	GASKET-AXLE SHAFT, 7.00, 8,.66.	
1 1000/11-14418-000	DELAY	701.35
1 100F/F5TZ14N0898	COMPUTER USAGE CHARGE	Job# 1 701.33
1 DIAG		

JOB #2 0 - SEE COMMENTS

CONDITION drain fuel from tanks and refill with new fuel

CAUSE CORRECTION Drained out 100 gallions	of red fuel and pumped in new.	
CORRECTION	DESCRIPTION	
QTY ITEM	LABOR FOR REPAIRS	
	FUEL FOR TRUCK	
1 606		

360.45 Job# 2

8-28-15 1692 hrs Engine Dies Replaced R-L Relay

\*\*\* BALANCE DUE \$1,217.11 \*\*\*

R100168065:01

AR

LABOR
PARTS
DIAGNOSTICS
GAS/OIL/GRS
SHOP SUPPLIES

SUB TOTAL
TAX
BALANCE DUE

1,217.11

Page	1
Invoice No.	239457
Invoice Date	05/28/14
Order No.	47104

Bill To: Customer No.

Ship To

T-40

2FZMAZOB458N70852 P.W.O. NO. 303 15197 CHS HRS, 161358 MILES, 1129 BDY HR

Customer PO

Salesperson
Company Contact
Shipping Method
STEVE WILLIAMS
SHOP SERVICE

Date Requested
Date Shipped
Entered By
Terms

04/14/14
05/28/14
JRB
NET ON RECEIPT

		JAD	-7-7-1			T	Extension
Item Number	Description	Qty Ordered	Qty Shipped	Qty Back Ordered	Unit Price	Disc %	
400	25M42A1C20 MOTOR	1.00	1.00				
46846D	GAUGE-PRESS-0-5000PSI-VACTOR L	1.00	1.00				
70318	QUICK CONNECT-1/4-FEMALE	1.00	1.00				
KEYSTL	SHOP SUPPLIES	1.00	1.00				
LABOR	SHOP	4.00	4.00			Mona	<b>TM</b>

- -REAR SLUDGE PUMP NOT WORKING
- -REMOTE TACH NOT WORKING
- -REMOTE PRESSURE GAUGE NOT WORKING

REAR SLUDGE PUMP WAS PACKED FULLOF DEBRIS CLEANED OUT, HYD PUMP TO RUN PUMP LOCKED UP. (CUSTOMER ADVISED THAT THEY WOULD CHANHE HYD. MOTOR)

CHECKED OPERATION OF THE TACH, FOUND THAT HAD WRONG SENSOR WIRED IN. (CUSTOMER ADVISED THEY WOULD PUT ON NEW SENSOR ON) FOUND NOTHING WRONG WITH THE REMOTE PRESSURE GAUGE AT THIS TIME

Thank you for your business!

All returns subject to restocking fee.

APPROVED T-49

RECEIVED

4 20 184

KISSICK CONFITTION ON

Thank You

Signature :

INVOICE NO. DATE 3-17780 04-04-14 nvoice CUSTOMER PO NO CUSTOMER NO 57901 T-49 3-86479 OHIP DATE B/O PAGE CODES SLSM **TERMS** 04-02-14 1 GW NET 10TH SOLD TO: Shipped To: ITEM QUANTITY NO. PROD. ORDERED SHIP LIST UNIT PRICE EXTENSION B/O PART NUMBER DESCRIPTION PRICE 1 1 1 072 MU-155698-XB7 CARBOTIC 1700FT LBS COR 072-C13500C \*\*\* Core \*\*\* T-49 1129 hours 4-10-14 Replaced Clutch, pilot, throwant & flywal re-surfaced of \$ 5kme value for high-Low. Replaced input shoft & bearing.
Replaced steering assist cylinder
Replaced Air drier Total Merchandise . Total Cores RECEIVED BY \_ Tax Amount

SEE WARRANTIES ON REVERSE SIDE 732.16

.....> Invoice Total

		DATE	INV	CICE NO	,
Invoice	04	04-07-14			,
	CUSTON	ER PO NO	CUSTO	MER N	9
	T-	49	57	7901	
MS	SLSW	CODES	80	PAGE	ı
10TH	FF		Y	1	

EM O.	ORDERED	QUANTITY	B/O	PRO0 LINE	PART NUMBER	DESCRIPTION	PRICE UNIT PRICE EXTENSION
1 2 3	1 1 1	1 1 1	(	0 342	FLYWHEEL1 A0099817225 G56124-0404	REGRIND FLAT FLYWHEE PILOT BEARING, MERCE 1/4NYLON X 1/4PIPE	
							0.75

SHIP DATE

04-07-14

NET .

Total Merchandise

Tax Amount
.....> Invoice Total

RECEIVED BY \_\_\_

REFERENCE

3-86766

## PARTS INVOICE

NUMBER

x100299689:01

DATE

04/07/2014

PO#

T-49/DONNIE GARTON

SALES PERSON

BILLTO		SHIP TO		50045
		SHIP VIA WILL CALL BL#		
TERMS AR	REFERENCE E100098901		UNIT	PRICE
QTY B/O		DESCRIPTION STOC BY ASSIS		-
1	100D/14-15201-000 N70852.	CYLINDER-STRG.RH ASSIS		

# SHIP VIA WILL CALL

SUB TOTAL TAX	
BALANCE DUE	832.07

DATE	INVOICE NO.		
04-08-14	3 - 17894		
CUSTOMER PO. NO	CUSTOMER NO.		
T-49	57901		

CACE	SHIP VIA	SHIP DATE	TERMS	SLSM	CODES	80	PAGE
REFERENCE 3-86887		04-08-14	NET 10TH	FF		Y	1
3-80007							

SOLD TO: Shipped To:

1 2 3 4 5 6 7 8	1 1 1 1 1	1 1 1	B/O 0 0	110	< *** Work Order# 3 21330	-17711 116RT016908LLX CYLINDER SHIFT	REMAN FULLE	R TRANS ***	**
2 3 4 5 6 7	1 1 1	1	0	110	< *** Work Order# 3 21330	-17711 116RT016908LLX	REMAN FULLE	R TRANS ***	>
9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24	1 1 1 1 1 1 1 1 1 1		0 0 0 0 0 0 0 0 0 0 0	110 110 110 110 110 110 163 110 8 110N-F	K2054 20550 S1659 14750 16980 14311 4302676 X12-1207 81504 FREIGHT IN REPLACE INPUT AND BEL FOUND SHIFT CYLINDER HOVE. REPLACED CYLINI SHIFTS FINE NOW. 10 WARRANTY ON REPAIR 10 OIL IN UNIT EARS LABOR HOP SUPPLIES	PISTON KIT O RING KIT FRT BRG COVER (2"PUL INPUT SHFT 2" PULL INTERNAL SNAP RING SNAP RING GASKET-FRONT BRG COV GASKET SHIFT BAR HSG 3/4 MAGNETIC PIPE PL BEARING BALL  ARING CHECK OUT LOW GEAF RUSTED REAL BAD PISTONS OF	R. DULD NOT O O.RINGS	*****	**
									Ox

RECEIVED BY \_\_\_\_\_

Total Labor
Tax Amount
.....> Invoice Total

919.25