



COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
WHITE	03	FORD F-250	1FTNW21P63ED54818		189115/189126	T4818	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN03 DE			18:00 23MAR22		0.00	CC	11APR22
R.O. OPENED		READY	OPTIONS: ENG:6.0_Liter				

17:16 21MAR22	15:42 06APR22						
LINE OPCODE	TECH	TYPE	HOURS		LIST	NET	TOTAL

A Moved to: 35625C Line: A  
 MOVE Moved to: 35625C Line: A  
 999ISPLT  
 MOVE Moved to: 35625C Line: A  
 999ISPLT  
 MOVE Moved to: 35625C Line: A  
 999ISPLT  
 MOVE Moved to: 35625C Line: A  
 999ISPLT  
 MOVE Moved to: 35625C Line: A  
 999ISPLT  
 MOVE Moved to: 35625C Line: A  
 999ISPLT  
 MOVE Moved to: 35625C Line: A  
 999ISPLT  
 MOVE Moved to: 35625C Line: A  
 999ISPLT



B GLOW PLUG LIGHT COMES ON WHEN CONCERN IS PRESENT. BUT NO OTHER INDICATORS

INFO ADDITIONAL INFORMATION  
 2245 C  
 1 4C3Z\*8A616\*AA CLUTCH ASY - FAN  
 1 5C3Z\*12224\*A CONNECTOR - 3-WAY  
 1 3C3Z\*9D930\*AA WIRE ASY  
 1 3U2Z\*14S411\*JCA WIRE ASY  
 1 \*W302767\* HARDWARE - MISCELLANEOUS  
 1 \*W302725\* HARDWARE - MISCELLANEOUS


REPAIR PERFORM REPAIRS  
 2245 ISP  
 1 3C3Z\*6C315\*AA SENSOR - CRANKSHAFT POSITIO  
 1 8C3Z\*12K073\*A SENSOR - CAMSHAFT POSITION  
 1 3U2Z\*14S411\*CGC WIRE ASY

189115 REPLACED ICP SENSOR CONNECTOR, ROAD TEST AGAIN AFTER REPAIRS

**DISCLAIMER OF WARRANTIES:**  
 Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

X \_\_\_\_\_  
 Signature of Person Responsible OR Agent for Person Responsible

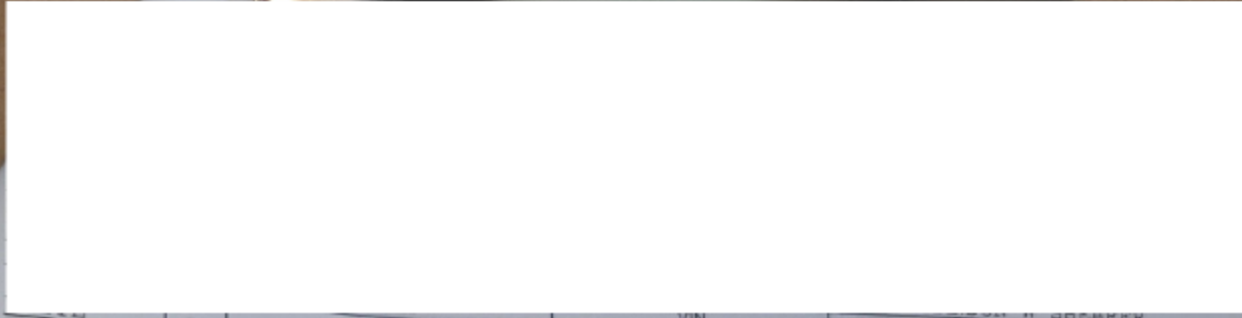

DEL. DATE	03	FORD F-250	VIN	LICENSE	MILEAGE IN / OUT	TAG
01JAN03 DD	PROD. DATE	WARR. EXP.	1FTNW21P63ED54818		189115/189126	T4818
R.O. OPENED		PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
	READY	18:00 23MAR22		0.00	CC	11APR22
17:16 21MAR22	15:42 06APR22	OPTIONS: ENG:6.0_Liter				

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

AND CONCERN PRESENT ON ROAD TEST. PERFORMED SELF TEST ON VEHICLE AND FOUND V-REF CIRCUIT FAULTS. INSPECTED AND FOUND WIRING CONNECTOR THAT IS BUILT INTO FAN CLUTCH LOOSE, REPLACED COOLING FAN CLUTCH. ROAD TEST AGAIN AFTER REPAIRS. ALL OK AFTER REPAIRS. REPLACED CMP AND CKP AND PIGTAILS, FOUND BARE WIRES ON INJECTOR WIRE HARNESS, REPLACED INJECTOR WIRE HARNESS, CLEARED CODES TEST DRIVE, RUNS GOOD.

\*\*\*\*\* THE FOLLOWING WORK NOT DONE-TRANSFERRED TO RO#35625C \*\*\*\*\*

A Moved to: 35625C Line: A  
 LC: A REF. RO: 26589 SVC PART  
 DATE: 07/22/20 SVC PART  
 DISTANCE: 14618



**DISCLAIMER OF WARRANTIES:**  
 Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly all either expressed or including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
<b>PLEASE PAY THIS AMOUNT</b>	<b>1167.44</b>

X \_\_\_\_\_  
 Signature of Person Responsible OR Agent for Person Responsible



DEL DATE	03	FORD F-250	VIN	LICENSE	MILEAGE IN / OUT	TAG
PROD DATE		WARR EXP	1FTNW21P63ED54818		189139/189145	T4818
01JAN03	DD		PROMISED	PO NO	RATE	PAYMENT
R.O. OPENED		READY	18:00 30MAR22		0.00	CASH
10:55 30MAR22	10:53 01APR22		OPTIONS			01APR22
			ENG:6.0_Liter			

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL  
 A CUSTOMER STATES THE VEHICLE STARTING LACKING POWER WHEN DRIVING AFTER PICKING VEHICLE UP. CHECK AND ADVISE

- CAUSE: INJECTORS
- 12650DD EEC SYSTEM DIAGNOSIS - (QUICK TEST) - N  
2245 W
- 2 3C3Z\*9E527\*ARM REMAN INJECTOR ASY - FUEL
- 1 \*W300020\* RING - SEALING
- 12650D45D ENGINE MODULE - DIAGNOSTIC PIN POINT TEST - L  
2245 W
- 12650DX1 EEC SYSTEM DIAGNOSIS - (QUICK TEST) - N  
EXTRA TIME TO REPEAT FINAL QUICK TEST  
2245 W
- 6005E HARD START / NO START DIAGNOSTICS - DIESEL ENGINE - DIAGNOSIS - L  
2245 W
- 6005E2 KEY ON ENGINE OFF - KOEO CHECK - TEST - L  
2245 W
- 6005E3 KEY ON ENGINE OFF - KOEO INJECTOR ELECTRICAL SELF-TEST - TEST - L  
2245 W
- 6005E4 SCAN TOOL TEST - DATA LIST MONITORING - TEST - L  
2245 W
- 9527AR FUEL INJECTOR OR NOZZLE FOR INJECTION PUMP - REPLACE (9F593/9E527/9H529) - L  
2245 W



FC: D42 01  
 PART#: 3C3Z\*9E527\*ARM  
 COUNT:  
 CLAIM TYPE: SPW  
 AUTH CODE:  
 2245

189139 VERIFIED CUSTOMER CONCERN. FOUND VEHICLE ALSO STARTS HARD.

**DISCLAIMER OF WARRANTIES:**

Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly all either expressed or including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

X \_\_\_\_\_  
 Signature of Person Responsible OR Agent for Person Responsible




WHITE	03	FORD F-250	1FTNW21P63ED54818	188144/188144	T4818
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	INVOICE IN / OUT TAG
01JAN03 DD			18:00 15NOV21		
R.O. OPENED	READY	OPTIONS: ENG:6.0_Liter	RATE	PAYMENT	INV. DATE
09:03 15NOV21	10:35 16NOV21		0.00	CASH	16NOV21

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL  
 A CUSTOMER STATES THERE IS AN ANTIFREEZE LEAK BY FRONT OF THE MOTOR.  
 CHECK AND ADVISE

- DIAG DIAGNOSIS  
 3033 C  
 1 3C3Z\*8501\*A PUMP ASY - WATER  
 1 FRT FRGHT FREIGHT  
 3 VC\*7DIL\*B ANTI-FREEZE

MISC OTHER  
 C  
 188144 3.50 VERIFY CONCERN, PRESSURE TEST SYSTEM AND FOUND LEAKING FROM WATER PUMP. REPLACE WATER PUMP. SERVICE COOLING SYSTEM USING BG ADDITIVES. FILL WITH FRESH COOLANT. TEST DRIVE AND VERIFY NO LEAKS.  
 \*\*\*\*\*  
 CUSTOMER PAY MISC. SHOP SUPPLIES FOR REPAIR ORDER

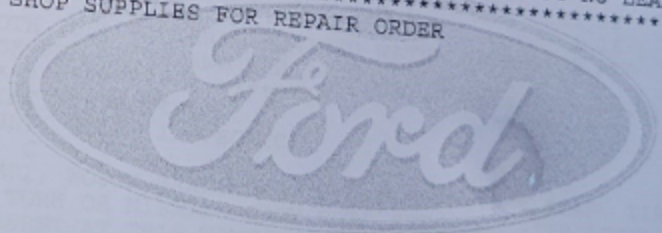

**DISCLAIMER OF WARRANTIES:**

Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly all either expressed or including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	849.77

X  
 \_\_\_\_\_  
 Signature of Person Responsible OR Agent for Person Responsible



COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG
WHITE	03	FORD F-250	1FTNW21P63ED54818		187565/187565	74818
DEL DATE	PROD DATE	WARR EXP	PROM/SED	PO NO.	RATE	PAYMENT
01JAN03 DL			18:00 28SEP21		0.00	CC
R.O. OPENED	READY	OPTIONS: ENG:6.0_Liter				

07:46 27SEP21 12:56 08OCT21

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

A PERFORM LUBE, OIL, AND FILTER CHANGE.  
 LOF PERFORM LUBE, OIL, AND FILTER CHANGE.  
 9043 C  
 1 FL\*2016\* KIT - ELEMENT & GASKET - OIL F  
 15 XO\*15W40\*BSD MOTORCRAFT SAE 15W-40 API CJ-4  
 1 PM\*4\*A BRAKE CLEANER  
 187565 PERFORMED LOF, TOP OFF FLUIDS



B REPLACE BOTH FUEL FILTERS, DRAIN WATER IN FUEL  
 6.0FILT REPLACE BOTH FUEL FILTERS, DRAIN WATER IN FUEL  
 9043 C  
 1 3C3Z\*9N184\*CB ELEMENT  
 1 PM\*4\*A BRAKE CLEANER  
 187565 REPLACED BOTH FUEL FILTERS. DRAINED WATER SEPARATOR AND PRIME SYSTEM. CHECK FOR LEAKS AND VERIFIED REPAIR.



C PERFORM MULTI POINT INSPECTION  
 99P PERFORM MULTI POINT INSPECTION  
 9043 C  
 187565 PERFORMED MPI, FOUND BRAKES ABOVE 7MM FRONT AND REAR. TIRES ABOVE 7/32. BOOTS TORN OR MISSING FROM DUAL STEERING STABILIZER KIT. NO OTHER CONCERNS PRESENT AT THIS TIME.



D SERVICE FRONT DIFFERENTIAL  
 FDIFF SERVICE FRONT DIFFERENTIAL  
 9043 C  
 MISC OTHER  
 C  
 187565 PERFORMED FRONT DIFF SERVICE. DRAINED AND FILLED WITH BO FLUID.



E PERFORM REAR DIFFERENTIAL SERVICE  
 RDIFF PERFORM REAR DIFFERENTIAL SERVICE

**DISCLAIMER OF WARRANTIES:**  
 Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly all either expressed or including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

X \_\_\_\_\_  
 Signature of Person Responsible OR Agent for Person Responsible

WHITE 03 FORD F-250 1FTNW21P63ED54818 187565/187565 T4818  
 DEL DATE PROD DATE WARR EXP PROMISED PO NO RATE PAYMENT INV DATE  
 01JAN03 DE 18:00 28SEP21 0.00 CC 08OCT21  
 R.O OPENED READY OPTIONS: ENG:6.0 Liter

07:46 27SEP21 12:56 08OCT21  
 LINE OPCODE TECH TYPE HOURS LIST NET TOTAL  
 999 C

J SERVICE TRANSFER CASE FLUID  
 TCASE SERVICE TRANSFER CASE FLUID  
 9043 C  
 3 XT\*10\*QLVC OIL - AUTOMATIC TRANSMISSION 8.35  
 187565 PERFORMED T-CASE SERVICE. DRAINED AND FILLED WITH FRESH FLUID.  
 \*\*\*\*\*  
 K\*\* REPLACE TURBO AND EGR VALVE FOR ADDITIONAL CEL CONCERNS.  
 REPAIR PERFORM REPAIRS  
 9043 C  
 1 F81Z\*8287\*EA CLAMP - HOSE  
 1 4C3Z\*9F452\*ARM REMAN VALVE ASY - MODULATOR  
 1 3C3Z\*6584\*BA GASKET - VALVE ROCKER ARM COVE  
 1 \*W302725\* HARDWARE - MISCELLANEOUS  
 1 PM\*4\*A BRAKE CLEANER

MISC OTHER  
 C  
 187565 REMOVED AND REPLACED TURBO, AND EGR VALVE. REPLACED TURBO, DRAIN AND FEED GASKETS AND MOUNTING HARDWARE. INSTALLED NEW UP PIPE CLAMP AND TORQUE TO SPEC. REMOVED AND REPLACED EGR VALVE. ROAD TEST VEHICLE AND MONITORED PIDS. FOUND VEHICLE NOW BUILD 22 PSI OF BOOST AND NO LONGER LACKS POWER. VERIFIED EGR VALVE OPERATION.  
 \*\*\*\*\*

CUSTOMER PAY MISC. SHOP SUPPLIES FOR REPAIR ORDER  
 LC: G REF. RO: 25202 SVC PART  
 DATE: 04/23/20 SVC PART  
 DISTANCE: 17372

**DISCLAIMER OF WARRANTIES:**  
 Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly all either expressed or including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
<b>PLEASE PAY THIS AMOUNT</b>	<b>2890.32</b>

X \_\_\_\_\_  
 Signature of Person Responsible OR Agent for Person Responsible



WHITE	03	FORD F-250	1FTNW21P63ED54818	LICENSE	MILEAGE IN/OUT	TAG
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT
01JAN03 DD			18:00 22JUL20			174497/174504 T4818
R.O. OPENED	READY	OPTIONS:	ENG:6.0_Liter	0.00	CHECK	30JUL20

12:07 22JUL20	17:51 30JUL20	LINE OPCODE	TECH TYPE	HOURS	LIST	NET	TOTAL
---------------	---------------	-------------	-----------	-------	------	-----	-------

A CUSTOMER STATES THE VEHICLE CRANKS AND WONT START WHEN HOT. WHEN VEHICLE DOES START, RPMS WILL GO TO 1500 FOR A SHORT TIME AND THEN COME BACK TO NORMAL. LACKS POWER WHEN DRIVING AND INTERMITTENT BLACK SMOKE FROM TAIL PIPE BUT DOES NOT FEEL LIKE A MISFIRE. CHECK AND ADVISE

DIAG DIAGNOSIS

- 3033 C
- 1 3C3Z\*9F838\*EA SENSOR ASY
- 1 3C3Z\*9A543\*AARM REMAN PUMP ASY - FUEL INJECTION
- 1 3C3Z\*9433\*BJ KIT - GASKET
- 2 3C3Z\*9439\*AA GASKET - INTAKE MANIFOLD
- 1 3C3Z\*6584\*BA GASKET - VALVE ROCKER ARM COVE
- 1 3C3Z\*6619\*EA GASKET
- 2 PM\*4\*A BRAKE CLEANER
- 2 VC\*7DIL\*B ANTI-FREEZE

174497 VERIFY CONCERN FOUND ICP READING INCORRECT, REPLACE SENSOR BUT VEHICLE STILL DOES NOT START. NO LEAKS FOUND WHEN AIR TESTING HIGH PRESSURE OIL SYSTEM. REPLACE HIGH PRESSURE OIL PUMP AND REPLACE ALL NECESSARY GASKETS AND HARDWARE. VEHICLE NOW STARTS AND RUNS AS INTENDED. TEST DRIVE AND VERIFY NO LEAKS.

B ALL FUEL INJECTORS AND EGR VALVE WERE REPLACED IN APRIL

INFO ADDITIONAL INFORMATION

999 C

C VEHICLE TOWED IN

TOW VEHICLE TOWED IN

999 C

D REPLACE LEFT FRONT WHEEL BEARING

INFO ADDITIONAL INFORMATION

3033 C

- 1 G2MZ\*1104\*AJ KIT - BRAKE REPAIR

DISCLAIMER OF WARRANTIES:


Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

X

Signature of Person Responsible OR Agent for Person Responsible


CUSTOMER COPY

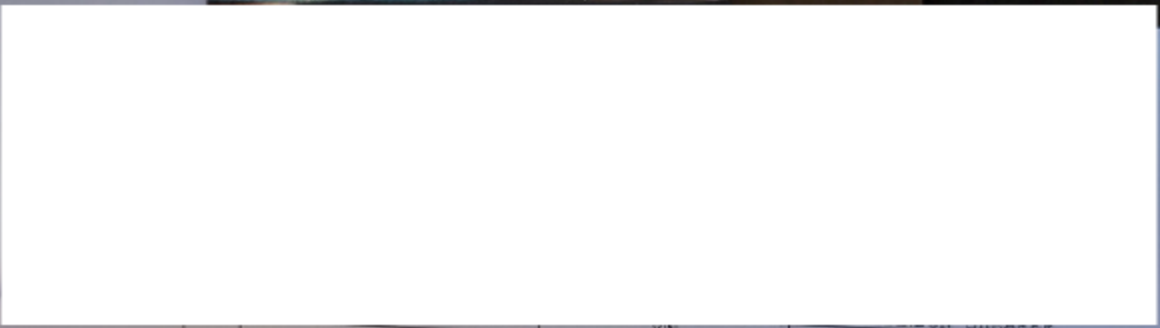

WHITE	03	FORD F-250	VIN	LICENSE	MILEAGE IN/OUT	TAG
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT
01JAN03 DD			18:00 22JUL20		0.00	CHECK
R.O. OPENED	READY	OPTIONS:	ENG:6.0_Liter			30JUL20

12:07 22JUL20	17:51 30JUL20						
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL

174497 REPLACE LOOSE LEFT FRONT WHEEL BEARING.  
 \*\*\*\*\*  
 E PERFORM LUBE, OIL, AND FILTER CHANGE.  
 LOF PERFORM LUBE, OIL, AND FILTER CHANGE.  
 3033 C  
 1 FL\*2016\* KIT - ELEMENT & GASKET - OIL F  
 15 XO\*15W40\*BSD MOTORCRAFT SAE 15W-40 API CJ-4  
 1 ZC\*32P32\*HG SOLUTION-WINDSHIELD WASHER  
 1 PM\*4\*A BRAKE CLEANER  
 174497 PERFORMED LOF, TOP OFF FLUIDS  
 \*\*\*\*\*  
 CUSTOMER PAY MISC. SHOP SUPPLIES FOR REPAIR ORDER

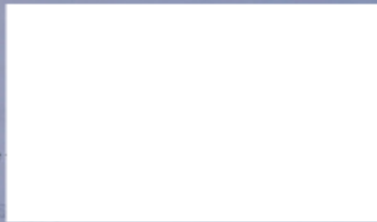


**DISCLAIMER OF WARRANTIES:**

Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly all either expressed or including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	2589.09

X \_\_\_\_\_  
 Signature of Person Responsible OR Agent for Person Responsible

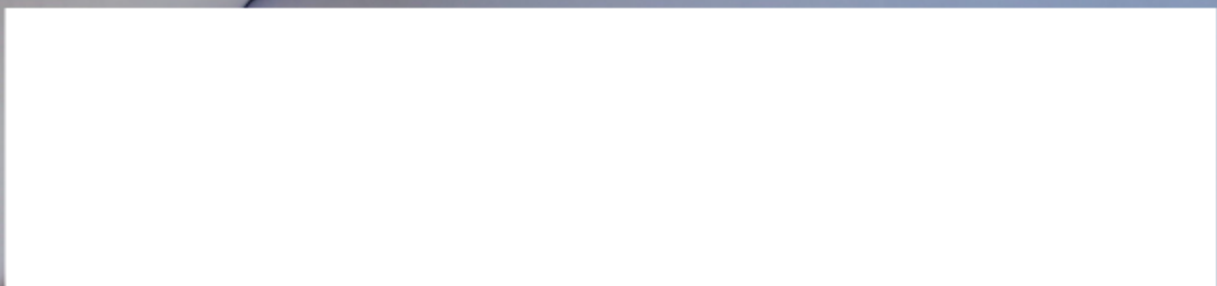

WHITE	03	FORD F-250	1FINW21P63ED54818	LICENSE	MILEAGE IN / OUT	TAG
DEL DATE	PROD DATE	WARR EXP.	PROMISED	PO NO	RATE	PAYMENT
01JAN03 DD			18:00 29APR20		0.00	CASH
R.O. OPENED	READY	OPTIONS	ENG:6.0_Liter			28APR20
13:33 23APR20	16:58 28APR20					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CUSTOMER STATES THE O/D LIGHT IS INOP AND TRANSMISSION WONT SHIFT IN ALL GEARS UNTIL ABOUT 2500 RPMS. SHIFTING CONCERN IS INTERMITTENT. CHECK AND ADVISE

DIAG DIAGNOSIS  
2245 C

1 3C3Z\*7210\*BBA LEVER - TRANSMISSION GEAR SHIF 89.03 1  
170193 VERIFIED CONCERN, OW HAUL BUTON NOT WORKING, FOUND WIRES DELAY  
BROKEN, REPLACE SHIFT HANDLE. NOW TOW HAUL IS WORKING. STILL HAS  
TO SHIFT WHEN COLD DUE TO ENGINE RUNNING POORLY. ADVISED OF FUEL  
INJECTOR REPLACEMENT

B P&A QUOTE FOR INJECTORS  
INFO ADDITIONAL INFORMATION  
999 C

C PERFORM MULTI POINT INSPECTION  
99P PERFORM MULTI POINT INSPECTION  
2245 C  
2 FL\*2016\* KIT - ELEMENT & GASKET - OIL F 32.11  
170193 PERFORM MPI, TIRES AND BRAKES ALL GOOD, LEFT FRONT WHEEL  
BEARING LOOSE.

D CUSTOMER STATES THE TIE ROD ADJUSTER IS TURNED AND CAUSING THE BOOT TO TEAR OFF. WANTS TO KNOW IF WE CAN ADJUST IT SO THAT ISN'T HAPPENING

DIAG DIAGNOSIS  
2245 C

170193 ADJUST STEERING DAMPER SHOCKS DOWN SO IT DOES NOT RUB ON THE DRAG LINK

E CUSTOMER STATES THERE IS ABOUT 2 IN PLAY IN THE STEERING BOX, DRIVES STRAIGHT BUT HAVE TO CONSTANTLY STEER, DOESN'T WANT TO PUT IN A NEW STEERING BOX IN, WONDERING IF WE CAN DO AN ADJUSTMENT'

DIAG DIAGNOSIS

DISCLAIMER OF WARRANTIES:		DESCRIPTION	TOTALS
Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly all either expressed or including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.		LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
		LESS INSURANCE	
SALES TAX			
		PLEASE PAY THIS AMOUNT	

X \_\_\_\_\_  
Signature of Person Responsible OR Agent for Person Responsible

CUSTOMER COPY

WHITE 03 FORD F-250 VIN 1FTNW21P63ED54818 LICENSE MILEAGE IN/OUT TAG  
 DEL DATE PROD DATE WARR EXP PROMISED PO NO RATE PAYMENT INV DATE  
 01JAN03 DD 18:00 29APR20 0.00 CASH 28APR20  
 R.O. OPENED READY OPTIONS: ENG:6.0\_Liter

13:33 23APR20 16:58 28APR20  
 LINE OPCODE TECH TYPE HOURS LIST NET TOTAL  
 2245 C

170193 NO LONGER RECOMMENDED TO ADJUST STEERING GEAR. ADVISED OF REPLACEMENT FOR CONCERN

\*\*\*\*\*  
 F\*\* PERFORM LUBE, OIL, AND FILTER CHANGE.  
 LOF PERFORM LUBE, OIL, AND FILTER CHANGE.  
 2245 C  
 1 FL\*2016\* KIT - ELEMENT & GASKET - OIL F  
 15 XO\*15W40\*BSD MOTORCRAFT SAE 15W-40 API CJ-4  
 1 3C3Z\*6766\*CA CAP ASY - OIL FILLER  
 170193 PERFORMED LOF, TOP OFF FLUIDS 15 QTS 15W40, FL-OIL, REFILL  
 OIL FILTER CAP

\*\*\*\*\*  
 G\*\* REPLACE BOTH FUEL FILTERS, DRAIN WATER IN FUEL  
 6.0FILT REPLACE BOTH FUEL FILTERS, DRAIN WATER IN  
 FUEL  
 2245 C  
 1 FD\*4616\* ELEMENT

170193 REPLACE FUEL FILTERS  
 \*\*\*\*\*


H\*\* REPLACE ENGINE AIR FILTER  
 AIRFILT REPLACE ENGINE AIR FILTER  
 2245 C  
 1 FA\*1778\* ELEMENT ASY - AIR CLEANER  
 170193 REPLACED ENGINE AIR FILTER

\*\*\*\*\*  
 I\*\* REPLACE FUEL INJECTORS PER PREVIOUS DIAG  
 REPAIR PERFORM REPAIRS  
 2245 C  
 8 3C3Z\*9E527\*ECRM REMAN INJECTOR ASY - FUEL  
 2 3C3Z\*6584\*BA GASKET - VALVE ROCKER ARM COV  
 1 \*W300020\* RING - SEALING  
 1 \*W302725\* HARDWARE - MISCELLANEOUS  
 1 4C3Z\*9F452\*ARM REMAN VALVE ASY - MODULATOR

**DISCLAIMER OF WARRANTIES:**  
 Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

X \_\_\_\_\_  
 Signature of Person Responsible OR Agent for Person Responsible

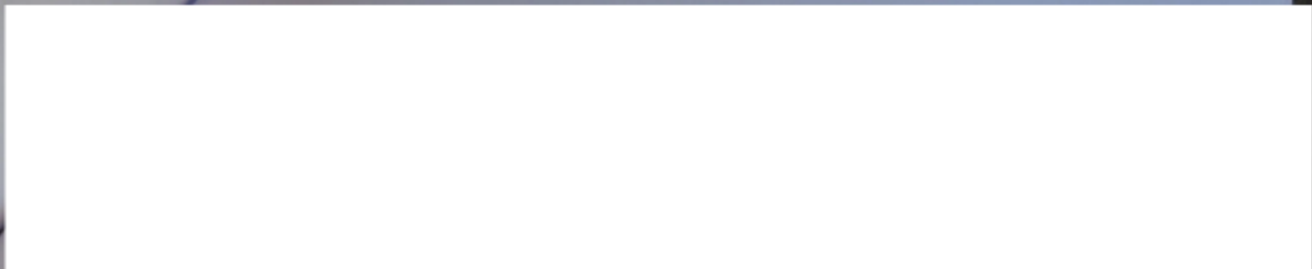

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	1FTNW21P63ED54818	LICENSE	MILEAGE IN/OUT	TAG
01JAN03	DD		18:00	29APR20		170193/170209	T4818
R.O. OPENED	READY		OPTIONS:	ENG:6.0_Liter	RATE	PAYMENT	INV. DATE
13:33	23APR20	16:58	28APR20		0.00	CASH	28APR20

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
				SOURCE 20			
170193				REPLACE ALL 8 FUEL INJECTORS, BOTH VALVE COVER GASKETS, OIL FILL TUBE O-RING, CRANKCASE BREATHER O-RING.			
*****							
				CUSTOMER PAY MISC. SHOP SUPPLIES FOR REPAIR ORDER			



**DISCLAIMER OF WARRANTIES:**  
 Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly all either expressed or including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
<b>PLEASE PAY THIS AMOUNT</b>	<b>3702.10</b>

X \_\_\_\_\_  
 Signature of Person Responsible OR Agent for Person Responsible

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	1FTNW21P63ED54818	PO NO.	RATE	PAYMENT	163243/163249 T4818	TAG
01JAN03 DD			18:00	01NOV19		0.00	CC	09NOV19	
R.O. OPENED	READY		OPTIONS: ENG:6.0_Liter						

07:50	31OCT19	08:59	09NOV19						
LINE OPCODE	TECH	TYPE	HOURS						
A	CUSTOMER STATES THE BATTERY LIGHT IS ON AND ALTERNATOR IS NOT CHARGING PROPERLY								
	DIAG DIAGNOSIS								

2245 C  
 1 4U2Z\*10V346\*CFRM REMAN ALTERNATOR ASY  
 1 VERIFIED CONCERN, BATTERY LIGHT ON AND ALTERNATOR NOT CHARGING, REPLACE ALTERNATOR.

B REPLACE BATTERY AND CLEAN TERMINALS  
 BATT REPLACE BATTERY AND CLEAN TERMINALS  
 2245 C  
 2 BXT\*65\*850 BATTERY  
 2 \*985\* BATTERY PADS  
 1 REPLACE BATTERIES AND CLEAN CABLES.

C REPLACE SERPENTINE BELT  
 SERP REPLACE SERPENTINE BELT  
 2245 C  
 1 3C3Z\*8620\*DB V-BELT  
 1 REPLACE BELT

D PERFORM MULTI POINT INSPECTION  
 99P PERFORM MULTI POINT INSPECTION  
 2245 C  
 1 PERFORM MPI, FRONT TIRES AT 4/32, REAR TIRES AT 3/32, FRONT BRAKES AT 3MM REAR BRAKES AT 5 MM.

E VEHICLE NEEDS JUMP STARTED AND CURRENT ODOMETER INFO ADDITIONAL INFORMATION  
 999 C

F\*\* REPLACE FUEL FILTER  
 6.0FILT REPLACE BOTH FUEL FILTERS, DRAIN WATER IN FUEL

**DISCLAIMER OF WARRANTIES:**  
 Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

X \_\_\_\_\_  
 Signature of Person Responsible OR Agent for Person Responsible

CUSTOMER COPY

DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	MILEAGE IN/OUT	TAG
01JAN03 DD			18:00 01NOV19		0.00	CC	09NOV19	163243/163249	T4818
R.O. OPENED			READY	OPTIONS: ENG:6.0_Liter					
07:50	31OCT19	08:59	09NOV19						
LINE OPCODE			TECH	TYPE	HOURS	LIST	NET	TOTAL	
2245			C						

1 FD\*4616\* ELEMENT  
 1 REPLACE FUEL FILTERS  
 \*\*\*\*\*  
 G\*\* INSPECT FRONT END FOR RATTLE AND LOOSE COMPONENTS  
 REPAIR PERFORM REPAIRS  
 2245 C  
 2 2C3Z\*5484\*AA BUSH  
 1 1C3Z\*5K483\*BB LINK  
 1 1C3Z\*5K483\*BA LINK  
 1 REPLACE FRONT SWAY BAR LINKS AND BUSHINGS  
 \*\*\*\*\*  
 CUSTOMER PAY MISC. SHOP SUPPLIES FOR REPAIR ORDER



**DISCLAIMER OF WARRANTIES:**

Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly all either expressed or including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
<b>PLEASE PAY THIS AMOUNT</b>	<b>1364.37</b>

X \_\_\_\_\_  
 Signature of Person Responsible OR Agent for Person Responsible

WHITE 03 FORD F-250 VIN 1FTNW21P63ED54818 LICENSE MILEAGE IN / OUT TAG  
 DEL. DATE PROD. DATE WARR. EXP. PROMISED PO NO. RATE PAYMENT INV. DATE  
 01JAN03 DD 18:00 29JUL22 0.00 CASH 10AUG22  
 R.O. OPENED READY OPTIONS: ENG:6.0\_Liter

07:35 26JUL22 12:29 10AUG22  
 LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

A CUSTOMER STATES THE ENGINE CRANKS AND WONT START. PRESENT AFTER DRIVING FOR A WHILE AND THEN SAT FOR ABOUT TWO HOURS  
 DIAG DIAGNOSIS  
 2245 C  
 1 3C3Z\*9C968\*AA REGULATOR - FUEL PRESSURE  
 6 3U2Z\*14A088\*BA KIT - TERMINAL  
 9 MISC WIRE

191446 DUPLICATE CONCERN AFTER LONGER ROAD TEST, WOULD NOT START FOR ABOUT 15 MINUTES AFTER SHUTTING OFF. CHECK CODES, P2287 KOER, AND RUNS ROUGH WHEN DOING KOER SELF-TEST, REPLACED IPR VALVE AND OVERLAID WIRES FOR ICP SENSOR, CLEARED CODES, NOW PASSES KOER SELF-TEST AND RUNS SMOOTH. RESTARTS AS INTENDED AFTER LONGER ROAD TEST.  
 \*\*\*\*\*

B NEED SERVICE HISTORY  
 INFO ADDITIONAL INFORMATION  
 2245 C  
 \*\*\*\*\*

C CUSTOMER STATES THE VEHICLE HAS A VIBRATION DURING HARD BRAKING. DOES KNOW ABOUT BAD BALL JOINTS  
 DIAG DIAGNOSIS  
 2245 C  
 2 4C3Z\*3049\*DB JOINT ASY - BALL  
 2 BC3Z\*3050\*B JOINT ASY - BALL  
 2 F81Z\*1S175\*HCA SEAL  
 2 3C3Z\*3254\*CA SEAL ASY - OIL  
 2 F81Z\*4A322\*AA SEAL  
 4 COTTER PIN

191446 CONCERN PRESENT FROM FRONT BRAKE ROTORS BEING WARPED BADLY. UPPER AND LOWER BALL JOINTS LOOSE. REPLACED ALL BALL JOINTS AND 4X4 SEALS.  
 \*\*\*\*\*

D DETAIL VEHICLE WHEN DONE  
 INFO ADDITIONAL INFORMATION  
 2245 C

**DISCLAIMER OF WARRANTIES:**  
 Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

X \_\_\_\_\_  
 Signature of Person Responsible OR Agent for Person Responsible

DEL. DATE	03	FORD F-250	1FTNW21P63ED54818	LICENSE	MILEAGE IN / OUT	TAG
01JAN03	DI	WARR. EXP.	PROMISED	PO NO.	191446/191461	T4818
R.O. OPENED	READY	18:00	29JUL22	RATE	PAYMENT	INV. DATE
07:35	26JUL22	12:29	10AUG22	0.00	CASH	10AUG22

LINE OPCODE TECH TYPE HOURS  
 1 DETAIL DETAIL

E\*\* REPLACE FRONT BRAKE PADS, MACHINE ROTORS/DRUMS, CLEAN AND ADJUST CALIPERS

- BRAKEFRONT REPLACE FRONT BRAKE PADS, MACHINE ROTORS/DRUMS, CLEAN AND ADJUST CALIPERS
- 2245 C
- 1 YUZZ\*2V001\*BA PAD
- 2 1C3Z\*1V125\*G ROTOR ASY
- 1 PM\*4\*A BRAKE CLEANER

191446 SEE LINE C

F\*\* PERFORM ALIGNMENT CHECK  
 ALIGN2 PERFORM FRONT END ALIGNMENT

- 2245 C
- 191446 PERFORMED ALIGNMENT, SET TOE

G\*\* PERFORM LUBE, OIL, AND FILTER CHANGE.  
 LOF PERFORM LUBE, OIL, AND FILTER CHANGE.

- 2245 C
- 1 FL\*2016\* KIT - ELEMENT & GASKET - OIL F
- 15 XO\*15W40\*BSD MOTORCRAFT SAE 15W-40 API CJ-4
- 1 ZC\*32P32\*HG SOLUTION-WINDSHIELD WASHER

191446 PERFORMED LOF, TOP OFF FLUIDS, 15 QTS 15W40, FL-2016

H\*\* PERFORM MULTI POINT INSPECTION  
 99P PERFORM MULTI POINT INSPECTION

- 2245 C
- 191446 PERFORMED MPI, WINDSHIELD HAS CRACK, STEERING DAMPER SHOCK LEAKING.

CUSTOMER PAY MISC. SHOP SUPPLIES FOR REPAIR ORDER

**DISCLAIMER OF WARRANTIES:**

Any warranties on the product sold hereby are those made by the manufacturer. The seller, FRIESEN FORD, INC., hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and FRIESEN FORD, INC. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	3126.33

X

Signature of Person Responsible OR Agent for Person Responsible